# **MR8847A**



MR8847-51 MR8847-52 MR8847-53

Instruction Manual

## **MEMORY HICORDER**



#### Video

Scan this code to watch the instructional video(s). Carrier charges may apply.



**EN** 

Be sure to read this manual before using the instrument.		
When using the instrument for the first time	Troubleshooting	
Part Names and Functions <a> p.18</a>	Maintenance and Service 🕨 p.431	
Preparing for Measurement <a> p.27</a>	Error Messages <b>•</b> p.437	

Apr. 2021 Revised edition 6 MR8847G961-06 21-04H



1

2

3

4

5

6

### Contents

Usage Index	1
Introduction	2
Verifying Package Contents	3
Safety Information	4
Operation Precautions	7

### 1 Overview 17

1.1	Product Overview	17
1.2	Part Names and Functions	18
1.3	Screens Configuration	21
	Explanation of screen contents	22
1.4	Basic Key Operation	23
1.4.1	Using the HELP Key	24
1.4.2	Using Mouse to Enable Key Operation	25

### 2 Preparing for Measurement 27

2.1	Installing and Removing	
	Modules	28
	Channel configuration	29
2.2	Attaching Connection Cables	30
2.3	Preparing Storage Devices	47
2.3.1	Available Storage Devices (Inserting a	
	CF Card and a USB Flash Drive)	47
2.3.2	Formatting Storage Devices	49
2.4	Loading Recording Paper	49
2.5	Supplying Power	51
2.5.1	Connecting the Power Cord	51
2.5.2	Connecting an Earthing Wire to the	
	GND Terminal (Functional Earth Termina	l)51
2.5.3	Turning On and Off the Instrument	52
2.6	Setting the Clock	53
2.7	Adjusting the Zero Position	
	(zero-adjustment)	54
2.8	Performing Calibration (When	
	Model MR8990 is Installed)	55
2		
3	Measurement	57

3.1 3.2	Measurement Procedure57 Inspecting the Instrument	7
	Before Measurement 59	)
3.3	Setting Measurement Conditions 60	)
3.3.1	Measurement Functions60	)
3.3.2	Timebase and Sampling Rate62	2
3.3.3	Setting the Recording Length	
	(Number of Divisions)66	3
3.3.4	Setting Screen Layout69	9

3.4	Configuring Input Channels	
	Settings	. 70
3.4.1	Channel Setting Procedure	71
3.4.2	Configuring Analog Channels Settings	73
3.4.3	Configuring Logic Channel Settings	76
3.4.4	Display Sheet	78
3.5	Starting and Stopping	
	Measurement	. 79
3.6	Measurement in Automatic	
	Range Setting (Auto-Range	
	Function)	82
4	X-Y Recorder	85
4.1	Measurement procedure	. 86
4.2	Setting Measurement Condition	s 87
4.3	Starting and Stopping	
	Measurement	. 88
4.4	Observing X-Y Composite	
	Curves	. 90
5	Saving/Loading Data	
	and Managing Filos	01
	and managing rifes	31
5.1	Data That Can Be Saved and	
	Loaded	. 93
5.2	Saving Data	. 95
5.2.1	Save Types and Setting Procedure	95
5.2.2	Automatically Saving Waveforms	96
5.2.3	Saving Data Selectively (SAVE Key)	. 103
5.2.4	Saving Waveform Outputting Data to a	
	Storage Device	
5.3		. 109
0.0	Loading Data	. 109 . <b>110</b>
5.4	Loading Data Automatically Loading Settings	. 109 . <b>110</b>
5.4	Loading Data Automatically Loading Settings (Auto-setup Function)	. 109 . <b>110</b> . <b>113</b>
5.4 5.5	Loading Data Automatically Loading Settings (Auto-setup Function) Managing Files	. 109 . <b>110</b> . <b>113</b> . <b>114</b>
<b>5.4</b> <b>5.5</b> 5.5.1	Loading Data Automatically Loading Settings (Auto-setup Function) Managing Files Saving Data	. 109 . <b>110</b> . <b>113</b> . <b>114</b> 115
<b>5.4</b> <b>5.5</b> 5.5.1 5.5.2	Loading Data Automatically Loading Settings (Auto-setup Function) Managing Files Saving Data Checking the Contents in a Folder	. 109 .110 .113 .113 .114 115
<b>5.4</b> <b>5.5</b> 5.5.1 5.5.2	Loading Data Automatically Loading Settings (Auto-setup Function) Managing Files Saving Data Checking the Contents in a Folder (Opening a Folder)	. 109 .110 .113 .113 .114 115 118
<b>5.4</b> <b>5.5</b> 5.5.1 5.5.2 5.5.3	Loading Data Automatically Loading Settings (Auto-setup Function) Managing Files Saving Data Checking the Contents in a Folder (Opening a Folder) Creating New Folders	. 109 .110 .113 .113 .114 115 118 118
<b>5.4</b> <b>5.5</b> 5.5.1 5.5.2 5.5.3 5.5.4	Loading Data Automatically Loading Settings (Auto-setup Function) Managing Files Saving Data Checking the Contents in a Folder (Opening a Folder) Creating New Folders Deleting Files and Folders	. 109 .110 .113 .114 115 118 118 119
<b>5.4</b> <b>5.5</b> 5.5.1 5.5.2 5.5.3 5.5.4 5.5.5	Loading Data Automatically Loading Settings (Auto-setup Function) Managing Files Saving Data Checking the Contents in a Folder (Opening a Folder) Creating New Folders Deleting Files and Folders Sorting Files	. 109 .110 .113 .113 113 115 118 118 119 120
<b>5.4</b> <b>5.5</b> 5.5.1 5.5.2 5.5.3 5.5.4 5.5.5 5.5.6 5.5.6	Loading Data Automatically Loading Settings (Auto-setup Function) Managing Files Saving Data Checking the Contents in a Folder (Opening a Folder) Creating New Folders Deleting Files and Folders Sorting Files Renaming Files and Folders	. 109 .110 .113 .114 115 118 118 118 119 . 120 . 121
<b>5.4</b> <b>5.5</b> 5.5.1 5.5.2 5.5.3 5.5.4 5.5.5 5.5.6 5.5.7 5.5.7	Loading Data Automatically Loading Settings (Auto-setup Function) Managing Files Saving Data Checking the Contents in a Folder (Opening a Folder) Creating New Folders Deleting Files and Folders Sorting Files Renaming Files and Folders Copying a File Into a Specified Folder	. 109 .110 .113 .113 115 118 118 118 118 119 120 121 122 122
<b>5.4</b> <b>5.5</b> 5.5.1 5.5.2 5.5.3 5.5.4 5.5.5 5.5.6 5.5.7 5.5.8	Loading Data Automatically Loading Settings (Auto-setup Function) Managing Files Saving Data Checking the Contents in a Folder (Opening a Folder) Creating New Folders Deleting Files and Folders Sorting Files Renaming Files and Folders Copying a File Into a Specified Folder Printing the File Table.	. 109 .110 .113 .114 115 118 118 118 119 .120 .121 .122 .123
<b>5.4</b> <b>5.5</b> 5.5.1 5.5.2 5.5.3 5.5.4 5.5.5 5.5.6 5.5.7 5.5.8 <b>6</b>	Loading Data Automatically Loading Settings (Auto-setup Function) Managing Files Saving Data Checking the Contents in a Folder (Opening a Folder) Creating New Folders Deleting Files and Folders Sorting Files Renaming Files and Folders Copying a File Into a Specified Folder Printing the File Table.	. 109 .110 .113 .114 115 118 118 118 119 .120 .121 .122 .123

6.1	Print Type and Procedure	126
6.2	Setting Auto-printing	127

-	

6.3	Manually Printing Data by Pressing the PRINT Key (Selection Print)130
6.4	Setting the Print Density of the Waveform 132
6.5	Configuring the Printer Settings133
6.6	Advanced Print Functions 136
6.6.1	Printing the Screenshot136
6.6.2	Printing Reports (A4-Sized Print)
6.6.3	Printing a List138
6.6.4	Printing the Text Coments138
7	Monitoring and
	Analyzing Waveforms
	on the Waveform
	Soroop 120
	Screen 139
71	Poading Moasurod Values
1.1	(Using Cursors A and B) 140
7 2	(Using Cursors A and B) 140 Specifying the Wayoform
1.2	Bango (Cursors A and B) 145
7 2	Moving the Waveform Display
1.5	Position 146
731	Position 146
7.3.2	Scrolling the Waveforms With the Jog
1.0.2	Dial and Shuttle Ring
7.3.3	Changing Position (Jump Function)
7.4	Plotting X-Y Composite Curves 148
7.5	Magnifying and Demagnifying
	Waveforms 150
7.5.1	Magnifying and Demagnifying Waveforms
	Horizontally (in the Time Axis Direction) 150
7.5.2	Zoom Function (Horizontally Magnifying
	a Part of Waveforms [in the time axis
	direction])151
7.5.3	Magnifying/demagnifying the
	Avia Direction
76	Axis Direction)
1.0	(Lovel Meniter)
761	(Level Monitor)
7.0.1	Numerical Value Monitor 155
7.0.2	Switching the Waveform
1.1	Screen Display (Display Menu) 156
7.7.1	Displaying Upper and Lower Limits on the Waveform Screen 156
7.7.2	Displaying Comments on the Waveform
772	Switching the Waveform Display Width 156
774	Switching Channel Information (18975
7.1. <del>.</del>	U8977, and U8978 only)
7.7.5	Switching the Sheet to Be Displayed 157

7.8	Viewing Waveforms Divided
	Into Blocks 157

### 8 Advanced Functions 159

8.1	Adding Comments	160
8.1.1	Adding, Displaying, and Printing the Title	
	Comment	. 160
8.1.2	Adding, Displaying, and Printing the	
	Channel Comments	. 161
8.1.3	Entering Alphanumeric Characters	. 163
8.2	Displaying Waveforms During	
	the Writing in the Memory	
	Simultaneously (Roll Mode)	167
8.3	Overlaying New Waveforms	
	With Past Waveforms	168
8.4	Setting Channels to Be Used	
	(Extending the Recording	
	Length)	170
8.5	Converting Input Values	
	(Scaling Function)	171
8.5.1	Example of Scaling Settings	. 174
8.6	Setting the Waveform Position	
	(Variable Function)	178
8.7	Fine-Adjusting Input Values	
	(Vernier Function)	181
8.8	Inverting the Waveform (Invert	
	Function)	182
8.9	Copying Settings to Other	
8.9	Copying Settings to Other Channels (Copy Function)	183
8.9 8.10	Copying Settings to Other Channels (Copy Function) Setting Details of Modules	183 184
<b>8.9</b> <b>8.10</b> 8.10.1	Copying Settings to Other Channels (Copy Function) Setting Details of Modules Setting the Anti-aliasing Filter (A.A.F)	<b>183</b> <b>184</b> . 186
<b>8.9</b> <b>8.10</b> 8.10.1 8.10.2	Copying Settings to Other Channels (Copy Function) Setting Details of Modules Setting the Anti-aliasing Filter (A.A.F) Setting the Probe Voltage Dividing Ratio.	<b>183</b> <b>184</b> . 186 . 186
<ul> <li>8.9</li> <li>8.10</li> <li>8.10.1</li> <li>8.10.2</li> <li>8.10.3</li> </ul>	Copying Settings to Other Channels (Copy Function) Setting Details of Modules Setting the Anti-aliasing Filter (A.A.F) Setting the Probe Voltage Dividing Ratio. Setting Model 8967 Temp Unit	<b>183</b> <b>184</b> 186 186 187
<b>8.9</b> <b>8.10</b> 8.10.1 8.10.2 8.10.3 8.10.4	Copying Settings to Other Channels (Copy Function) Setting Details of Modules Setting the Anti-aliasing Filter (A.A.F) Setting the Probe Voltage Dividing Ratio Setting Model 8967 Temp Unit Setting Model 8969 and U8969 Strain	<b>183</b> <b>184</b> . 186 . 186 . 187
8.9 8.10 8.10.1 8.10.2 8.10.3 8.10.4	Copying Settings to Other Channels (Copy Function) Setting Details of Modules Setting the Anti-aliasing Filter (A.A.F) Setting the Probe Voltage Dividing Ratio Setting Model 8967 Temp Unit Setting Model 8969 and U8969 Strain Unit	<b>183</b> <b>184</b> . 186 . 186 . 187 . 188
<ul> <li>8.9</li> <li>8.10</li> <li>8.10.1</li> <li>8.10.2</li> <li>8.10.3</li> <li>8.10.4</li> <li>8.10.5</li> </ul>	Copying Settings to Other Channels (Copy Function) Setting Details of Modules Setting the Anti-aliasing Filter (A.A.F) Setting the Probe Voltage Dividing Ratio. Setting Model 8967 Temp Unit Setting Model 8969 and U8969 Strain Unit Setting Model 8970 Freq Unit	<b>183</b> <b>184</b> . 186 . 186 . 187 . 188 . 188
<ul> <li>8.9</li> <li>8.10</li> <li>8.10.1</li> <li>8.10.2</li> <li>8.10.3</li> <li>8.10.4</li> <li>8.10.5</li> <li>8.10.6</li> </ul>	Copying Settings to Other Channels (Copy Function) Setting Details of Modules Setting the Anti-aliasing Filter (A.A.F) Setting the Probe Voltage Dividing Ratio. Setting Model 8967 Temp Unit Setting Model 8969 and U8969 Strain Unit Setting Model 8970 Freq Unit Setting Model 8971 Current Unit	<b>183</b> <b>184</b> . 186 . 186 . 187 . 188 . 189 . 192
8.9 8.10 8.10.1 8.10.2 8.10.3 8.10.4 8.10.5 8.10.6 8.10.7	Copying Settings to Other Channels (Copy Function) Setting Details of Modules Setting the Anti-aliasing Filter (A.A.F) Setting the Probe Voltage Dividing Ratio Setting Model 8967 Temp Unit Setting Model 8969 and U8969 Strain Unit Setting Model 8970 Freq Unit Setting Model 8971 Current Unit Setting Model 8972 DC/RMS Unit	<b>183</b> <b>184</b> . 186 . 186 . 187 . 188 . 189 . 192 . 192
<ul> <li>8.9</li> <li>8.101</li> <li>8.10.2</li> <li>8.10.3</li> <li>8.10.4</li> <li>8.10.5</li> <li>8.10.6</li> <li>8.10.7</li> <li>8.10.8</li> </ul>	Copying Settings to Other Channels (Copy Function) Setting Details of Modules Setting the Anti-aliasing Filter (A.A.F) Setting the Probe Voltage Dividing Ratio Setting Model 8967 Temp Unit Setting Model 8969 and U8969 Strain Unit Setting Model 8970 Freq Unit Setting Model 8971 Current Unit Setting Model 8972 DC/RMS Unit Setting Model MR8990 Digital Voltmeter	<b>183</b> <b>184</b> . 186 . 186 . 187 . 188 . 189 . 192 . 192
<ul> <li>8.9</li> <li>8.10</li> <li>8.10.1</li> <li>8.10.2</li> <li>8.10.3</li> <li>8.10.4</li> <li>8.10.5</li> <li>8.10.6</li> <li>8.10.7</li> <li>8.10.8</li> </ul>	Copying Settings to Other Channels (Copy Function) Setting Details of Modules Setting the Anti-aliasing Filter (A.A.F) Setting the Probe Voltage Dividing Ratio Setting Model 8967 Temp Unit Setting Model 8969 and U8969 Strain Unit Setting Model 8970 Freq Unit Setting Model 8971 Current Unit Setting Model 8972 DC/RMS Unit Setting Model MR8990 Digital Voltmeter Unit	<b>183</b> <b>184</b> . 186 . 186 . 187 . 188 . 189 . 192 . 192 . 193
<ul> <li>8.9</li> <li>8.10</li> <li>8.10.1</li> <li>8.10.2</li> <li>8.10.3</li> <li>8.10.4</li> <li>8.10.5</li> <li>8.10.6</li> <li>8.10.7</li> <li>8.10.8</li> <li>8.10.9</li> </ul>	Copying Settings to Other Channels (Copy Function) Setting Details of Modules Setting the Anti-aliasing Filter (A.A.F) Setting the Probe Voltage Dividing Ratio. Setting Model 8967 Temp Unit Setting Model 8969 and U8969 Strain Unit Setting Model 8970 Freq Unit Setting Model 8971 Current Unit Setting Model 8972 DC/RMS Unit Setting Model MR8990 Digital Voltmeter Unit Setting Model U8974 High Voltage Unit	<b>183</b> <b>184</b> . 186 . 186 . 187 . 188 . 189 . 192 . 192 . 193
8.9 8.10 8.10.1 8.10.2 8.10.3 8.10.4 8.10.5 8.10.6 8.10.7 8.10.8 8.10.9 8.10.9	Copying Settings to Other Channels (Copy Function) Setting Details of Modules Setting the Anti-aliasing Filter (A.A.F) Setting the Probe Voltage Dividing Ratio. Setting Model 8967 Temp Unit Setting Model 8969 and U8969 Strain Unit Setting Model 8970 Freq Unit Setting Model 8971 Current Unit Setting Model 8972 DC/RMS Unit Setting Model MR8990 Digital Voltmeter Unit Setting Model U8974 High Voltage Unit Setting Model U8977 3CH Current Unit	<b>183</b> <b>184</b> . 186 . 186 . 187 . 188 . 189 . 192 . 192 . 194 . 193
8.9 8.10 8.10.1 8.10.2 8.10.3 8.10.4 8.10.5 8.10.6 8.10.7 8.10.8 8.10.9 8.10.10 8.10.11	Copying Settings to Other Channels (Copy Function) Setting Details of Modules Setting the Anti-aliasing Filter (A.A.F) Setting the Probe Voltage Dividing Ratio Setting Model 8967 Temp Unit Setting Model 8969 and U8969 Strain Unit Setting Model 8970 Freq Unit Setting Model 8971 Current Unit Setting Model 8972 DC/RMS Unit Setting Model 8972 DC/RMS Unit Setting Model MR8990 Digital Voltmeter Unit Setting Model U8974 High Voltage Unit Setting Model U8977 3CH Current Unit	<b>183</b> <b>184</b> . 186 . 186 . 187 . 188 . 189 . 192 . 192 . 193 . 194 . 195 . 196
8.9 8.10 8.10.1 8.10.2 8.10.3 8.10.4 8.10.5 8.10.6 8.10.7 8.10.8 8.10.9 8.10.10 8.10.11 8.10.12	Copying Settings to Other Channels (Copy Function) Setting Details of Modules Setting the Anti-aliasing Filter (A.A.F) Setting the Probe Voltage Dividing Ratio Setting Model 8967 Temp Unit Setting Model 8969 and U8969 Strain Unit Setting Model 8970 Freq Unit Setting Model 8970 Freq Unit Setting Model 8971 Current Unit Setting Model 8972 DC/RMS Unit Setting Model MR8990 Digital Voltmeter Unit Setting Model U8974 High Voltage Unit Setting Model U8977 3CH Current Unit Setting Model U8979 Charge Unit Setting MR8790 Waveform Generator	<b>183</b> <b>184</b> . 186 . 186 . 187 . 188 . 192 . 192 . 193 . 194 . 195 . 196
8.9 8.10 8.10.1 8.10.2 8.10.3 8.10.4 8.10.5 8.10.6 8.10.7 8.10.8 8.10.9 8.10.10 8.10.11 8.10.12	Copying Settings to Other Channels (Copy Function) Setting Details of Modules Setting the Anti-aliasing Filter (A.A.F) Setting the Probe Voltage Dividing Ratio Setting Model 8967 Temp Unit Setting Model 8969 and U8969 Strain Unit Setting Model 8970 Freq Unit Setting Model 8970 Freq Unit Setting Model 8971 Current Unit Setting Model 8972 DC/RMS Unit Setting Model MR8990 Digital Voltmeter Unit Setting Model U8974 High Voltage Unit Setting Model U8977 3CH Current Unit Setting Model U8979 Charge Unit Setting MR8790 Waveform Generator Unit.	<b>183</b> <b>184</b> . 186 . 186 . 187 . 188 . 189 . 192 . 193 . 194 . 195 . 196 . 199
8.9 8.10 8.10.1 8.10.2 8.10.3 8.10.4 8.10.5 8.10.6 8.10.7 8.10.8 8.10.9 8.10.10 8.10.11 8.10.12 8.10.13	Copying Settings to Other Channels (Copy Function) Setting Details of Modules Setting the Anti-aliasing Filter (A.A.F) Setting the Probe Voltage Dividing Ratio. Setting Model 8967 Temp Unit Setting Model 8969 and U8969 Strain Unit Setting Model 8970 Freq Unit Setting Model 8971 Current Unit Setting Model 8972 DC/RMS Unit Setting Model MR8990 Digital Voltmeter Unit Setting Model U8974 High Voltage Unit Setting Model U8977 3CH Current Unit Setting Model U8979 Charge Unit Setting MR8790 Waveform Generator Unit Setting MR 8971 Pulse Generator Unit	<b>183</b> <b>184</b> . 186 . 186 . 187 . 188 . 192 . 193 . 194 . 195 . 196 . 199 . 201
8.9 8.10 8.10.1 8.10.2 8.10.3 8.10.4 8.10.5 8.10.6 8.10.7 8.10.8 8.10.9 8.10.10 8.10.11 8.10.12 8.10.13 8.10.14	Copying Settings to Other Channels (Copy Function) Setting Details of Modules Setting the Anti-aliasing Filter (A.A.F) Setting the Probe Voltage Dividing Ratio. Setting Model 8967 Temp Unit Setting Model 8969 and U8969 Strain Unit Setting Model 8970 Freq Unit Setting Model 8971 Current Unit Setting Model 8972 DC/RMS Unit Setting Model 8972 DC/RMS Unit Setting Model U8974 High Voltage Unit Setting Model U8974 High Voltage Unit Setting Model U8979 Charge Unit Setting Model U8979 Charge Unit Setting MR8790 Waveform Generator Unit Setting MR 8971 Pulse Generator Unit Setting U8793 Arbitrary Waveform	<b>183</b> <b>184</b> . 186 . 186 . 187 . 188 . 189 . 192 . 193 . 193 . 194 . 195 . 196 . 199 . 201
8.9 8.10 8.10.1 8.10.2 8.10.3 8.10.3 8.10.4 8.10.5 8.10.6 8.10.7 8.10.6 8.10.7 8.10.8 8.10.9 8.10.10 8.10.11 8.10.12 8.10.13 8.10.14	Copying Settings to Other Channels (Copy Function) Setting Details of Modules Setting the Anti-aliasing Filter (A.A.F) Setting the Probe Voltage Dividing Ratio Setting Model 8967 Temp Unit Setting Model 8969 and U8969 Strain Unit Setting Model 8970 Freq Unit Setting Model 8970 Freq Unit Setting Model 8972 DC/RMS Unit Setting Model 8972 DC/RMS Unit Setting Model U8974 High Voltage Unit Setting Model U8974 High Voltage Unit Setting Model U8979 Charge Unit Setting Model U8979 Charge Unit Setting MR8790 Waveform Generator Unit Setting MR 8971 Pulse Generator Unit Setting U8793 Arbitrary Waveform Generator Unit	<b>183</b> <b>184</b> . 186 . 186 . 187 . 188 . 189 . 192 . 192 . 193 . 194 . 195 . 196 . 199 . 201
<ul> <li>8.9</li> <li>8.10</li> <li>8.10.1</li> <li>8.10.2</li> <li>8.10.3</li> <li>8.10.4</li> <li>8.10.5</li> <li>8.10.6</li> <li>8.10.7</li> <li>8.10.6</li> <li>8.10.7</li> <li>8.10.8</li> <li>8.10.9</li> <li>8.10.10</li> <li>8.10.10</li> <li>8.10.11</li> <li>8.10.12</li> <li>8.10.13</li> <li>8.10.14</li> <li>8.11</li> </ul>	Copying Settings to Other Channels (Copy Function) Setting Details of Modules Setting the Anti-aliasing Filter (A.A.F) Setting the Probe Voltage Dividing Ratio. Setting Model 8967 Temp Unit Setting Model 8969 and U8969 Strain Unit Setting Model 8970 Freq Unit Setting Model 8970 Freq Unit Setting Model 8971 Current Unit Setting Model 8972 DC/RMS Unit Setting Model MR8990 Digital Voltmeter Unit Setting Model U8974 High Voltage Unit Setting Model U8979 Charge Unit Setting Model U8979 Charge Unit Setting MR8790 Waveform Generator Unit Setting MR 8971 Pulse Generator Unit Setting U8793 Arbitrary Waveform Generator Unit	<b>183</b> <b>184</b> . 186 . 186 . 187 . 188 . 192 . 193 . 194 . 195 . 196 . 201
<ul> <li>8.9</li> <li>8.10</li> <li>8.10.1</li> <li>8.10.2</li> <li>8.10.3</li> <li>8.10.4</li> <li>8.10.5</li> <li>8.10.6</li> <li>8.10.7</li> <li>8.10.6</li> <li>8.10.7</li> <li>8.10.8</li> <li>8.10.9</li> <li>8.10.10</li> <li>8.10.10</li> <li>8.10.11</li> <li>8.10.12</li> <li>8.10.13</li> <li>8.10.14</li> <li>8.11</li> </ul>	Copying Settings to Other Channels (Copy Function) Setting Details of Modules Setting the Anti-aliasing Filter (A.A.F) Setting the Probe Voltage Dividing Ratio Setting Model 8967 Temp Unit Setting Model 8969 and U8969 Strain Unit Setting Model 8970 Freq Unit Setting Model 8970 Freq Unit Setting Model 8971 Current Unit Setting Model 8972 DC/RMS Unit Setting Model MR8990 Digital Voltmeter Unit Setting Model U8974 High Voltage Unit Setting Model U8977 3CH Current Unit Setting Model U8979 Charge Unit Setting MR8790 Waveform Generator Unit Setting MR 8971 Pulse Generator Unit Setting U8793 Arbitrary Waveform Generator Unit	<b>183</b> <b>184</b> . 186 . 186 . 187 . 188 . 189 . 192 . 193 . 194 . 195 . 201 . 203

11

12

13

6

7

8

9

10

Appx.

Ind.

8.12	Saving Waveforms Registered
	in Model U8793 onto a Storage
	Device
8.13	Setting Output Waveform
	Parameters on the Waveform
	Screen 209

### 9 Setting the Trigger 211

<b>A</b>	Catting Dragadura 040
9.1	Setting Procedure 212
9.2	Setting the Trigger Mode 213
9.3	Triggering the Instrument
	Using Analog Signals
9.4	Triggering the Instrument
	Using Logic Signals (Logic
	Trigger)
9.5	Triggering the Instrument
	at the Specified Time or at
	Regular Intervals (Timer
	Trigger)
• •	
9.6	Iriggering the instrument
	Externally (External Trigger) 226
9.7	Triggering the Instrument
	Manually (Manual Trigger) 226
9.8	Setting the Pre-trigger 227
9.8.1	Setting the Trigger Start Point
	(Pre-trigger)227
9.8.2	Setting the Trigger Acceptance
	(Trigger Priority)
9.9	Setting the Trigger Timing 230
9.10	Setting the Trigger Logical
••••	Connective (AND/OR) Among
	the Trigger Sources 222
0.44	Change in the Masses of Dat
9.11	Searching the Measured Data
	Using the Trigger Settings 233

### 10 Numerical Calculation Functions 235

Numerical Calculation	
Procedure	. 236
Setting the Numerical Value	
Calculation	. 238
Displaying the Numerical Calculation	
Results	242
Judging the Calculation	
Results	. 243
Displaying the Judgment Results and	
Outputting the Signals	245
Saving the Numerical	
Calculation Results	. 246
	Numerical Calculation Procedure

10.5	Finding the Numerical	_
	Calculation Results 24	8
10.6	Numerical Calculation Types	
	and Descriptions 24	9
11	Waveform Calculation	
	Eurotion 25'	2
	Function 25.	5
11 1	Wayoform Calculation	
	Workflow 25	Л
11 2	Wayoform Calculation	-
11.2	Softings 25	6
11 2 1	Displaying the Waveform Calculation	0
11.2.1	Results 25	8
11.2.2	Setting Constants 26	0
11.2.3	Change the Display Method for	•
	Calculated Waveforms	51
11.3	Waveform Calculation	
	Operators and Results	4
	•	
12	Memory Division	
		_
	Function 26	(
40.4		
12.1	Configuring the Recording	•
	Settings	9
12.2	Configuring the Display	•
	Settings 27	n
		U
12		2
13	FFT Function 27:	3
<b>13</b>	FFT Function 27: Overview and Features 27	3
<b>13</b>   13.1	FFT Function 27: Overview and Features	3 3
<b>13</b>   13.1 13.2	FFT Function 27: Overview and Features	3 3 ₃
<b>13</b> 13.1 13.2	FFT Function 27: Overview and Features	3 3 4
<b>13</b> 13.1 13.2 13.3	FFT Function 273 Overview and Features	<b>3</b> 3 4
<b>13</b> 13.1 13.2 13.3	FFT Function       273         Overview and Features       27         Operation Workflow (Reference       27         Data)       27         Setting the FFT Analysis       27         Selecting the FFT Eurotion       27	<b>3</b> 3 3 4 5 5
<b>13</b> 13.1 13.2 13.3 13.3.1 13.3.2	FFT Function       27         Overview and Features       27         Operation Workflow (Reference       27         Data)       27         Setting the FFT Analysis       27         Selecting the FFT Function       27         Selecting the FFT Function       27         Setting the Data Source for Analysis       27	3 3 3 4 5 5
<b>13</b> <b>13.1</b> <b>13.2</b> <b>13.3</b> 13.3.1 13.3.2	FFT Function       273         Overview and Features       27         Operation Workflow (Reference       27         Data)       27         Setting the FFT Analysis       27         Conditions       27         Selecting the FFT Function       27         Setting the Data Source for Analysis       27         Setting the Data Source for Analysis       27         Setting the Data Source for Analysis       27	<b>3</b> <b>3</b> <b>3</b> <b>4</b> <b>5</b> 55 75
<b>13</b> <b>13.1</b> <b>13.2</b> <b>13.3</b> 13.3.1 13.3.2 13.3.3	FFT Function       273         Overview and Features       274         Operation Workflow (Reference       274         Data)       274         Setting the FFT Analysis       275         Conditions       275         Selecting the FFT Function       275         Setting the Data Source for Analysis       275         (Reference Data)       275         Setting the FFT Function       275         Setting the Data Source for Analysis       275         Setting the Frequency Range and       275	<b>3</b> <b>3</b> <b>3</b> <b>4</b> <b>5</b> 575 76
<b>13</b> <b>13.1</b> <b>13.2</b> <b>13.3</b> 13.3.1 13.3.2 13.3.3	FFT Function       27         Overview and Features       27         Operation Workflow (Reference       27         Data)       27         Setting the FFT Analysis       27         Selecting the FFT Analysis       27         Selecting the FFT Function       27         Setting the Data Source for Analysis       27         Setting the FFT Function       27         Setting the Tequency Range and       27         Number of Analysis Points       27	<b>3</b> <b>3</b> <b>3</b> <b>4</b> <b>5</b> 55 76
<b>13</b> <b>13.1</b> <b>13.2</b> <b>13.3</b> 13.3.1 13.3.2 13.3.3 13.3.4	FFT Function       27         Overview and Features       27         Operation Workflow (Reference       27         Data)       27         Setting the FFT Analysis       27         Selecting the FFT Analysis       27         Selecting the FFT Function       27         Setting the Data Source for Analysis       27         Setting the FFT Function       27         Setting the Frequency Range and       27         Number of Analysis Points       27         Decimating and Calculating Data       27	<b>3</b> <b>3</b> <b>3</b> <b>4</b> <b>5</b> 5 7 5 7 9
<b>13</b> <b>13.1</b> <b>13.2</b> <b>13.3</b> 13.3.1 13.3.2 13.3.3 13.3.4 13.3.5	FFT Function       273         Overview and Features       27         Operation Workflow (Reference       27         Data)       27         Setting the FFT Analysis       27         Selecting the FFT Function       27         Setting the Frequency Range and       27         Number of Analysis Points       27         Decimating and Calculating Data       27         Setting the Window Function       28	<b>3</b> <b>3</b> <b>3</b> <b>4</b> <b>5</b> 75 76 79 90
<b>13</b> <b>13.1</b> <b>13.2</b> <b>13.3</b> 13.3.1 13.3.2 13.3.3 13.3.4 13.3.5 13.3.6	FFT Function       27         Overview and Features       27         Operation Workflow (Reference       27         Data)       27         Setting the FFT Analysis       27         Selecting the FFT Analysis       27         Selecting the FFT Function       27         Setting the Data Source for Analysis       27         Setting the FFT Function       27         Setting the FFT Function       27         Setting the FFT Function       27         Setting the Frequency Range and       27         Number of Analysis Points       27         Decimating and Calculating Data       27         Setting the Window Function       28         Configuring the Analysis Result Peak       28	<b>3</b> <b>3</b> <b>3</b> <b>4</b> <b>5</b> 5 5 6 7 9 00
<b>13</b> <b>13.1</b> <b>13.2</b> <b>13.3</b> 13.3.1 13.3.2 13.3.3 13.3.4 13.3.5 13.3.6	FFT Function       27         Overview and Features       27         Operation Workflow (Reference       27         Data)       27         Setting the FFT Analysis       27         Selecting the FFT Analysis       27         Selecting the FFT Function       27         Setting the Data Source for Analysis       27         Setting the FFT Function       27         Setting the Frequency Range and       27         Number of Analysis Points       27         Decimating and Calculating Data       27         Setting the Window Function       28         Configuring the Analysis Result Peak       28	<b>3</b> <b>3</b> <b>3</b> <b>4</b> <b>5</b> 5 5 6 79 50 31
<b>13</b> <b>13.1</b> <b>13.2</b> <b>13.3</b> 13.3.1 13.3.2 13.3.3 13.3.4 13.3.5 13.3.6 13.3.7	FFT Function       27         Overview and Features       27         Operation Workflow (Reference       27         Data)       27         Setting the FFT Analysis       27         Selecting the FFT Analysis       27         Selecting the FFT Function       27         Setting the Data Source for Analysis       27         Setting the FFT Function       27         Setting the FFT Function       27         Setting the FFT Function       27         Setting the Frequency Range and       27         Number of Analysis Points       27         Decimating and Calculating Data       27         Setting the Window Function       28         Configuring the Analysis Result Peak       28         Value Setting       28         Averaging Analysis Results (Waveform       28	<b>3</b> <b>3</b> <b>4</b> <b>5</b> 5 5 6 7 90 81
<b>13</b> <b>13.1</b> <b>13.2</b> <b>13.3</b> <b>13.3.1</b> <b>13.3.2</b> <b>13.3.3</b> <b>13.3.4</b> <b>13.3.5</b> <b>13.3.6</b> <b>13.3.7</b>	FFT Function       273         Overview and Features       27         Operation Workflow (Reference       27         Data)       27         Setting the FFT Analysis       27         Selecting the FFT Analysis       27         Selecting the FFT Function       27         Setting the Data Source for Analysis       27         Setting the FFT Function       27         Setting the Frequency Range and       27         Setting the Vindow Function       28         Configuring the Analysis Result Peak       28         Averaging Analysis Results (Waveform       28         Averaging)       28	<b>3</b> <b>3</b> <b>4</b> <b>5</b> 57 <b>6</b> 79 <b>60</b> <b>31</b> <b>52</b>
<b>13</b> .1 <b>13.1</b> <b>13.2</b> <b>13.3</b> 13.3.1 13.3.2 13.3.3 13.3.4 13.3.5 13.3.6 13.3.7 13.3.8	FFT Function       273         Overview and Features       27         Operation Workflow (Reference       27         Data)       27         Setting the FFT Analysis       27         Setting the FFT Analysis       27         Selecting the FFT Function       27         Setting the Data Source for Analysis       27         Setting the FFT Function       27         Setting the Fequency Range and       27         Number of Analysis Points       27         Decimating and Calculating Data       27         Setting the Window Function       28         Configuring the Analysis Result Peak       28         Averaging Analysis Results (Waveform       28         Highlighting Analysis Results (Phase       28	<b>3</b> <b>3</b> <b>4</b> <b>5</b> 5 5 6 7 90 31 52
<b>13</b> <b>13.1</b> <b>13.2</b> <b>13.3</b> <b>13.3.1</b> <b>13.3.2</b> <b>13.3.3</b> <b>13.3.4</b> <b>13.3.5</b> <b>13.3.6</b> <b>13.3.7</b> <b>13.3.8</b> <b>13.3.8</b> <b>13.2.0</b>	FFT Function       27         Overview and Features       27         Operation Workflow (Reference       27         Data)       27         Setting the FFT Analysis       27         Selecting the FFT Analysis       27         Selecting the FFT Function       27         Setting the Data Source for Analysis       27         Setting the FFT Function       27         Setting the FFT Function       27         Setting the FFT Function       27         Setting the Frequency Range and       27         Number of Analysis Points       27         Decimating and Calculating Data       27         Setting the Window Function       28         Configuring the Analysis Result Peak       28         Averaging Analysis Results (Waveform       28         Averaging Analysis Results (Phase       28         Spectra Only)       28         Configuring the Analysis Results (Phase       28	<b>3</b> <b>3</b> <b>4</b> <b>5</b> 5 5 7 9 00 31 5 5
<b>13</b> <b>13.1</b> <b>13.2</b> <b>13.3</b> <b>13.3.1</b> <b>13.3.2</b> <b>13.3.3</b> <b>13.3.4</b> <b>13.3.5</b> <b>13.3.6</b> <b>13.3.7</b> <b>13.3.8</b> <b>13.3.9</b> <b>13.3.10</b>	FFT Function       27         Overview and Features       27         Operation Workflow (Reference       27         Data)       27         Setting the FFT Analysis       27         Setting the FFT Analysis       27         Selecting the FFT Function       27         Setting the Data Source for Analysis       27         Setting the FFT Function       27         Setting the FFT Function       27         Setting the FFT Function       27         Setting the Frequency Range and       27         Number of Analysis Points       27         Decimating and Calculating Data       27         Setting the Window Function       28         Configuring the Analysis Result Peak       28         Averaging Analysis Results (Waveform       28         Averaging)       28         Highlighting Analysis Results (Phase       28         Spectra Only)       28         Configuring the Analysis Mode Settings       28         Setting the Diaplay Papers of the       28	<b>3</b> <b>3</b> <b>4</b> <b>5</b> <b>5</b> <b>6</b> <b>7</b> <b>9</b> <b>0</b> <b>3</b> <b>4</b> <b>5</b> <b>5</b> <b>6</b> <b>7</b> <b>9</b> <b>0</b> <b>3</b> <b>3</b> <b>4</b> <b>5</b> <b>5</b> <b>6</b> <b>7</b> <b>9</b> <b>0</b> <b>3</b> <b>1</b> <b>1</b> <b>1</b> <b>1</b> <b>1</b> <b>1</b> <b>1</b> <b>1</b> <b>1</b> <b>1</b>
<b>13</b> <b>13.1</b> <b>13.2</b> <b>13.3</b> <b>13.3.1</b> <b>13.3.2</b> <b>13.3.3</b> <b>13.3.4</b> <b>13.3.5</b> <b>13.3.6</b> <b>13.3.7</b> <b>13.3.8</b> <b>13.3.9</b> <b>13.3.10</b>	FFT Function       273         Overview and Features       27         Operation Workflow (Reference       27         Data)       27         Setting the FFT Analysis       27         Setting the FFT Analysis       27         Selecting the FFT Function       27         Setting the Data Source for Analysis       27         Setting the FFT Function       27         Setting the Frequency Range and       27         Setting the Frequency Range and       27         Setting the Frequency Range and       27         Setting the Vindow Function       28         Configuring the Analysis Result Peak       28         Averaging Analysis Results (Waveform       28         Averaging)       28         Highlighting Analysis Results (Phase       28         Spectra Only)       28         Configuring the Analysis Mode Settings       28         Setting the Display Range of the       29	<b>3</b> <b>3</b> <b>4</b> <b>5</b> 5 6 7 9 0 31 5 6 0 1 2 5 6 0 1 2 5 6 0 1 2 5 6 0 1 1 2 5 6 0 1 1 1 1 1 1 1 1 1 1 1 1 1
<b>13</b> <b>13.1</b> <b>13.2</b> <b>13.3</b> <b>13.3.1</b> <b>13.3.2</b> <b>13.3.3</b> <b>13.3.4</b> <b>13.3.5</b> <b>13.3.6</b> <b>13.3.7</b> <b>13.3.8</b> <b>13.3.9</b> <b>13.3.10</b> <b>13.3.11</b>	FFT Function       273         Overview and Features       27         Operation Workflow (Reference       27         Data)       27         Setting the FFT Analysis       27         Setting the FFT Analysis       27         Setting the FFT Analysis       27         Setting the FFT Function       27         Setting the Data Source for Analysis       27         Setting the Frequency Range and       27         Number of Analysis Points       27         Setting the Frequency Range and       27         Decimating and Calculating Data       27         Setting the Window Function       28         Configuring the Analysis Result Peak       28         Value Setting       28         Averaging Analysis Results (Waveform       28         Averaging)       28         Configuring the Analysis Mode Settings       28         Configuring the Analysis Mode Settings       28         Configuring the Display Range of the       29         Setting the Display Range of the       29         Setting and Changing Analysis       29	<b>3</b> <b>3</b> <b>4</b> <b>5</b> <b>5</b> <b>6</b> <b>7</b> <b>9</b> <b>0</b> <b>3</b> <b>4</b> <b>5</b> <b>5</b> <b>6</b> <b>7</b> <b>9</b> <b>0</b> <b>3</b> <b>3</b> <b>4</b> <b>5</b> <b>5</b> <b>6</b> <b>7</b> <b>9</b> <b>0</b> <b>3</b> <b>1</b> <b>1</b> <b>5</b> <b>1</b> <b>1</b> <b>1</b> <b>1</b> <b>1</b> <b>1</b> <b>1</b> <b>1</b>

13.4	Configuring the Channel settings	292
13.5	Configuring the Screen Display	
	Settings	293
13.5.1	Displaying the Running Spectrum	. 295
13.6	Saving Analysis Results	298
13.7	Printing Analysis Results	299
13.8	Analyzing Waveforms on the	
	Waveform Screen	300
13.8.1	Calculating After Specifying the	
	Calculation Starting Point	. 300
13.9	FFT Analysis Modes	302
13.9.1	Analysis Modes and Display Examples	. 302
1202		
13.9.2	Analysis Mode Functions	. 320

## 14 Waveform Evaluation<br/>Function321

14.1	Evaluating Waveforms and
	Giving GO/NG Judgments
	(MEM, FFT Function) 321
14.2	Setting the Evaluation Area 324
14.3	Configuring the Waveform
	Evaluation Setting 326
14.4	Setting the Waveform
	<b>Evaluation Stopping conditions 327</b>
14.5	Creating the Evaluation Area 329
14.6	Details About the Editor
	Commands 330

### 15 Setting the System Environment 335

16 Connecting the	
Instrument to a	
Computer	341

16.1	Setting LAN and Connecting the Instrument to the LAN Network (Before Using FTP/ Internet Browser/Command	
	Communications)	. 342
16.1.1	Configuring the LAN Settings With the	
	Instrument	342
16.1.2	Connecting the Instrument to the	
	Computer With the LAN Cable	346
16.2	Controlling the Instrument	
	Remotely (Using an Internet	
	Browser).	. 348
16.2.1	Setting HTTP With the Instrument	348

16.2.2	Connecting the Computer to the	
	Instrument With the Internet Browser	.349
16.2.3	Operating the Instrument With the	
	Internet Browser	. 350
16.3	Accessing Files on the	
	Instrument From the computer	
	(Using the FTP)	355
16.3.1	Setting the FTP With the Instrument	. 356
16.3.2	Connecting the Computer to the	
	Instrument Using the FTP	. 357
16.3.3	Managing Files With the FTP	. 358
16.4	Transferring Data to the	
	computer	359
16.5	Wave Viewer (Wv)	360
16.6	Configuring the USB Settings	
	and Connecting the Instrument	
	and Connecting the Instrument to the Computer (Before	
	and Connecting the Instrument to the Computer (Before Performing Command	
	and Connecting the Instrument to the Computer (Before Performing Command Communications)	361
16.6.1	and Connecting the Instrument to the Computer (Before Performing Command Communications)	361
16.6.1	and Connecting the Instrument to the Computer (Before Performing Command Communications) Configuring the USB Settings With the Instrument	<b>361</b>
16.6.1	and Connecting the Instrument to the Computer (Before Performing Command Communications) Configuring the USB Settings With the Instrument Installing the USB Driver	<b>361</b> 361 361
16.6.1 16.6.2 <b>16.7</b>	and Connecting the Instrument to the Computer (Before Performing Command Communications) Configuring the USB Settings With the Instrument Installing the USB Driver Controlling the Instrument with	<b>361</b> 361 361
16.6.1 16.6.2 <b>16.7</b>	and Connecting the Instrument to the Computer (Before Performing Command Communications) Configuring the USB Settings With the Instrument Installing the USB Driver Controlling the Instrument with Command Communications	<b>361</b> 361 361
16.6.1 16.6.2 <b>16.7</b>	and Connecting the Instrument to the Computer (Before Performing Command Communications) Configuring the USB Settings With the Instrument Installing the USB Driver Controlling the Instrument with Command Communications (LAN/USB)	<b>361</b> 361 361 <b>365</b>
16.6.1 16.6.2 <b>16.7</b>	and Connecting the Instrument to the Computer (Before Performing Command Communications) Configuring the USB Settings With the Instrument Installing the USB Driver Controlling the Instrument with Command Communications (LAN/USB) Setting the Instrument	<b>361</b> 361 361 <b>365</b> 366
16.6.1 16.6.2 <b>16.7</b> 16.7.1	and Connecting the Instrument to the Computer (Before Performing Command Communications) Configuring the USB Settings With the Instrument Installing the USB Driver Controlling the Instrument with Command Communications (LAN/USB) Setting the Instrument	<b>361</b> 361 361 <b>365</b> 366
16.6.1 16.6.2 <b>16.7</b> 16.7.1 <b>16.8</b>	and Connecting the Instrument to the Computer (Before Performing Command Communications) Configuring the USB Settings With the Instrument Installing the USB Driver Controlling the Instrument with Command Communications (LAN/USB) Setting the Instrument Operating the Instrument Performant Communications	<b>361</b> 361 361 <b>365</b> 366
16.6.1 16.6.2 <b>16.7</b> 16.7.1 <b>16.8</b>	and Connecting the Instrument to the Computer (Before Performing Command Communications) Configuring the USB Settings With the Instrument Installing the USB Driver Controlling the Instrument with Command Communications (LAN/USB) Setting the Instrument Operating the Instrument Remotely and Acquiring Data	<b>361</b> 361 361 <b>365</b> 366
16.6.1 16.6.2 <b>16.7</b> 16.7.1 <b>16.8</b>	and Connecting the Instrument to the Computer (Before Performing Command Communications) Configuring the USB Settings With the Instrument Installing the USB Driver Controlling the Instrument with Command Communications (LAN/USB) Setting the Instrument Remotely and Acquiring Data Using the Model 9333 LAN	<b>361</b> 361 361 <b>365</b> 366
16.6.1 16.6.2 <b>16.7</b> 16.7.1 <b>16.8</b>	and Connecting the Instrument to the Computer (Before Performing Command Communications) Configuring the USB Settings With the Instrument Installing the USB Driver Controlling the Instrument with Command Communications (LAN/USB) Setting the Instrument Remotely and Acquiring Data Using the Model 9333 LAN Communicators	361 361 361 365 366

### 17 Controlling the Instrument Externally 369

17.1	Connection of the External Control Terminals	370
17.2	External I/O	371
17.2.1	External Input (START/EXT.IN1) (STOP/	
	EXT.IN2) (PRINT/EXT.IN3)	371
17.2.2	External Output (GO/EXT.OUT1) (NG/	
	EXT.OUT2)	373
17.2.3	External Sampling (EXT.SMPL)	375
17.2.4	Trigger Output (TRIG OUT)	377
17.2.5	External Trigger Terminal (EXT.TRIG)	378

### 18 Specifications 379

18.1	General Specifications of the	
	Instrument	. 379
18.2	Common Functions	. 382
18.3	Measurement Functions	. 384
18.3.1	Memory Function	384
18.3.2	Recorder Function	385

18.3.3	X-Y Recorder Function	
18.3.4	FFT Function	
18.4	Other Functions 388	
18.5	File 393	
18.6	Specifications of Modules 395	
18.6.1	Model 8966 Analog Unit	
18.6.2	Model 8967 Temp Unit	
18.6.3	Model 8968 High Resolution Unit 399	
18.6.4	Model 8969 Strain Unit, U8969 Strain Unit401	
18.6.5	Model 8970 Freq Unit403	
18.6.6	Model 8971 Current Unit	
18.6.7	Model 8972 DC/RMS Unit407	
18.6.8	Model 8973 Logic Unit409	
18.6.9	Model MR8990 Digital Voltmeter Unit 410	
18.6.10	Model U8974 High Voltage Unit 412	
18.6.11	Model U8979 Charge Unit 414	
18.6.12	Model U8793 Arbitrary Waveform	
	Generator Unit	
18.6.13	Model MR8790 Waveform Generator Unit420	
18.6.14	Model MR8791 Pulse Generator Unit422	
	Specifications of output connector424	
18.6.15	Model U8975 4CH Analog Unit425	
18.6.16	Model U8977 3CH Current Unit Current	
	Unit	
18.6.17	Model U8978 4CH Analog Unit429	

### 19 Maintenance and Service

19.1	Troubleshooting	432
19.2	Resetting the Instrument	435
19.2.1	Resetting System Settings	435
19.2.2	Resetting Waveform Data	436
19.3	Error Messages	437
19.4	Self-Test (Self-Diagnostics)	442
19.4.1	ROM/RAM Check	442
19.4.2	Printer Check	443
19.4.3	Display Check	443
19.4.4	Key Check	444
19.4.5	System Configuration Check	444
19.5	Cleaning the instrument	446
19.6	Disposing of the Instrument	
	(Removing Lithium Battery)	448

Α	p	p	e	n	d	ix	
	-	<b>—</b>	_				

### Appx.1

431

Appx. 1	Default Values for M	lajor
	Settings	Аррх.1
Appx. 2	For Reference	Аррх.2
Appx. 3	About Options	Appx.15
Appx. 4	FFT Definitions	Аррх.24

Index	

Ind.1

Contents

### **Usage Index**

#### **Basic measurement procedure**



**Performing analysis** 

Saving/printing results (optionally)

5 Completing the measurement (p. 52)

Turning off the instrument

Monitoring changes in input signals (p. 211)

Manually triggering the instrument (p. 226)

Entering comments (p. 160)

Freely setting the waveform display (p. 70)

Converting input values (p. 171)

Copying settings to other channels (p. 183)

Eliminating noise (Low-pass filter) (p. 76)

Plotting X-Y composite curves (p. 148)

Locking the operation keys (p. 19)

Formatting a CF Card (p. 49)

Scaling measured values obtained with current clamp sensors (p. 174)

### Introduction

Thank you for purchasing the Hioki MR8847A Memory HiCorder (MR8847-51, MR8847-52, MR8847-53). To obtain maximum performance from the instrument, please read this manual first, and keep it handy for future reference.

The optional clamps (p. Appx.15) collectively mean "clamp sensors."

The following instruction manuals are available for this instrument. Refer to the relevant manual as usage.

Туре	Contents	Printed	CD-stored
Measurement Guide	<b>Read this booklet first.</b> Contains basic operating procedures for those who use this instrument for the first time.	V	_
Instruction Manual (This document)	Contains details and specifications regarding the functions and operations of this instrument.	✓	-
Communication Command Instruction Manual	Contains a list of the communication commands and their explanations to control the instrument with a computer.	-	V
U8793, MR8790, MR8791 Instruction Manual	Contains specifications and explanations of functions/operations of Models U8793 Arbitrary Waveform Generator Unit, MR8790 Waveform Generator Unit, MR8791 Pulse Generator Unit, and SF8000 Waveform Maker.	_	✓

#### Trademarks

- Microsoft Windows, Excel and Internet Explorer are either registered trademarks or trademarks of Microsoft Corporation in the United States and other countries.
- CompactFlash is a registered trademark of SanDisk Corporation (USA).
- Sun, Sun Microsystems, Java, and any logos containing Sun or Java are trademarks or registered trademarks of Oracle Corporation in the United States and other countries.

### **Verifying Package Contents**

When you receive your instrument, inspect it carefully to ensure that no damage occurred during shipping. In particular, check the accessories, panel switches, and connectors. If damage is evident, or if it fails to operate according to the specifications, contact your authorized Hioki distributor or reseller. Store the packaging in which the instrument was delivered, as you will need it when transporting the instrument.

#### Instrument and accessories

#### Confirm that you received the following items: (One each)



- \*1: When one or more pieces of Model 8967 Temp Unit are installed in the instrument, two ferrite clampon chokes (small) are supplied per module.
- \*2: The latest version can be downloaded from our website.

### **Safety Information**

This instrument and modules are designed to conform to IEC 61010 Safety Standards, and has been thoroughly tested for safety prior to shipment. However, using the instrument in a way not described in this manual may negate the provided safety features.

Before using the instrument, be certain to carefully read the following safety notes:

### 



Mishandling during use could result in injury or death, as well as damage to the instrument. Be certain that you understand the instructions and precautions in the manual before use.

### 



With regard to the electricity supply, there are risks of electric shock, heat generation, fire, and arc discharge due to short circuits. Individuals using an electrical measuring instrument for the first time should be supervised by a technician who has experience in electrical measurement.

#### **Protective Gear**



This instrument measures live lines. To prevent electric shock, use appropriate protective insulation and adhere to applicable laws and regulations.

**WARNING** 

#### Notation

In this document, the risk seriousness and the hazard levels are classified as follows.

	Indicates an imminently hazardous situation that will result in death or serious injury to the operator.
	Indicates a potentially hazardous situation that may result in death or serious injury to the operator.
	Indicates a potentially hazardous situation that may result in minor or moderate injury to the operator or damage to the instrument or malfunction.
IMPORTANT	Indicates information related to the operation of the instrument or maintenance tasks with which the operators must be fully familiar.
A	Indicates a high voltage hazard. If a particular safety check is not performed or the instrument is mishandled, this may give rise to a hazardous situation; the operator may receive an electric shock, may get burnt or may even be fatally injured.
$\oslash$	Indicates prohibited actions.
	Indicates the action which must be performed.
*	Additional information is presented below.

#### Symbols Affixed to the Instrument

	Indicates cautions and hazards. When the symbol is printed on the instrument, refer to the corresponding topic in the Instruction Manual.
	Indicates the ON side of the power switch.
0	Indicates the OFF side of the power switch.
	Indicates a fuse.
<u> </u>	Indicates a grounding terminal.
	Indicates DC (Direct Current).
$\sim$	Indicates AC (Alternating Current).
	Indicates a burn hazard if touched directly.

#### **Standards Symbols**



#### **Other Symbols**

This manual uses the following symbols to indicate specific information for operating the instrument.

(p. )	Indicates the location of reference information.
CURSOR (Bold-faced)	Names of settings, buttons, and other screen elements are written in bold blue text.
	Unless otherwise specified, "Windows" represents Windows 7, Windows 8, or Windows 10.
[]	Menus, commands, dialogs, buttons in a dialog, and other names on the screen and keys are indicated in brackets.
MEM	Indicates that the memory function supports the function.
REC	Indicates that the recorder function supports the function.
X-Y	Indicates that the X-Y recorder function supports the function.
FFT	Indicates that the FFT recorder function supports the function.
	Click: Press and quickly release the left button of the mouse. Right-click: Press and quickly release the right button of the mouse. Double-click: Quickly click the left button of the mouse twice.

#### Accuracy

We define measurement tolerances in terms of f.s. (full scale), rdg. (reading), and setting values with the following meanings:

f.s. (maximum display value or scale length)	The maximum displayable value or scale length. For this instrument, the maximum displayable value equals the numerical number of a presently set range (unit: V/div) multiplied by the number of divisions (20) on the vertical axis. Example: When the range is set to 1 V/div, f.s. = 20 V
rdg. (reading or displayed value)	The value currently being measured and indicated on the measuring instrument.
Setting	Indicates the value set as the output voltage, current, or other quantity.

#### **Measurement Categories**

To ensure safe operation of measuring instruments, IEC 61010 establishes safety standards for various electrical environments, categorized as CAT II to CAT IV, and called measurement categories.



Fixed Installation

The applicable measurement category is determined based on the module being used. Refer to "18.6 Specifications of Modules" (p. 395).

### **Operation Precautions**

#### **Before Use**

Follow these precautions to ensure safe operation and to obtain the full benefits of the various functions.

### 

If the connection cables or the instrument are damaged, there is a risk of an electric shock. Perform the following inspection before using the instrument:

Before using the instrument, check that the coatings of the connection cables



- are neither ripped nor torn and that no metal parts are exposed. Using the instrument under such conditions could result in an electric shock. Replace the connection cables with those specified by our company.
- Verify that it operates normally to ensure that no damage occurred during storage or shipping. If you find any damage, contact your authorized Hioki distributor or reseller.

#### Installing the instrument and modules

WARNING
Installing the instrument and modules in inappropriate locations may cause a
malfunction of the instrument or may give rise to an accident. Avoid the following
locations:

- · Exposed to direct sunlight or high temperatures
- Exposed to corrosive or combustible gases
- · Exposed to a strong electromagnetic field or electrostatic charge
- Near induction heating systems (such as high-frequency induction heating systems and IH cooking equipment)
- · Susceptible to vibration
- · Exposed to water, oil, chemicals, or solvents
- Exposed to high humidity or condensation
- · Exposed to high quantities of dust particles

### **ACAUTION**



Do not place the instrument on an unstable table or an inclined place. Dropping or knocking down the instrument can cause injury or damage to the instrument.

#### Installing the instrument

To prevent overheating, be sure to leave the specified clearances around the instrument.

- The instrument should be operated only with the bottom or rear side downwards.
- Vents must not be obstructed.
- Do not install the instrument at an angle.



#### Handling the Instrument and Modules





#### Handling the printer and the recording paper



The print head and surrounding metal parts can become hot. Be careful to avoid touching these parts.

**WARNING** 



Be careful not to cut yourself with the paper cutter.

- Please use only the specified recording paper. Using non-specified paper may not only result in faulty printing, but printing may become impossible.
- If the recording paper is skewed on the roller, paper jams may result.
- Always use the paper cutter to cut the printed paper. Excessive paper dust can accumulate on the roller if the paper is cut with the print head, which may result in paper jams or white streaks in the printing.

#### Storing data recordings

The recording paper is thermally sensitive. Observe the following precautions to avoid paper discoloration and fading.

- To avoid paper discoloration, do not expose it to direct sunlight. Store the paper at no more than 40°C and 90% RH.
- Store the paper away from dew and damp places.
- Make photocopies of recording printouts that are to be handled or stored for legal purposes.
- If the thermal paper is exposed to an organic solvent such as alcohol or ketone, it may no longer develop properly, and recorded data may fade. Keep the printer papers away from flexible PVC films and pressure sensitive tapes including scotch tapes because they contain organic solvents.
- Also, the thermal recording paper is ruined by contact with wet diazo copy paper.



Avoid exposure to direct sunlight.



Do not store the paper at

more than 40°C (104°F) and 90% RH.



Avoid stacking with wet Diazo copy paper.



Avoid exposure to volatile organic solvents like alcohol, ethers, and ketones.



Avoid contact with flexible PVC films or adhesive tapes such as scotch tapes.

#### Storing recording paper

- Store thermal paper where its temperature will not exceed 40°C.
- The paper will deteriorate if exposed to light for a long time; thus, do not remove the wrapping paper from the roll until it is ready to be used.

#### Handling storage devices

### **<u>A</u>CAUTION**

- Do not remove the storage device while it is being accessed by the instrument (while the **SAVE** key is lit in blue). Data saved on the device could be lost.
- Do not turn off the instrument while it is accessing the storage device (while the **SAVE** key is lit up in blue). Data saved on the device could be lost.
- Do not carry the instrument with a USB flash drive left connected. Damage could result.
- Exercise care when using such products because static electricity could damage the storage device or cause a malfunction of the instrument.
- Do not subject the SSD to extreme shock or vibration. Shock can cause it to be damaged.

#### IMPORTANT

- No compensation is available for loss of data stored on the built-in drive (SSD) or a removable storage device, regardless of the content or cause of damage or loss. Be sure to back up any important data saved on the built-in drive (SSD) or the removable storage device.
- Use only CF cards (no adapter is required to insert a CF card into the instrument.) or USB flash drive sold by Hioki.
- Compatibility and performance are not guaranteed for PC cards or USB flash drive made by other manufacturers. You may be unable to read from or save data to such cards.

   ■Hioki optional CF cards (with an adapter accompanying) and USB flash drive

   Model 9728 PC Card 512M, Model 9729 PC Card 1G, Model 9830 PC Card 2G
   Model Z4006 USB Drive
- With some external storage device, the instrument may not start up if it is turned on while the external storage device is inserted. In such a case, turn on the instrument first, and then insert the external media. Prior testing is recommended.
- The instrument does not support particular kind of USB flash drives, such as those that require fingerprint authentication or a password.
- When saving or loading data, insert the storage device before selecting data to be saved. When the storage device is not inserted, no devices are not displayed in the file list.
- All storage devices (built-in drive [SSD], USB flash drive, and CF card) have a limited service life. After extensive use for a long period, saving and loading data may be disabled. In that case, replace the device with a new one.
- The built-in drive (SSD) is a consumable part. When the saved data reaches the capacity (about 60 TB), no further data can be recorded. In such a case, the SSD should be replaced with a new one.
- When the instrument is left powered off for a one year or more, the data saved on the built-in drive (SSD) may be lost. Be sure to back up the data if the instrument is left powered off for a long time.
- Devices the automatic data saving supports are the built-in drive (SSD), a USB flash drive, and a CF card.

#### Before connecting cables

### 

#### When measuring power line voltage

• Connect the connecting cables to only the secondary side of a breaker. Even if a short-circuit occurs on the secondary side of the breaker, the breaker will interrupt a short-circuit current. Do not connect them to the primary side of the breaker because an unrestricted current flow could damage the instrument and facilities if a short circuit occurs.



- To prevent an electrical shock and a bodily injury, do not touch any input terminals on the VT (PT), CT or the instrument when they are in operation.
- Do not leave the measurement cables connected to the instrument in an environment where voltage surges exceeding the maximum input voltage may occur. Subjecting the instrument to such a voltage may result in damage to the instrument or a serious accident.
- Do not short-circuit two wires to be measured by bringing the connection cables into contact with them. Arcs or such grave accidents are likely to occur.
- To avoid a short-circuit or an electric shock, do not touch the metal parts of the connecting cable clips.
- To avoid electrical shock, be careful to avoid shorting live lines with the connection cable chips.

### 



To avoid an electric shock and a short-circuit accident, use only the specified test leads to connect the instrument input terminals to the circuit to be tested.

• To avoid an electric shock, do not exceed the lower of the ratings shown on the instrument and connection cords.



To prevent an electric shock, confirm that the white or red portion (insulation layer) inside the cable is not exposed. If a color inside the cable is exposed, do not use the cable.

### 

• The cable is hardened in the freezing temperatures. Do not bend or pull it to avoid tearing its shield or cutting cable.



<u>Connecting cables to the BNC jacks on modules</u>
 Do not use any cable terminated with a metal BNC connector. If you connect a metal BNC cable to an insulated BNC connector, the insulated BNC connector and the instrument may be damaged.



To prevent cable damage, do not step on cables or pinch them between other objects. Do not bend or pull on cables at their base.

#### IMPORTANT

- Use only the specified connection cables. Use of any cable not specified by our company does not allow safe measurements due to poor connection or other reasons.
- For detailed precautions and instructions regarding connections, refer to the instruction manuals for your modules, connection cables, etc.

#### Before connecting a logic probe to the measurement object



#### Before turning on the instrument





- To avoid electrical accidents and to maintain the safety specifications of this instrument, connect the power cord provided only to an outlet.
- Before turning the instrument on, make sure the supply voltage matches that indicated on its power connector. Connection to an improper supply voltage may damage the instrument and present an electrical hazard.

### 



Avoid using an uninterruptible power supply (UPS), DC/AC inverter with rectangularwave or pseudo-sine-wave output to power the instrument. Doing so may damage the instrument.

#### Before connecting the instrument to an external device

### 

To avoid electrical hazards and damage to the instrument, do not apply voltage exceeding the rated maximum to the external control terminals.

	I/O terminals	Maximum input voltage
Instrument	START/EXT.IN1	-0.5 V to 7 V DC
	STOP/EXT.IN2	-0.5 V to 7 V DC
	PRINT/EXT.IN3	-0.5 V to 7 V DC
	GO/EXT.OUT1	50 V DC, 50 mA DC, 200 mW
	NG/EXT.OUT2	50 V DC, 50 mA DC, 200 mW
	EXT.SMPL	-0.5 V to 7 V DC
	TRIG OUT	50 V DC, 50 mA DC, 200 mW
	EXT.TRIG	-0.5 V to 7 V DC
U8793	IN	-0.5 V to 7 V DC
Arbitrary Waveform Generator Unit	OUT	30 V DC, 50 mA DC

### 

To avoid an electric shock or damage to the equipment, always observe the following precautions when connecting the cables to external control terminals.

- Always turn off the instrument and any devices to be connected before making connections.
- Be careful to avoid exceeding the ratings of the external control terminals and the external connectors.
- The external control terminals use the same GND as the instrument. Ensure that devices and systems to be connected to the external control terminals are isolated from one another as required.

### 



To avoid equipment failure, do not disconnect the USB cable while communications are in progress.

• Use a common ground for both the instrument and the connection equipment. Using different ground circuits will result in a potential difference between the instrument's ground and the connected equipment's ground. If the cable is connected while such a potential difference exists, it may result in equipment malfunction or failure.



- Before connecting or disconnecting any cable, always turn off the instrument and the device to be connected. Failure to do so may result in equipment malfunction or damage.
- After connecting the communications cable, tighten the screws on the connector securely. Failure to secure the connector could result in equipment malfunction or damage.

#### **Disc precautions**

- Exercise care to keep the recorded side of discs free of dirt and scratches. When writing text on a disc's label, use a pen or marker with a soft tip.
- Keep discs inside a protective case and do not expose to direct sunlight, high temperatures, or high humidity.
- Hioki is not liable for any issues your computer system experiences in the course of using this disc.

#### When the instrument is not used for a long period

- To avoid straining some parts of the printer, and to prevent dirt adhering to the print head, close the printer cover.
- Perform test prints (printer check) three or four times before using the printer that has been in storage and has left unused for a long period.

#### **Precautions during shipment**

Store the packaging in which the instrument was delivered, as you will need it when transporting the instrument.

**Operation Precautions** 

### 1.1 Product Overview

This instrument enables you to measure and analyze various waveforms with simple methods. You can use this instrument mainly for facility diagnosis, preventive maintenance, and troubleshooting.



### **1.2 Part Names and Functions**



### Operation keys



1	DISP key Displays the waveform screen.	8	<b>STATUS key</b> Displays the status screen.
2	<b>CH.SET key</b> Displays the channel settings window on the waveform screen (p. 70).	9	CHAN key Displays the channel screen.
3	<b>TRIG.SET key</b> Displays the trigger settings window on the waveform screen (p. 211).	10	<b>FILE key</b> Displays the File screen. (p. 114)
4	F key Selects setting items.	11	AB CSR key (Lights up in red when selected.) Sets Cursors A and B. (p. 140)
5 E C C a K P k e f u a F 3 tt	ESC key Cancels the last action. Closes the displayed dialog and window. KEY LOCK: Press and hold the ESC key for 3 seconds to engage the key lock function, which prevents accidental operation. Press and hold this key for 3 seconds to disengage the key lock function.	12	WAVE key (Lights up in red when selected.) Assigns waveform scrolling to the jog dial and shuttle ring. (p. 146)
		13	Inner: Jog dial Outer: Shuttle ring Scrolls waveforms display. (p. 146) Increases and decreases a setting value. (p. 23)
6	STOP key Stops the measurement in progress.	14	CURSOR key Moves the cursor up, down, left, and right on the screen.
	Press the key once: Stops the measurement in progress after the instrument records the specified recording length of waveforms. Press the key twice: Immediately stops the measurement in progress. (p. 338)	15	Manual trigger key Manually trigger the instrument. (p. 226)
7	SYSTEM key Displays the system screen. (p. 335)	16	START key Starts measurement. (Lights up in green during measurement.) (p. 338)

1 Overview



### **1.3 Screens Configuration**

The screens are configured as listed below. Pressing each of the keys listed below displays a corresponding screen or window.

The waveform screen can display the trigger settings window, and the channel settings window.

#### Waveform screen



The display used to observe waveforms.

Configure measurement conditions using the settings window on the right.

#### Trigger settings window, channel settings window



The display used to configure the trigger settings

The display used to configure the settings of analog channels and logic channels

#### **Status screen**

ST/	ATUS
_	

The window used to configure the measurement methods and numerical calculation settings.

Pressing the **STATUS** key switches the sheets to be displayed in the following order: **[Status]** sheet, **[Num Calc]** sheet, **[Memory Div]** sheet, and **[Wave Calc]** sheet.

#### **Channel screen**



The screen used to configure the channel, the scaling, and the comment settings Pressing the **CHAN** key switches the sheets to be displayed in the following order: **[Unit List]** sheet, **[Each Ch]** sheet, **[Scaling]** sheet, and **[Comment]** sheet.

#### System screen

SYSTEM

The screen used to configure the environment, the file saving, the file printing, and the interface settings, and to initialize data.

Pressing the **SYSTEM** key switches sheets to be displayed in the following order: [Environment] sheet, [File Save] sheet, [Printer] sheet, [Interface] sheet, and [Init] sheet.

#### File screen

FILE

The screen used to view saved data files in storage devices (a CompactFlash card, the built-in drive, a USB flash drive, the internal memory).

### Explanation of screen contents

#### Waveform screen



#### Items common to the Status, Channel, System, and File screens



Messages such as "Online," "Key Lock active.," and error messages also appear here.

### **1.4 Basic Key Operation**

1

2

#### Press the CURSOR key and move the cursor to an item to be changed.



### Check the illustrations on the GUI and press the function key (F key) to change the settings.

The function assigned to the **F** key varies depending on the setting items.

#### To select an item to be set



#### To increase and decrease a setting value



Press the **F** key to change the setting value. (Turning the jog dial or shuttle ring enables you to change values.)

### 

### For some settings, press the CH.SET key to select [Exec], and press the TRIG.SET key to select [Cancel].

To enter characters and numbers See "8.1.3 Entering Alphanumeric Characters" (p. 163).

### 1.4.1 Using the HELP Key

Pressing the **HELP** key displays a simple explanation of the item at the cursor position. You can also search the help messages for the information for which you are looking.

#### Cursor position help



Move the cursor to the item for which you want to display a help message.

### Press the HELP key. The [Cursor Pos Help] sheet that contains the help message of the cursor position appears.

. . . . . . . . . . .

Pressing the CURSOR up and down keys or turning the Jog dial scrolls the information.

Cursor Pos Help • Function Setting Sets the settings for the functions. Memory Selects memory function After the input signal data is recorded in the built-in memory, display and printing are available. As measurement can be carried out in high speed sampling, this is suitable for transitional waveform measurement.	Auto       Timebase:       1        1       1       1       1       1       1       1       1       1       1       1       1       1       1       1       1
	100div
	( 1.000 s)
	TUETUOKA
	A M
	REGURDER
	I I
	X-Y DECODIED
	A THEORY AND A
[Zoom In/Out: CH.SET key]	
[SCROLL: Press up/down on the + key or use the jog shuttle]	

- Pressing the **CH.SET** key switches the display mode of the **[Cursor Pos Help]** sheet between the following modes: The full-screen display, the upper-half display, and the lower-half display. The figure above illustrates the upper-half display mode.
- Pressing the HELP key closes the [Cursor Pos Help] sheet.

### 1.4.2 Using Mouse to Enable Key Operation

Using a commercially available USB mouse enables you to operate the instrument in the manner similar to that with the keys on the instrument.

- The instrument may not support some types of mouses.
- Do not connect any type of device other than a mouse or a USB flash drive to the USB connector of the instrument.
- Operating the instrument with a mouse may cause temporary operating delay or abnormal screen display.
- While operating the instrument with a mouse, do not change the interface on the system screen to anything other than "LAN." Operating the instrument with a mouse is disabled while USB communications are in progress.
- External noise may cause the instrument to malfunction while it is operated with a mouse. Keep the mouse and mouse cable as far away as possible from sources of noise.

The figure below illustrates the basic operation of the instrument with a mouse.



The operation keys of the instrument and the shortcut menu relate to each other as follows.



To operate the functions assigned to the **CH.SET**, **WAVE**, and **AB CSR** keys and to configure those settings, click the icons displayed while a mouse is connected to the instrument.

lcon	Operation key
CH	CH.SET key
WAVE	WAVE key
AB CSR	WAVE key

#### Useful functionality

Dragging the right button of the mouse (hold down the button, moving the mouse rightward, leftward, or forward, and then release the button) performs the same function as when pressing the following keys: Rightward: START Leftward: STOP Upward: ESC

## **Preparing for Measurement**

#### Procedure

2

1	Install the instrument.	(p. 7)
2	Install or remove modules. (When adding or replacing modules)	(p. 28)
3	Connect logic probes to the LOGIC terminals.	(p. 42)
4	Connect connection cables to the modules. (When measuring analog signals) Probes and cables differ depending on the type of measurement to be performed.	<b>(p. 30)</b> of
5	Insert a storage device (CF card, USB flash drive).	(p. 47)
6	Load a roll of recording paper.	(p. 49)
7	Connect the power cord.	(p. 51)
8	Connect an earthing wire to the GND terminal (functional earth terminal). (When performing measurement in noisy environments)	(p. 51)
9	Turn on the instrument.	(p. 52)
10	Set the clock	(p. 53)
11	Perform zero-adjustment Perform calibration (For the instrument with Model MR8990 installed)	(p. 54) (p. 55)
	After preparation terminates, start	

measurement. (p. 57)

#### To operate the instrument with a computer

Refer to "16 Connecting the Instrument to a Computer" (p. 341).

#### To control the instrument externally

Refer to "17 Controlling the Instrument Externally" (p. 369).



6

#### 2.1 **Installing and Removing Modules**

Read "Handling the Instrument and Modules" (p. 8) carefully.

Modules ordered with the instrument has already been installed in the instrument. Follow the procedures

below to add, replace, or remove modules from the instrument.

- · Up to three logic units can be installed. The instrument ignores the fourth logic module and later modules that are installed in the instrument.
- For information on the analog channel resolution when logic channels are used, refer to "8.10 Setting Details of Modules" (p. 184).

#### Installing a module

**Right side** 



- Required items: Phillips-head screwdriver (No. 2)
  - 1 Turn off the instrument.



- 2 Orient the module and insert it all the way into the instrument. Make certain that the module is installed in such a way that the characters printed on the module's panel are right side up about those printed on the instrument.
- 3 Tighten the two module mounting screws with a Phillips screwdriver.

#### Removing a module

**Right side** 



(Example: Model 8966)

- 1 Turn off the instrument.
- 2 Remove all connection cables and thermocouples connected to the module.
- 3 Remove the power cord.
- 4 Loosen the two module mounting screws with a Phillips screwdriver.
- 5 Pinch the knobs and pull out the module.

Required items: Phillips-head screwdriver (No. 2)

#### When not installing another module after removal



- 1 Place a blank panel.
- 2 Tighten two screws with a Phillips screwdriver.

If measurement is performed with the instrument without a blank panel installed, the instrument may fail to meet specifications because of temperature instability within modules.
## Channel configuration

Modules are numbered beginning at the top, and channels are numbered beginning at the left of the module installed at the top.

You can find out information about the modules installed in the instrument in the System Information (p. 444).





If a Logic Unit has been installed as unit 7

# 2.2 Attaching Connection Cables

Read "Before connecting cables" (p. 12) carefully.

For detailed precautions and instructions regarding connections, refer to the instruction manuals for your modules, connection cables, etc.

## Measuring voltage



## Connecting cables to the BNC female terminals on modules

## Example: Model 8966 Analog Unit



Required item: Connection cables

- Connect the BNC male connector of the cable to a BNC female connector on the module.
- 2 Align the slots in the BNC male connector with the bayonet lugs on the BNC female connector on the module, then attach the male connector while turning it clockwise until it locks.
- **3** Connect the cable clips to a measurement object.

# To disconnect the connection cable from the BNC female connector

Turn the BNC male connector counterclockwise, then pull it out.

## Measuring Frequency, Number of Rotations, and Count

## Refer to (p. 31) for details about connecting a cable to the BNC female terminal.



## **Measuring temperature**



## Connecting thermocouples to the terminal blocks



## Required items:

Thermocouple, flat-blade screwdriver (2.6-mm blade)

Recommended wire:

Compatible wire: Thermocouple element wires from 0.4 mm to 1.2 mm in diameter Strip length: 10 mm

**1** Strip the insulation of the thermocouple wires as shown on the left.

Strip length: approx. 10 mm

- 2 Depress the button on the terminal block on the module with the flatblade screwdriver.
- 3 Insert each thermocouple wire into the appropriate terminal hole while depressing the button.

Confirm proper polarity.

- **4 Release the button.** The thermocouple is connected.
- **5** Connect to the measurement object.

## To remove the thermocouple

Pull the thermocouple wire while depressing the button.

- If noise influences surrounding equipment, turn the thermocouple around the accessory ferrite clamp-on choke several times (as seen in the right diagram).
   When connecting the thermocouple that is more than 3 meters long, the
- When connecting the thermocouple that is more than 3 meters long, the measurement may be affected by EMC environments including external noise.



## Measuring vibration or displacement with a strain gauge transducer



The following device can be connected to the module.

• Strain gauge transducer (Not available from Hioki)

Connect L9769 or 9769 Conversion Cable to the strain gauge transducer.

Connect a strain gauge transducer to a connector on Model U8969 Strain Unit via Model L9769 Conversion Cable; Model 8969 Strain Unit via Model 9769 Conversion Cable.

## Connecting the strain gauge transducer to a module's connector

Example: Connecting the strain gauge transducer to Model U8969 Strain Unit via Model L9769 Conversion Cable



#### **Required items:**

Model L9769 Conversion Cable, strain gauge transducer

- Insert Model L9769 into a connector of Model U8969 with the slot of the plug aligned with the outward indentation of the connector.
- 2 Insert the plug into the connector until they are locked together.
- **3** Connect Model L9769 to the strain gauge transducer.
- 4 Connect the strain gauge transducer to a measurement object.

#### How to disconnect Model L9769

Pull the sleeve of the plug gently, releasing the plug, and disconnect the cable.

The instrument describes Model U8969 as "8969."

## **Connector pin-out**

Model U8969 Strain Unit
The metal shell is connected to the GND of the instrument.

Pin mark	Description		
А	BRIDGE+		
В	INPUT-		
С	BRIDGE-		
D	INPUT+		
E	FLOATING COMMON		
F	SENSE+		
G	SENSE-		
H, J	N.C.		

Model L9769 Conversion Cable
(Strain gauge transducer end)



Applied voltage: bridge voltage of 2 V

The metal shell is connected to the GND of the instrument.

Pin mark	Description		
A	BRIDGE+, SENSE+		
В	INPUT-		
С	BRIDGE-, SENSE-		
D	INPUT+		
E	FLOATING COMMON		
F, G	N.C.		

## **Connection of Model L9769**

- Pin F of the module end is connected with Pin A of the strain gauge transducer end.
- Pin G of the module end is connected with Pin C of the strain gauge transducer end.

## Example: Connecting the strain gauge transducer to Model 8969 Strain Unit via Model 9769 **Conversion Cable**



## **Connector pin-out**

Model 8969 Strain Unit (Pin 1 is on the left when the module's top side is on the up) . . . . .

2 3 4 5 6 7

Pin No.	Description
1	BRIDGE+
2	SENSE+
3	INPUT+
4	INPUT-
5	BRIDGE-
6	SENSE-
7	FLOATING COMMON

#### **Required items:**

Model 9769 Conversion Cable, strain gauge transducer

1 Connect Model 9769 to a connector on the module.

> Insert the connector of Model 9769 with the orange part facing upward.

- **2** Connect the Model 9769 to the strain gauge transducer.
- 3 Connect the strain gauge transducer to a measurement object.



Applied voltage: bridge voltage of 2V

The metal shell is connected to the GND of Model 8969.

Pin mark	Description		
А	BRIDGE+		
В	INPUT-		
С	BRIDGE-		
D	INPUT+		
E	FLOATING COMMON		
F, G	N.C.		

#### **IMPORTANT**

- Preforming measurement with a strain gauge requires a bridge box. Use a strain gauge and bridge box both of which are commercially available.
- The bridge box may be susceptible to the effect of noise. For more information about how to ground the bridge box, refer to its instruction manual or contact the manufacturer of the bridge box.

#### **IMPORTANT**

Do not excessively bend the cable and the base between cable and connector, pull on them, nor twist them. Doing so may cause the conversion cable to break.

## **Measuring current**

## Current sensors that can be connected to current modules

Model number

9709

9709-05

9272-05

9272-10 CT6841

CT6841-05

CT6843-05

CT6844-05

CT6845-05

CT6846-05

CT6862-05

CT6863-05

CT6865-05

CT6843

CT6844

CT6845

CT6846

CT6862

CT6863

CT6865

CT6875

CT6876

CT6877

The following current sensors can be connected to Model U8977 3CH Current Unit and Model 8971 Current Unit. Use of conversion cables may be required depending on sensors and modules.

✓ : Directly connectib				
Model name	Maximum input current / Frequency	Conversion cable for U8977	Conversion cable for 8971	C <u>onn</u> ector*1
	500 4	CT9900	9318	Plastic
AC/DC Current Sensor	500 A DC to 100 kHz	$\checkmark$	CT9901 + 9318	Metal
Clamp on Sensor	20 A/200 A	√	CT9901 + 9318	Metal
		CT9900	9318	Plastic
	00.4	CT9900	9318	Plastic
AC/DC Current Probe	DC to 1 MHz	~	CT9901 + 9318	Metal
	000.4	CT9900	9318	Plastic
AC/DC Current Probe	200 A DC to 500 kHz	~	CT9901 + 9318	Metal
AC/DC Current Probe	500 A DC to 200 kHz	CT9900	9318	Plastic
		~	CT9901 + 9318	Metal
	500 A DC to 100 kHz	CT9900	9318	Plastic
AC/DC Current Probe		~	CT9901 + 9318	Metal
	1000 A DC to 20 kHz	CT9900	9318	Plastic
AC/DC Current Probe		~	CT9901 + 9318	Metal
AC/DC Current Sensor	50 A DC to 1 MHz	CT9900	9318	Plastic
		$\checkmark$	CT9901 + 9318	Metal
	000.1	CT9900	9318	Plastic
AC/DC Current Sensor	DC to 500 kHz	$\checkmark$	CT9901 + 9318	Metal
	1000 4	CT9900	9318	Plastic
AC/DC Current Sensor	DC to 20 kHz	~	CT9901	Metal

 $\checkmark$ 

√

√

✓: Directly connectible

\*1: Metal connector (ME15W), plastic connector (PL23)

AC/DC Current Sensor

AC/DC Current Sensor

AC/DC Current Sensor

500 A

DC to 2 MHz 1000 A

DC to 1.5 MHz

2000 A

DC to 1 MHz

Metal

Metal

Metal

+ 9318

CT9901

+ 9318

CT9901

+ 9318

Not connectible

## **Connecting current sensors to Model 8971 Current Unit**

Current sensors with a black resin connector (PL23), whose model numbers do not end in -05, can be connected to Model 8971 using the optional Model 9318 Conversion Cable\*.

\*: Model 9318 Conversion Cable is an accessory of Model 8971 Current Unit.



- Aligning the guides of the conversion cable with those of the sensor connector on the module, and straightly insert the plug until it locks.
- 2 Align the guides of the current sensor to be used with those of the conversion cable connector, and straightly insert the plug until it locks.

The instrument automatically recognizes the model of the current sensor.

**3** Clamp the current sensor around a line of a measurement target.

How to disconnect the current sensor

- **1** Hold and pull the plastic collar of the conversion cable, which releases the lock, and the remove the connector.
- 2 Hold and pull the plastic collar of the current sensor, which releases the lock, and the remove the connector.

## When measuring current with Model 9018-50 Clamp On Probe

Using Model 9018-50 enables voltage measurement modules such as Model 8966 Analog Unit to measure current.

For more information about how to configure the instrument for use in this type of application, refer to "8.5.1 Example of Scaling Settings" (p. 174).

## Connecting current sensors to Model U8977 3CH Current Unit

Current sensors with metal connectors (ME15W), indicated by a model number ending in -05, can be connected directly.

Align the connector guides.

Orient so that the wide ridge is positioned at the top of the instrument.



1

Grip the metal part of the connector.

Current sensors with a black resin connector (PL23), whose model numbers do not end in -05, can be connected to Model U8977 3CH Current Sensor using the optional Model CT9900 Conversion Cable.



If the CT6846 or CT6865 (1000 A rating) is connected using Model CT9900 Conversion Cable, it will be recognized as a 500 A AC/DC sensor. Set the CT ratio to 2.00.

Current sensors in the CT7000 series can be connected to Model U8977 3CH Current Unit using the optional Model CT9920 Conversion Cable. When using the CT9920, sensors will not be recognized automatically. Select the supported mode on the settings screen. Supported models: CT7631, CT7636, CT7642, CT7731, CT7736, CT7742, CT7044, CT7045, CT7046



## Measuring acceleration

Familiarize yourself with "Operation Precautions" (p. 7) before connecting a current sensor.



The following device can be connected to the module. • Acceleration sensor (Not available from Hioki)

Connect a acceleration sensor to Model U8979 Charge Unit.

## Acceleration sensor connectable with Model U8979



Use an acceleration sensor with a built-in pre-amplifier that conforms to the specification of Model U8979 Charge Unit. Using an inapplicable sensor may cause damaging itself.

Acceleration sensor type	Terminal the sensor is connected to	Note
With a built-in pre-amplifier	BNC connector	Drive power: 3.5 mA, 22 V
Charge output	Miniature connector (#10-32)	_

**CAUTION** 

## Connecting an acceleration sensor with a built-in pre-amplifier

Connecting a BNC-output acceleration sensor with a built-in pre-amplifier



- Align the slots in the BNC connector of an acceleration sensor with the locking studs of a BNC connector on the module, and insert the connector.
- 2 Turn the BNC connector of the acceleration sensor clockwise until it locks.
- **3** Attach the acceleration sensor with the built-in pre-amplifier to a measurement target.

#### How to remove the acceleration sensor Turn the BNC connector of the acceleration sensor counter-clockwise to release the lock and remove the connector.

#### Connecting an acceleration sensor other than a sensor with a built-in pre-amplifier

Convert the output connector into the BNC connector using a commercially available conversion connector or conversion cable to connect the sensor.

## Connecting a charge-output acceleration sensor

Connecting a charge-output acceleration sensor equipped with the miniature connector (#10-32)



# Connecting a charge-output acceleration sensor equipped with a connector other than a miniature connector (#10-32)

Convert the output connector into the miniature connector (#10-32) using a commercially available conversion connector or conversion cable to connect the sensor.

## **Measuring logic signals**

Read "Before connecting a logic probe to the measurement object" (p. 13) carefully. For more information about logic probe specifications, refer to the instruction manual of your logic probe.



The logic channels LA through LD are installed in the instrument.

## The following logic probes can be connected to the LOGIC

terminals

# Connecting logic probes to the logic terminals

## Example: Connecting Model 9327 Logic Probe





**Required items:** Model 9327 Logic Probe

- 1 Aligning the plug slots of the logic probe with a logic terminal, insert the logic probe plug.
- 2 Connect the logic probe to a measurement object.

## Measuring voltage with a high degree of accuracy (digital voltmeter)



## The following lead can be connected to the module.

 Model L2200 Test Lead (Maximum input voltage: 1000 V)



Connect the test lead to the banana jacks on the module.

## Connecting test leads to the banana jacks



# Required items: Test leads mentioned above

**1** Connect the test leads to the banana jacks on the module.

Connect the black lead to the L jack; and the red lead to the H jack. Make sure the test lead plugs are fully inserted in the jacks.

2 Connect the test lead to a measurement object.

## Measuring high voltage

Applicable Module • Model U8974 High Voltage Unit	<ul> <li>The following cables can be connected to the module.</li> <li>Model L4940 Connection Cable Set (Maximum input voltage: 1000 V)</li> </ul>
Connect the connection cable to the	

Connect the connection cable to the banana jacks on the module.

## Connecting connection cables to the banana jacks



Access		
+ Model L4934	Model L4934 Small Alligator Clip Set * Model L4932 is required when using Model L4934.	
	Model L4935 Alligator Clip Set	
	Model L9243 Grabber Clip	3 Connect the clips to a measurement
	Model L4936 Bus Bar Clip Set	
	Model L4937 Magnetic Adapter Set	
	Model L4932 Test Pin Set	





Connect the connection cable to the output terminal of a module.



## Connecting a connection cable to the output terminals

Example: Model U8793

waveform.



Required item: Connection cable mentioned above

- Insert the SMB connector of connection cable in the output terminal of the module until it clicks.
- 2 Connect the cable clips to an object to which the instrument applies the waveform.

## To disconnect output connectors

Firmly pinch the head of the SMB connector (other than the cable), and pull it out.

## Outputting a pulse waveform

Applicable Module
• Model MR8791 Pulse Generator
Unit

Required items: Commercially available cable (Half-pitch 50 pins)

## Connecting a connection cable to the output connector



### Required items: Commercially available cable

- **1** Connect the connection cable to the output connector of the module.
- **2** Connect the connection cable to the object to which the instrument applies the waveform.

# To disconnect the connection cable from output connectors

Pull the connector while depressing the buttons of the connection cable.

## Output connector

10250-52A2PL: Sumitomo 3M products (SCSI-2 connector), (Centronics half-pitch 50 pins socket-contact) Refer to "Specifications of output connector" (p. 424).

- The metal shell of the connector 10250-52A2PL has the same potential as the ground of the instrument (frame ground).
- Use a lock-type connector for connecting a wire harness and the connector.

# 2.3 Preparing Storage Devices

Read "Handling storage devices" (p. 11) carefully.

# 2.3.1 Available Storage Devices (Inserting a CF Card and a USB Flash Drive)

Icons indicatir devices	ig storage	The icons indicating the status of storage devices always appear at the top of the screen.			
CF	<u>c</u>		<b>CFC</b> : Storage devices are inserted.		
USB CF c flash drive	ard Built-in drive	# 🖬 🗳	: Storage devices are inserted and selected as the save destination. (Shown in red)		
		" m 🖉	: Storage devices a as the save destina (Shown in black)	are not inserted; however, selected ation.	
Storage device		ŀ	low to insert devices	, notes	
	Insert a CF ca	rd		Front side CF card slot	
CE card	Fully insert a C the mark (▲) p When the eject and then insert the CF card wh may cause dan card cannot be forcedly. Depre and then insert	F card with the top ointing toward the s button sticks out, d the CF card complet ille the eject button nage to the instrume inserted completely ss the eject button to the CF card again.	facing upward and lot. epress the button, etely. Inserting is sticking out ent. If the CF y, do not insert it to make it stick out,		
CF Card	To remove the Depress the eje extended, depr	e <b>CF card</b> ect button. After the ress it again to eject	button is the CF card.	Eject CF card	
Built-in drive	Model U8331 S * After formattir available capac The optional M Hioki formatted	SD Unit (storage ca ng the drive, its capa city. odel U8331 SSD Un I the hard disk durin	apacity: 128 GB* 1 GE acity is decreased to le nit (factory option) is re g the production proce	3 = 1,000,000,000 bytes) ss than 128 GB, which is an actually equired. ss.	

Storage device	How to insert devices, notes			
Memory (INT) F8 Memory (INT)	<ul> <li>The memory installed in the instrument is available. Only settings files can be written in the memory.</li> <li>Automatic writing of data is not possible.</li> </ul>			
	<ul> <li>Do not connect any devices other than USB flash drives.</li> <li>The instrument does not support all commercially available USB flash drives.</li> <li>To use a USB flash drive, you have to configure the setting on the instrument. See the procedure described on the following page.</li> </ul>			
	Inserting a USB flash drive	Right side		
USB flash	Orient the USB flash drive and insert it all the way into the connector.	USB connector (Type A)		
USB Stick	Removing the USB flash drive Make sure that the instrument is not accessing the USB flash drive (for saving or loading data, etc.), and then remove the USB flash drive. (No operation is required on the instrument.)			

Depending on the intended use of the USB flash drive, connector types and settings on the instrument differ.

	Connector	Instrument settings		Reference
		Interface	USB setting	information
Using a USB flash drive	Туре А	LAN	USB Stick	See the following procedure.
Retrieving files saved on a CF card or the built-in drive with a computer (via a USB cable)	Туре В	LAN	Mass storage HDD, Mass storage CF	"16.4" (p. 359)
Operating the instrument from a computer (via a USB cable)	Туре В	USB	Interface	"16.6.1" (p. 361)

Even when the SSD is installed as a built-in drive, it is recognized as an HDD.

## Procedure

#### To display the screen

Press the **SYSTEM** key several times to display the **[Interface]** sheet on the system screen.

1 Move the cursor to the [Interface] box, and then select [LAN].

Interface) — Interface Use DHCP	LAN
USB Set	USB Stick

**2** Move the cursor to the [USB Set] box, and then select [USB Stick].

Format

CF

# 2.3.2 Formatting Storage Devices

The instrument can format CF cards, USB flash drives, the built-in drive, and the internal memory. Once they are formatted, the "HIOKI8847" folder is created.

Note that formatting a storage device deletes all the information on the storage device, and the deleted information is unrecoverable.

## Procedure

#### To display the screen

Press the **FILE** key to display the file screen.

- 1 Insert a storage device.
- 2 Select [Next Page]. Select [Format].

The cursor is placed on the [Format Target] box.

**3** Select a storage device to be formatted, and then select [Exec].

The specified storage device is formatted.

A confirmation window is displayed. Select **[Yes]** to proceed the formatting action. Select **[No]** to cancel the formatting action.

# 2.4 Loading Recording Paper

Read "Handling the printer and the recording paper" (p. 10) carefully.

#### Procedure

<u>Required items: Model MR9231 Recording Paper, Paper</u> roll axles (accessory)

Command

Format Target





**1** Press the button to open the printer cover.

2 Insert the paper roll axles into the core of Model 9321 Recording Paper.

_
_
_







## **3** Put the paper into the holder.

Insert first the left side of the paper into the holder, and then, until the holder clicks, put the paper into the holder while pressing the paper leftward.

Face the print side of the paper upward. If the paper is put in the holder without the paper roll axle installed, the printer cover cannot be open, resulting in damage to the printer.

**4** Pull out the edge of the paper toward yourself, and close the printer cover while applying the face of the paper to the cover's side surface.

The surface of the paper may become sticky due to the residue left behind by the adhesive tape, with the result that the printing on that area becomes unprintable. Unroll approximately the first 200 mm of paper before inserting it into the printer.

## How to withdraw the recording paper

As shown in the left figure, withdraw the paper while pressing the paper roll axle leftward.

# 2.5 Supplying Power

Read "Before turning on the instrument" (p. 13) carefully.

## 2.5.1 Connecting the Power Cord

## Procedure

- **1** Connect the power cord to the power inlet on the instrument.
- **2** Plug the power cord into the mains outlet.



# 2.5.2 Connecting an Earthing Wire to the GND Terminal (Functional Earth Terminal)

When performing measurement in a noisy environment, you can improve the noise immunity by connecting an earthing wire to the GND terminal (functional earth terminal).

When using a potential transformer (PT) for AC power line measurement or others, connect an earthing wire to the GND terminal of the PT.

#### **Right side**



## 2.5.3 Turning On and Off the Instrument

## **Turning on the Instrument**



## Set the power switch in the on position (

The splash screen is displayed first, and then the waveform screen is displayed.

### Before starting measurement

To perform precise measurement, warm up the instrument about 30 minutes after turning on the instrument to stabilize the internal temperature of the modules. After warm-up, perform zero adjustment before performing measurement.

## Turning off the instrument

## Before turning off the instrument

When the instrument is turned off, data recorded in the internal memory is deleted. When you do not want to lose recorded data, save it first to a CF card or an external storage device. Refer to "5 Saving/Loading Data and Managing Files" (p. 91).

#### **Right side**



## Set the power switch in the off position ( $\bigcirc$ ).

The instrument is turned off.

After the instrument is turned on again, the display is displayed with the same settings as when the instrument was turned off last time.

When the auto-setup function is enabled, settings are read and configured automatically. (p. 113)

# 2.6 Setting the Clock

Set date and time for the built-in clock as follows.

The clock has an automatic calendar with leap year correction and 24-hour format.

The functions listed below make use of the clock. Ensure that the clock is set correctly before using these functions.

- · Performing measurement with timer-based trigger enabled
- Printing data including times of trigger events
- · Saving measured data

## Procedure

#### To display the screen

Press the **SYSTEM** key several times to display the **[Init]** sheet on the system screen.

1 Move the cursor to the [Clock] box. HIOKI Environment File Save Printer [Clock] 2 Select the digits to change and set the 2021 / 04 / 20 09 : 00 : 00 numeric values. Date setting Time setting (Year, month, day) (Hour, minute, second) **3** While the cursor is placed on one of the [Clock] settings, select [Apply]. YS TEM (Push) 20-Apr 9:00:10 The date and time settings are accepted. Function: The date and time are displayed at the top right of MEMORY the screen. 01

# 2.7 Adjusting the Zero Position (zero-adjustment)

This operation compensates potential deflection of modules and sets the reference potential of the instrument to 0 V.

The compensation operation is performed for all channels and ranges.

## Before performing zero-adjustment

- Warm up the instrument for about 30 minutes after the power-on to stabilize the internal temperature of the modules, and then perform zero-adjustment.
- Note that zero-adjustment cannot be performed during measurement.
- Key operation is not accepted during zero-adjustment.
- The time required for zero-adjustment varies depending on types and the number of modules installed in the instrument. (The operation may take several seconds.)

#### Procedure

#### To display the screen

Press the CHAN key several times to display the [Unit List] sheet on the channel screen.

- **1** Move the cursor to the [Zero-Adjust] box.
- 2 Select [Exec Zero-Adjust].

The zero-adjustment is executed.



Zero-adjustment has no effect on the 8969 and U8969 Strain Unit. (Adjust the zero position using the auto-balance. (p. 188))

#### Perform zero-adjustment in the following cases.

- · When a module has been replaced
- When the instrument has been cycled.
- When settings has been initialized (system reset)
- When measurement mode has been switched between DC and RMS on Model 8971 Current Unit, 8972 DC/RMS Unit, or U8974 High Voltage Unit
- When measurement mode has been switched on Model U8979 Charge Unit
- When the ambient temperature has changed significantly The zero-position drift\* may occur.

\* Drift:

This means a spurious output caused by a shift in an operating point of an operational amplifier. Drift can occur due to changes in temperature and due to component aging over a period of use.

# 2.8 Performing Calibration (When Model MR8990 is Installed)

This operation calibrates the scale of MR8990 Digital Voltmeter Unit. The compensation operation is performed for all channels and ranges.

## Before performing calibration

- Warm up the instrument for about 30 minutes after the power-on to stabilize the internal temperature of the modules, and then perform zero-adjustment.
- Note that calibration cannot be performed during measurement. However, when the calibration setting is set to on, calibration is performed at the start of measurement.
- Key operation is not accepted during calibration.
- The time required for calibration varies depending on types and number of modules installed in the instrument. (The operation may take several seconds.)

## Procedure

#### To display the screen

Press the CHAN key several times to display the [Unit List] sheet on the channel screen.

- **1** Move the cursor to the [Zero-Adjust] box.
- 2 Select [Exec Zero-Adjust].

Calibration is executed.

## In the following cases, calibration should be executed again.

- · When a module has been replaced
- When the instrument has been cycled.
- · When settings has been initialized (system reset)
- · When the ambient temperature has changed significantly

Performing Calibration (When Model MR8990 is Installed)

# Measurement

# 3.1 Measurement Procedure

## **1** Inspecting the instrument before measurement

Refer to "3.2 Inspecting the Instrument Before Measurement" (p. 59).

## 2 Configuring the basic measurement settings

Select a suitable recording method for an object to be measured

Set the sampling rate

Set the recording length

Set the waveform display format and printing format Refer to the following pages:

"3.3.1 Measurement Functions" (p. 60)

"3.3.2 Time Axis Range and Sampling Rate" (p. 62)

"3.3.3 Recording Length (Number of Divisions)" (p. 66)

"3.3.4 Screen Layout" (p. 69)

#### Advanced settings

Refer to the following pages:

- "7.4 Plotting X-Y Composite Curves" (p. 148)
- "8.2 Displaying Waveforms During the Writing in the Memory Simultaneously (Roll Mode)" (p. 167)
- "8.3 Overlaying New Waveforms With Past Waveforms" (p. 168)
- "10 Numerical Calculation Functions" (p. 235)

## 3 Configuring the input channel settings

Configure the analog channel settings

Configure the logic channel settings

#### Advanced settings

Refer to the following pages:

- "8.1 Adding Comments" (p. 160)
- "8.5 Converting Input Values (Scaling Function)" (p. 171)
- "8.6 Setting the Waveform Position (Variable Function)" (p. 178)
- "8.1 Adding Comments" (p. 160)
- "8.8 Inverting the Waveform (Invert Function)" (p. 182)

## 4 Configuring the trigger settings

Refer to "9 Setting the Trigger" (p. 211).

Refer to the following pages: "3.4.2 Configuring Analog Channels Settings" (p. 73)

"3.4.3 Configuring Logic Channel Settings" (p. 76)

## **5 Starting measurement**

Refer to the following pages:

- "3.5 Starting and Stopping Measurement" (p. 79)
- "5 Saving/Loading Data and Managing Files" (p. 91)
- "6 Printing Data" (p. 125)
- "7.1 Reading Measured Values (Using Cursors A and B)" (p. 140)
- "7.3.2 Scrolling the Waveforms With the Jog Dial and Shuttle Ring" (p. 146)
- "7.5 Magnifying and Demagnifying Waveforms" (p. 150)

## 6 Completing the measurement

Refer to "3.5 Starting and Stopping Measurement" (p. 79).

#### To observe the input signal

Pressing the **AUTO** key configures the timebase of the input waveform, vertical axis (voltage axis) range, and zero-adjust settings automatically and then starts measurement. Refer to "3.6 Measurement With Automatic Range Setting (Auto-Ranging Function)" (p. 82).

#### To load previously saved settings

Load the settings file using the file screen.

Saving the settings with respect to each measurement object and each application enables you to perform measurement more convenient.

Refer to "5.3 Loading Data" (p. 110).

#### To automatically load previously saved settings at power-on

Previously saved measurement settings can be automatically loaded from a file when the instrument is turned on. Simply insert a CF card containing an auto-settings file before turning on the instrument.

Refer to "5.4 Automatically Loading Settings (Auto-setup Function)" (p. 113).

Make sure that the "HIOKI8847" folder of the CF card contains the file.

#### To initialize the instrument (restoring the basic default settings)

From the system screen, select the **[Init]** sheet to reset the instrument to the factory default settings.

After initialized, the instrument is set up to perform simple measurement easily.

If the operation of the instrument seems unusual or overly complex, initialize the instrument. Refer to "19.2 Resetting the Instrument" (p. 435).

# 3.2 Inspecting the Instrument Before Measurement

Before using the instrument for the first time, verify that it operates normally to ensure that no damage occurred during storage or shipping. If you find any damage, contact your authorized Hioki distributor or reseller.

### (1) Inspecting products used with the instrument

#### When using probes and connection cables

Does the waveform screen appear?

Yes

Inspection terminates.



The instrument may be damaged. Request repairs.

Measurement

## 3.3 Setting Measurement Conditions

This section describes how to set measurement conditions.

The settings window displayed on the Waveform display enables you to configure basic settings conveniently while you are observing waveforms. The basic settings can also be configured on the **[Status]** sheet of the status screen

## How to open the settings window



## 3.3.1 Measurement Functions

Select a function depending on a type of measurement.

#### Procedure

#### To display the screen

Press the **DISP** key to display the waveform screen.

Move the cursor to the function box (the uppermost column of the settings window).

MEMORY (Default setting) / RECORDER / X-Y RECORDER / FFT

MEMORY	<b>Used to measure instantaneous waveforms and transient phenomenon.</b> You can use the trigger and calculation functions.
RECORDER	Used to observe and record fluctuations of phenomenon changing slowly You can print data in real time.
X-Y RECORDER	<b>Used to observe signals endlessly in X-Y curve format</b> You can set the X-Y composite curves plotting setting to on/off in the same manner as the pen raising/lowering setting installed in typical X-Y pen recorders. Refer to "4 X-Y Recorder" (p. 85).
FFT	Used to analyze frequencies You can conduct various types of the spectrum and octave analyses. Refer to "13 FFT Function" (p. 273).

#### Values obtained by the recorder function

While the recorder function is being used, the instrument obtains measured values at a previously set sampling rate and lets both the maximum and minimum values be a sampling data value during each of the sampling data periods. Thus, every sampling data value ranges in amplitude.



If the input waveform fluctuates widely due to noise even though usually it fluctuates slightly, the difference between the maximum and minimum values obtained with the instrument at the sampling rate that is relatively faster can be inordinately large.

Set the sampling rate to a slower setting to prevent this phenomenon from being observed.



## 3.3.2 Timebase and Sampling Rate

The timebase setting defines a time length per division of the horizontal axis (time/div). The sampling setting defines an interval at which the instrument samples waveforms.

(While the memory function is being used, the sampling rate appears, enclosed in parentheses, under the timebase box. See the right figure. The displayed sampling rate changes along with the timebase)

Timebase:		
		1ms/div
	(	10µs/S)

[M E M] [R E

Procedure To display the screen Press the DISP key to display the waveform screen.

### For the memory function

- **1** Move the cursor to the [Timebase] box.
- 2 Set the time per division on the horizontal axis (time axis).

5 (Default setting), 10, 20, 50, 100, 200, 500 μs/ div 1, 2, 5, 10, 20, 50, 100, 200, 500 ms/div 1, 2, 5, 10, 30, 50 s/div, 1 min/div, 100 s/div 2, 5 min/div

To control the sampling rate using an external signal, select **[External]** and input the signal to the external sampling terminal. To set back the setting to the internal sampling, select **[Internal]** and set the time.

When the external sampling is used, the settable number of sampling per division can range from 10 S/div to 1000 S/div.

Refer to "17.2.3 External Sampling (EXT.SMPL)" (p. 375).

If using Model U8975, U8977, or U8978, the 5  $\mu$ s/div range will not be available (the default setting will be 10  $\mu$ s/div).

## For the recorder function

- **1** Move the cursor to the [Timebase] box.
- 2 Set the time per division on the horizontal axis (time axis).
- **3** Move the cursor to the [Timebase] box.
- **4** Set the sampling rate.

10 (Default setting), 20, 50, 100, 200, 500 ms/div 1, 2, 5, 10, 30, 50 s/div, 1 min/div, 100 s/div 2, 5, 10, 30 min/div, 1 h/div

1 (Default setting), 10, 100 µs 1, 10, 100 ms (Select a sampling rate from among the options that are 1/100 of the timebase or less)

The selectable range varies depending on the timebase setting. The higher the sampling rate is, the better you can observe minute changes.

## MEM

## How to select the timebase

Refer to the table below to set the timebase.

For example, to measure a waveform with a frequency of 100 kHz, a maximum display frequency of between 200 kHz and 800 kHz should be selected according to the following table. When you want to set the maximum display frequency to 400 kHz, the timebase should be set to 10  $\mu$ s/div.

Timebase	Sampling rate	Maximum display frequency
5 µs/div	50 ns (20 MS/s)	800 kHz
10 µs/div	100 ns (10 MS/s)	400 kHz
20 µs/div	200 ns (5 MS/s)	200 kHz
50 µs/div	500 ns (2 MS/s)	80 kHz
100 µs/div	1 µs (1 MS/s)	40 kHz
200 µs/div	2 µs (500 kS/s)	20 kHz
500 µs/div	5 µs (200 kS/s)	8 kHz
1 ms/div	10 µs (100 kS/s)	4 kHz
2 ms/div	20 µs (50 kS/s)	2 kHz
5 ms/div	50 µs (20 kS/s)	800 Hz
10 ms/div	100 µs (10 kS/s)	400 Hz
20 ms/div	200 µs (5 kS/s)	200 Hz
50 ms/div	500 µs (2 kS/s)	80 Hz
100 ms/div	1 ms (1 kS/s)	40 Hz
200 ms/div	2 ms (500 S/s)	20 Hz
500 ms/div	5 ms (200 S/s)	8 Hz
1 s/div	10 ms (100 S/s)	4 Hz
2 s/div	20 ms (50 S/s)	2 Hz
5 s/div	50 ms (20 S/s)	0.8 Hz
10 s/div	100 ms (10 S/s)	0.4 Hz
30 s/div	300 ms (3.33 S/s)	0.13 Hz
50 s/div	500 ms (2 S/s)	0.08 Hz
1 min/div	600 ms (1.67 S/s)	0.04 Hz
100 s/div	1 s (1 S/s)	0.067 Hz
2 min/div	1.2 s (0.83 S/s)	0.033 Hz
5 min/div	3 s (0.33 S/s)	0.013 Hz

The unit "S/s" stands for the number of samplings per second.



The sampling rate is automatically set to 1/100 of the selected timebase.

When Model MR8990 Digital Voltmeter Unit is installed, the sampling rate of its channels is automatically set to 1/50 of the selected timebase.

Example: When Model 8966 is installed as Unit 1 (CH1 and CH2) and Model MR8990 as Unit 2 (CH3 and CH4), then the timebase is set to 1 s/div Sampling rate of Unit 1 (Model 8966): 10 ms Sampling rate of Unit 2 (Model MR8990): 20 ms

## To automatically set the timebase

Pressing the **AUTO** key selects a suitable timebase for an input signal and starts measurement. (This function can be used in the memory function only.) Refer to "3 Measurement in Automatic Range Setting (Auto-Range Function)" (p. 82).
### REC

- The timebase and sampling rate can be set independently. The sampling rate is selected depending on the timebase setting.
- As mentioned below, when the former timebase settings are selected, the instrument displays waveforms that are demagnified horizontally (in the time axis direction) at the latter scale size. 20 ms/div, ×1/2; 10 ms/div, ×1/5

To perform measurement minimizing the effect of noise

While measuring a waveform that usually fluctuates only slightly, with a fast sampling rate set, a difference between the maximum and minimum values may become large if the amplitude of the waveform changes sharply. To prevent this effect, select a slower sampling rate or enable the module's low-pass filter (p. 73).

### Note common to MEM REC

The data refresh rate is not allowed to exceed the maximum sampling rate of the module. During the period while data is being not updated, the same data is measured, with the result that stairlike waveforms are plotted.

Even when a single signal is sampled simultaneously by two modules, the data may differ with one another due to differences in the sampling rate, frequency bandwidth, and frequency response.

Module	Max. timebase	Max. sampling rate or data refresh rate	Reference information
Model 8966 Model 8973	5 µs/div	50 ns (20 MS/s)	_
Model 8967	Depends on data refresh setting	Depends on data refresh setting	Refer to "8.10.3" (p. 187).
Model 8968	100 µs/div	1 μs (1 MS/s)	-
Model 8969 Model U8969 Model U8979	500 μs/div	5 μs (200 kS/s)	_
Model 8970	Depends on setting	Depends on setting	Refer to "8.10.5" (p. 189).
Model 8971	100 µs/div	1 μs (1 MS/s)	Refer to "8.10.6" (p. 192).
Model 8972	Depends on response setting	Depends on response setting	Refer to "8.10.7" (p. 192).
Model U8975 Model U8977 Model U8978	20 µs/div	200 ns (5 MS/s)	_
Model MR8990	Depends on NPLC setting	Depends on NPLC setting	_
Model U8974	100 µs/div	Depends on response setting	Refer to "8.10.9" (p. 194).

Data refresh rate for various modules

### 3.3.3 Setting the Recording Length (Number of Divisions)

[MEM] [REC

Set the recording length (number of divisions) of each data acquisition.

### Procedure

### To display the screen

Press the **DISP** key to display the waveform screen.

### For the memory function

- 1 Move the cursor to the [Shot] box.
- 2 Select the type.

Fixed Shot	Select the length from among the fixed values.
User Shot	Freely specify a value in one division increments.

3 Set the recording length. (Fixed Shot)

### Model MR8847-51 (Memory capacity: 64 MW)

25, 50, 100, 200, 500, 1,000, 2,000, 5,000, 10,000 div 20,000 div (in 2/4/8/16-ch mode) 50,000 div (in 2/4/8-ch mode) 100,000 div (in 2/4-ch mode) 200,000 div (in 2-ch mode)

### Model MR8847-52 (Memory capacity: 256 MW)

25, 50, 100, 200, 500, 1,000, 2,000, 5,000, 10,000, 20,000, 50,000 div 100,000 div (in 2/4/8/16-ch mode) 200,000 div (in 2/4/8-ch mode) 500,000 div (in 2/4-ch mode) 1,000,000 div (in 2-ch mode)

### Model MR8847-53 (Memory capacity: 512 MW)

25, 50, 100, 200, 500, 1,000, 2,000, 5,000, 10,000, 20,000, 50,000, 100,000 div 200,000 div (in 2/4/8/16-ch mode) 500,000 div (in 2/4/8-ch mode) 1,000,000 div (in 2/4-ch mode) 2,000,000 div (in 2-ch mode)

### (User Shot)

Model MR8847-51	1 div to 20,000 div (in 32-ch mode*) 1 div to 40,000 div (in 16-ch mode) 1 div to 80,000 div (in 8-ch mode) 1 div to 160,000 div (in 4-ch mode) 1 div to 320,000 div (in 2-ch mode)
Model MR8847-52	1 div to 80,000 div (in 32-ch mode*) 1 div to 160,000 div (in 16-ch mode) 1 div to 320,000 div (in 8-ch mode) 1 div to 640,000 div (in 4-ch mode) 1 div to 1,280,000 div (in 2-ch mode)
Model MR8847-53	1 div to 160,000 div (in 32-ch mode*) 1 div to 320,000 div (in 16-ch mode) 1 div to 640,000 div (in 8-ch mode) 1 div to 1,280,000 div (in 4-ch mode) 1 div to 2,560,000 div (in 2-ch mode)

\*: If using Model U8975, U8977, or U8978

### For the recorder function

- **1** Move the cursor to the [Shot] box.
- **2** Select the type.
- **3** Set the recording length.

Fixed Shot	Select the length among the prepared values.
User Shot	Freely specify a value in one division increments.

### (Fixed Shot)

Cont. ON-OFF	When <b>[ON]</b> is selected, the instrument performs measurement while continuously overwriting the data in the memory. You can save and print the data obtained during the period from the measurement was stopped until the recording reached its maximum record length.		
Model MR8	847-51 (Memory capacity: 64 MW)		
25, 50, 100, 200, 500, 1,000, 2,000, 5,000, 10,000 div 20,000 div*			
Model MR8847-52 (Memory capacity: 256 MW)			
25, 50, 100, 200, 500, 1,000, 2,000, 5,000, 10,000, 20,000 div 50,000 div*			
Model MR8847-53 (Memory capacity: 512 MW)			
25, 50, 100, 200, 500, 1,000, 2,000, 5,000, 10,000, 20,000, 50,000 div 100,000 div*			

\*: If not using Model U8975, U8977, or U8978

(User Shot)

Model	1 div to 10,000 div
MR8847-51	1 div to 20,000 div*
Model	1 div to 40,000 div
MR8847-52	1 div to 80,000 div*
Model	1 div to 80,000 div
MR8847-53	1 div to 160,000 div*

\*: If not using Model U8975, U8977, or U8978

## MEM

### Recording length and the number of samples

Every division of the recording length includes 100 samples. The total number of samples in a specified recording length is: Set recording length (divisions) × 100 samples + 1. However, when the Model MR8990 Digital Voltmeter Unit is installed, the number of samples is as follows:

- When only Model MR8990 is installed Number of samples in a division: 50 samples Total number of samples in the recording length: Set recording length (divisions) × 50 samples + 1
- When both Model MR8990 and other modules are installed Channels for Model MR8990

Number of samples in a division: 50 samples Total number of samples in the recording length: Set recording length (divisions) × 50 samples + 1 Channels for other modules

Number of samples in a division: 100 samples Total number of samples in the recording length: Set recording length (divisions) × 100 samples + 2

## REC

Each recording length division includes 100 samples, each of which consists of two values: the maximum and minimum values.

Data obtained with Model MR8990 using the recorder function has a resolution of 16 bits.

### When recording length is set to [Cont.]

- The instrument saves data that is obtained during the period that lasts until the measurement terminates and has the following maximum recording lengths.
   Model MR8847-51: 20,000 div (If using Model U8975, U8977, or U8978: 10,000 div)
   Model MR8847-52: 80,000 div (If using Model U8975, U8977, or U8978: 40,000 div)
   Model MR8847-53: 160,000 div (If using Model U8975, U8977, or U8978: 80,000 div)
- For the range settings of from 10 ms/div to 200 ms/div, the instrument does not perform the realtime print even when the printer setting (real-time print) is set to on. Perform printing manually after measurement terminates (p. 130)
- When the auto-saving is set to on, the instrument does not save any data during the measurement. When the measurement terminates, the data presently written in the internal memory is saved.

### When the recording length is changed during measurement

Measured data already acquired in the memory is discarded, and measurement is started using the newly set recording length.

# 3.3.4 Setting Screen Layout

You can lay out waveform displays of input signals on the waveform screen. This setting also applies to the printing setting.

Selecting X-Y1 mode or X-Y4 mode plots X-Y composite curves. (This function can be used in the memory and X-Y recorder functions.) Refer to "7.4 Plotting X-Y Composite Curves" (p. 148).

### Procedure

To display the screen Press the STATUS key several times to display the [Status] sheet on the status screen.

### For the memory function

### Move the cursor to the [Format] box.

Single	Displays and records waveforms in a graph. (Default setting)	
Dual	Displays and records waveforms in two graphs.	
Quad	Displays and records waveforms in four graphs.	
Oct	Displays and records waveforms in eight graphs.	
Hex	Displays and records waveforms in 16 graphs.	
X-Y Single	Plots and records curves that illustrate correlations between them assigning multiple input signals to the X and Y axes in a graph.	
X-Y Quad	Plots and records curves that illustrate correlations between them assigning multiple input signals to the X and Y axes in four graphs.	

### For the recorder function

### Move the cursor to the [Format] box.

Single	Displays and records waveforms in a graph. (Default setting)
Dual	Displays and records waveforms in 2 graphs.
Quad	Displays and records waveforms in 4 graphs.
Oct	Displays and records waveforms in 8 graphs.
Hex	Displays and records waveforms in 16 graphs.

# MEM REC X-Y

### Analog channel assignment

In Dual, Quad, Oct, and Hex mode, you can freely assign analog channels to the different graphs.

### Procedure

### To display the screen

Press the CHAN key several times to display the [Unit List] sheet on the channel screen.

- 1 Move the cursor to the [Graph] box.
- 2 Select the display screen with respect to each channel.

The graphs are numbered beginning from the top like Gr1, Gr2, Gr3.



### **Configuring Input Channels Settings** 3.4

Configuring analog and logic channels settings.

### To open the channel settings window



Refer to "Setting the variable function while the waveforms obtained through all of the channels are being displayed" (p. 180).

Refer to "7.7.3 Switching the Waveform Display Width" (p. 156).

### To reduce the number of displayed waveforms

Set the waveform display color setting on the Channel setting window to off. Refer to "1. Waveform display color" (p. 73).

### To apply a channel setting to another channel

Refer to "8.9 Copying Settings to Other Channels (Copy Function)" (p. 183).

## 3.4.1 Channel Setting Procedure

The procedure below shows how to configure the analog channels (CH1 through CH16) settings.

### 1 Configuring the settings of input and screen display



### 2 Configuring the trigger settings (as needed)

Refer to (p. 211).

# **3** Configuring the settings of waveform display colors and positions

	Refer to the following pages:
Setting the waveform display color	(p. 73)
Setting the display position and magnification ratio (As needed)	(p. 178)

## 4 Configuring the graph display settings



- Setting the input coupling set to GND disables the range settings because the waveforms seem to have no amplitude.
- Filter attenuation may influence correct range settings.
- When choosing trigger settings, set the vertical axis (voltage axis) range first. When you change the range after specifying the trigger, the trigger setting is changed.
- When using the variable function, set the vertical axis (voltage axis) range first. When you change the range setting after applying the variable function, observation of waveforms with sufficient precision may not be possible.
- When using the variable and scaling functions together, enable the scaling function first. When you enable the scaling function after enabling the variable function, an unintended display may be displayed.

This section describes the setting procedure for logic channels (standard logic terminals: LA through LD, expansion logic terminals: L1A through L8D).

1 Configuring the display settings			
	Configuring the logic recording width settings	Refer to (p. 76).	
2 Configuring the settings of waveform display colors and positions			
		Refer to the following pages:	
	Setting the waveform display positions	(p. 76)	
	Set waveform display colors	(p. 77)	

- The waveform display positions can be specified in one percent point increments.
- · No logic waveforms are displayed in X-Y1 and X-Y4 modes
- Op to three logic modules can be installed. The fourth logic module and later modules installed in the instrument are ignored.

# 3.4.2 Configuring Analog Channels Settings

For information about specific settings for each module, refer to "8.10 Setting Details of Modules" (p. 184).

### Procedure

### To display the screen

Press the **DISP** key to display the waveform screen, and then press the **CH.SET** key to open the channel settings window ([Analog] sheet).

- 1 Move the cursor to a box for which you want to change the settings.
- 2 Select settings by pressing the F key.



### To apply the channel settings to another channel Refer to "8.9 Copying Settings to Other Channels (Copy Function)" (p. 183).

# 1. Waveform display color

Sets the color of the waveform of the selected channel. Each channel can have a different color setting from or the same color setting as other channels.

Dff	Displays no waveform. When <b>[Save Channel]</b> of the auto-saving setting is set to <b>[Display Ch]</b> , the instrument does not save any data of this channel. Refer to "Select the channels to be saved." (p. 99).
On	Displays the waveform. To select the display color, press [1] and [1] in the F keys.
ALL On-Off	You can switch the waveforms display between on and off for entire channels.

2. Vertical axis (voltage axis) range Sets the vertical axis (voltage axis) range with respect to each channel. You can set the vertical axis range in terms of voltages per division. When the variable auto-correction is set to [Off] and the variable function is set to [On], the size of the waveform displayed on the screen is fixed regardless of the vertical axis (voltage axis) ranges.

Full-scale value(Full-scale value) = [Vertical axis (voltage axis) range] × 20 divExample: When the vertical axis (voltage axis) range is set at 1 V/div,<br/>the full-scale value is calculated as 1 V/div × 20 = 20 V.<br/>The measurable range is ±20 V.

### If a waveform amplitude falls outside of the range

Changes the vertical axis (voltage axis) range to a lower sensitivity setting.

3. Input coupling	You can set the input signal coupling method. Typically, select the DC coupling.	
	DC (V, –)	Measures the input signals including both DC components and AC components. (Default setting)
	AC $(\widetilde{\vee}, \sim)$	Measures the input signal, including AC components only. DC components are rejected.
	GND (,,,)	Measures the input signals short-circuiting the input signal to the ground (This enables you to check the zero position of the signal).
4. Vertical axis (voltage axis) magnification ratio	You can set the axis) direction Magnifying wa waveforms doe Refer to "7.5.3 M Direction)" (p. 15	e magnification ratio of waveforms in the vertical axis (voltage for displaying and printing waveforms respect to each channel. veforms are performed based on the zero position. Magnifying es not influence the measurement resolution. Magnifying/demagnifying the Waveforms Vertically (in the Voltage Axis 53).
	To display waveforms magnified in user-defined magnification ratios, enables the variable function.	
	When signs of displayed waveforms are reversed, you can flip the waveforms vertically. Refer to "8.6 Setting the Waveform Position (Variable Function)" (p. 178) and "8.8	
	Inverting the Wa	veform (Invert Function)" (p. 182).
5. Vernier	You can finely adjust input voltage amplitudes freely on the waveform screen (This fine adjustment changes waveforms shape only seemingly). Finely adjusting waveform amplitudes enables you to calibrate the instrument for physical values recorded with sensors such as noise, temperature, and acceleration sensors.	
	Refer to "8.7 Fin	e-Adjusting Input Values (Vernier Function)" (p. 181).
6. Zero position	You can set the zero-volt level display position. If the zero-volt input level is displaced, perform the zero-adjust	
	Refer to "2.7 Adj Performing Calib	usting the Zero Position (zero-adjustment)" (p. 54) and "2.8 pration (When Model MR8990 is Installed)" (p. 55).
	To move the ze	ero positions of entire channels at a time, press [Preset].
	Ascending (3%→96%)	Moves the zero position of CH1 to the 10% level of the vertical axis and those of the following channels, through CH16, to each position that increases in 5 percentage points increments.
	Descending (96%→3%)	Moves the zero position of CH1 to the 90% level of the vertical axis and those of the following channels, through CH16, to each position that decreases in 5 percentage points increments.
	All Ch 0%	Moves the zero position of entire channels to the 0% level of the vertical axis.
	All Ch 50%	Moves the zero position of entire channels to the 50% level of the vertical axis.
	If the zero posi Strain Unit is d Refer to "8.10.4	tion of the waveform obtained with Model 8969 or U8969 isplaced, perform the auto-balance. Setting Model 8969 and U8969 Strain Unit" (p. 188).

- The zero position setting merely change waveform positions, not applying any offsets to inputs signals.
- The vertical axis (voltage axis) magnification/demagnification of waveforms is performed based on the zero position.
- The zero position adjustment and the vertical axis (voltage axis) magnification/demagnification merely change displayable voltage ranges on the waveform screen. No actual measurement ranges are not changed.

The zero positions are moved as shown in the illustration below. (Example:<br/>Model 8966 Analog Unit)Zoom factor ×1Displayed areaDisplayed areaDisplayed areaA/D data(Zero position: 0%)(Zero position: 50%)(Zero position: 100%)



### Resolution of each module in screen display range (LSB)

Madula				Magn	ification	ratio				
wodule	×1/10	×1/5	×1/2	×1	×2	×5	×10	×20	×50	×100
Model 8966 (Analog) Model 8971 (Current) Model 8972 (DC/RMS)	20000 (4000)	10000 (4000)	4000	2000	1000	400	200	100	40	20
Model 8967 (Temperature)*	200000	100000	40000	20000	10000	4000	2000	1000	400	200
Model 8968 (High resolution) Model U8974 (High voltage) Model U8975 Model U8978 (4CH analog) Model U8977 (3CH current)	320000 (64000)	160000 (64000)	64000	32000	16000	6400	3200	1600	640	320
Model 8969 Model U8969 (Strain) Model U8979 (Charge)	250000 (64000)	125000 (64000)	50000	25000	12500	5000	2500	1250	500	250
Model 8970 (Power frequency)	20000	10000	4000	2000	1000	400	200	100	40	20
Model 8970 (Count)	400000	200000	80000	40000	20000	8000	4000	2000	800	400
Model 8970 (Excluding power frequency and count)	100000	50000	20000	10000	5000	2000	1000	500	200	100
Model MR8990 (DVM)	10000000 (1200000)	5000000 (1200000)	2000000 (1200000)	1000000	500000	200000	100000	50000	20000	10000

The magnification ratios enclosed in the brackets represent ranges of valid data.

\*: For Model 8967 Temp Unit, the valid range varies depending on thermocouples. For information about the minimum resolution, see the specifications of Model 8967 Temp Unit.

7. Low-passYou can set the low-pass filter installed in the module. Enabling this<br/>function can eliminate unwanted high-frequency components.

Settable filter types varies depending on modules. Select a suitable setting according to an input signal characteristics.

## 3.4.3 Configuring Logic Channel Settings

The [Logic] sheet appears in Single, Dual, Quad, Oct, and Hex mode.

### Procedure

### To display the screen

Press the **DISP** key to display the waveform screen, and then press the **CH.SET** key to open the channel settings window (**[Logic]** sheet).

- **1** Move the cursor to a box for which you want to change the settings.
- 2 Select settings by pressing the F key.



### To apply the channel settings to another channel

Refer to "8.9 Copying Settings to Other Channels (Copy Function)" (p. 183).

### 1. Logic width

You can change the display width of the logic waveform. Making waveforms narrower can enhance the readability of the display containing a large number of waveforms.

Wide	Displays waveforms at expanded width.
Normal	Displays waveform at the normal width.
Narrow	Displays waveform at reduced width. (Default setting)

# 2. Waveform display position

You can set the logic waveforms positions.

You can freely move the positions of the logic waveforms within the range of the display.

# 3. Waveform display color

You can set the waveforms color of the selected channel. You can set the same color as those for other channels.

For logic modules, either each module or each channel can have a different color setting.

OFF	Displays no waveform. When <b>[Save Channel]</b> of the auto- saving setting is set to <b>[Display Ch]</b> , the instrument does not save any data of this channel. Refer to "Select the channels to be saved." (p. 99).
ON	Displays the waveform. Press the <b>F</b> key to set the display colors.
Probe ON-OFF	Switches the waveform display between on and off at a time for those obtained with a single probe.
ALL ON-OFF	Switches the entire logic waveform display between on and off at a time. This setting is selectable when the cursor is placed on any item of the waveform display position box.

Setting the standard logic (LA, LB, LC, and LD) display setting to **[ON]** disables Model 8970 Freq Units installed in Unit 1 and Unit 2 positions. Furthermore, it deteriorates the resolutions of Models 8967 Temp Unit, 8968 High Resolution Unit, 8969 Strain Unit, U8969 Strain Unit, U8974 High Voltage Unit, and U8979 Charge Unit from 16 bits to 12 bits. Installing Models MR 8990 Digital Voltmeter Unit, U8793 Arbitrary Waveform Generator Unit, MR8790 Waveform Generator Unit, or MR8791 Pulse Generator Unit installed in Unit 1 and Unit 2 positions disables the standard logic terminals.

# 3.4.4 Display Sheet

The input channel settings can be set with respect to each display sheet. Up to four sheets are available. You can assign waveforms to be displayed to each display sheets and switch a display sheet to another.

. . . . . . . . . . . . . . . . . . .

MEM REC

нюкі	Jnit	: Li	s		E	ach	ı Ch		$\overline{}$	Sca	d in	ß	$\overline{}$	Co	mme	nt		🔊 Сн	AN (Pus	D		13-Oct 14:11:2
Sh	eet		1							Fo	rma	t	5	Sing	;le						H.SET	Function: MEMORY
	Ch			Mode					Zoor	ı –			LPF			Vari	ab	le	Graph	Up	tion	
Unit		Wav	е			Rai	nge			Pos	siti	ion			Ċ		Ī	Jnit				
ANAL OC	1		1	Volta	age	10	10mV	điv	×∲1!	9	I	65%	Of	f	۷	Oft	F	V				
ANALUU	2		1	Volta	age		5mV	div	X	5		55%	Of	f	۷	Oft	F	V				
TEMP	3		L	Temp	-K	1	.0°C	div	×	1		0%				Of1	ŧ.	°C				Standard
10.00	4		I	Temp	-K	1	.0°C	div	×	1		0%				Off	F	°C				
STRAIN	5		I			2	3µ0	div	×	1		50%	Of	f		Off	F	με				
onan	6		I			2	3µ0	div	×	1		50%	Of	f		Of1	F	зц		_		Option
HIGH RES	7		1	Volta	age		5mV	div	×	1		50%	Of	f	V	Of1	F	<u>V</u>		_		
	8		1	Volta	age		5mV	div	X	1		50%	Uf	f	V	Uf1	-	V		_		
FREQ	9		ļ.	Fre	q		1Hz	div	X	1		0%	Uf	f	-	Ufi		Hz				
	10		ļ.	Fre	q		1Hz	điv	X	1		0%	Ut	t	-	011	-	Hz		_		
CURRENT	11		ļ.	20A/	27	10	10mA	div	X	1	_	50%	Uf	f	A	Uf1		A				
	12		I	20A/	27	16	10m/4	div	×	1		50%	Ut	†	A	Uti		A		_		
LOGIC				A					В					Ľ				D		4		
	L/	-	-	-	-	-	-	-		-	-	-	-	-	-	-				4		
DC/RMS	15		÷	DC			5mV	div	×	1		50%			V	011				_		
	10			- DC			Smv	div	×	1		50%	UF	F	۷	UTI	-	V	_			<u></u>
– [Built-	in	_0g	ic,	1					1						+	<u>+                                    </u>	Zer	o-Adju	st】—			<b>.</b>
Logic W	idt	1	A	-	-	-	-	-								Ze	ro-	Adjust				
Narro	W	+	В	-	-	-	-	-	-													
		-	U D	-	-	-	-	-	-													
			υ	-	-	-	-	-							_							
Hint	Disp top	ria ria	//s sht	etti of	ng thi ner	scr s i al	een nst	o rur tir	∶li: nent ngs.	sto to and	f cl move the	hanr e to e TR	nel s o oth	sett ner SFT	tin: se ke	gs.U ttin ∠ to	se g s mn	the ME creens	NU key ,CH.SE	on th Tkey	e	

•	You can set the follow	ing display-related settings only with respect to each display sheet.				
	Analog waveform:	Display on/off, waveform color, magnification ratio, zero position, graph, variable (on/off, upper and lower limits)				
	Logic waveform:	Display on/off, waveform color, display position, logic width				
	X-Y waveform:	Display on/off, display color, X ch, Y ch, waveform calculation (X ch, Y ch)				
	Common setting:	Display format				
•	The measurement-rela	ated settings other than above are common to all displayed sheets.				
	When a range is changed, the ranges of entire display sheets are changed.					
•	<ul> <li>Saving settings files operation saves the settings of all displayed sheets.</li> </ul>					
•	Saving waveform files of saving. When you t	operation saves the waveforms in the setting of the sheet displayed at the time ry to load a waveform file, only the sheet displayed at the time of saving can be				

You can configure the waveform calculation settings using the channel setting window. See "3.4 Configuring Input Channels Settings" (page 70)

loaded because other sheets were not saved.

### Switching sheets (1 through 4)

# 3.5 Starting and Stopping Measurement

### Procedure

### To display the screen

Press the **DISP** key to display the waveform screen.

### To start measurement

Press the **START** key to start measurement.

- When measurement is started, waveform data displayed on the screen is cleared.
- Applying a signal to the external control terminal can start measurement. Refer to "17 Controlling the Instrument Externally" (p. 369).

### To prevent starting measurement unintentionally

To prevent starting measurement by operation mistakes, you can set the **START** key acceptance condition.

Refer to "Start Action" (p. 338).

### To automatically save data during measurement

Refer to "5.2.2 Automatically Saving Waveforms" (p. 96).

### To print waveforms

Refer to "6 Printing Data" (p. 125).

### To stop the measurement in progress

Press the **STOP** key once to stop the measurement in progress after the specified recording length expires.

Press the **STOP** key once again to stop the measurement in progress immediately.

You can change key acceptance conditions for the **START** and **STOP** keys. Refer to "15 Setting the System Environment" (p. 335).

Pressing the **STOP** key may display the following GUI on screen.



Stops the measurement in progress immediately. (the same behavior as that when pressing the **STOP** key twice)

Cancels the stopping action and continue the measurement in progress.

When no keys are operated during this status, the measurement is terminated after the specified recording length expires, and the display returns to the previous screen.

### Measurement and internal operations

Two options of the measurement methods available: the normal measurement (starts measuring and recording waveforms at once) and trigger measurement (starts recording waveforms when trigger conditions are satisfied). In this manual, "Start of measurement" indicates the time when you press the **START** key, and "start of acquisition" indicates a start time of waveform acquisition on the waveform screen.





# Triggering the instrument repeatedly and recording phenomena before

The data before a trigger event (for the pre-trigger period) is acquired.

When the trigger mode is set to [Repeat] or [Auto] (the memory function only), the number of trigger events is displayed at the top of the screen. (storage counter)

Refer to "Explanation of screen contents" (p. 22).

Trigger mode:

With the pre-trigger

[Repeat]

enabled

# 3.6 Measurement in Automatic Range Setting <sup>MEM</sup> (Auto-Range Function)

This function is enabled only for measurement with the analog modules with the memory function enabled.

When you press the **AUTO** key after inputting signals to an analog module and select **[Auto Range]**, the horizontal axis range (timebase), vertical axis (voltage axis) range, and zero position are selected automatically, and then measurement is started.

The timebase is set to the lowest numbered channel of the channels with those waveform display setting set to on. In addition, it is set automatically so that waveforms with a length of from one cycle to 2.5 cycles in 25 divisions are recorded.

Setting the auto-range function set to on changes the following items.

Module-related conditions (For all channels)						
Vertical axis (voltage axis) range	Automotioally activalue					
Zero position	Automatically-set value					
Vertical axis (voltage axis) magnification ratio	×1					
Low-pass filter	Off					
Input coupling	DC					

frigger conditions (For a single channel only)							
Trigger mode	Auto						
Logical operation between trigger sources	OR						
Pre-trigger	20%						
Internal trigger	Set to on is only the lowest numbered channel of channels with those waveform display setting. (If the difference between maximum and minimum value is eight divisions or less, the second lowest numbered channel is turned on.)						
Trigger type	Level trigger: Slope, Rising Trigger level: Automatically-set value Filter: Off						

Condition of [Status] sheet on the status screen					
Timebase	Automatically-set value (time axis magnification ratio: ×1)				

- When measurement is started in the auto-range setting, <u>the trigger output signal is output from the</u> <u>external control terminal block's TRIG OUT terminal</u>. Keep this in mind when performing auto-range measurement while using the trigger output terminal.
- The auto-range function automatically selects settings for an input signal when the function is enabled. After supplying an input signal (waveform), start auto-range measurement.
- If the input signal of the lowest numbered channel with the waveform display setting set to on have extremely low amplitude, the timebase is set according to the input signal of the next lowest numbered channel.
- If the range cannot be set for any channels with waveform display setting set to on, a warning message is displayed, with the result that the measurement in progress is interrupted.
- The auto-range measurement disables the auto-saving and auto-printing functions.
- For a low-frequency signal of less than 10 Hz, the optimal ranges cannot be selected automatically. Set the ranges manually.
- Using the following modules disables the auto-range function: Models 8967 Temp Unit, 8969 Strain Unit, U8969 Strain Unit, 8970 Freq Unit, MR8990 Digital Voltmeter Unit

Measurement in Automatic Range Setting (Auto-Range Function)

X-Y Recorder



- You can plot X-Y composite curves each of which presents the relationship between an input signal and another in real time.
- Since the instrument writes the data of plotted curves in the memory, it can save the data as files as well as print the curves.
- You can set the waveforms plotting setting to on and off in the same manner as the pen raising and lowering setting installed in typical X-Y pen recorders.
- You can observe up to eight X-Y composite curves simultaneously.
- Since the instrument writes X-Y composite curves in the memory, it can redraw the X-Y composite curves in other display settings after measurement.

### HIOKI 1234567890123456789012345678901234 🛛 💾 🔤 😂 1-Apr 12:48 HIOKI 1234567 X-Y REC 1455611 No.1 Sampling: The bar indicates 1ms/S 8. the amount of OVER occupied memory. Pen∶ DOWN [OVER] appears Player: when the memory Stop is filled with the Speed: waveforms to Normal capacity. redraw M ▶/■

### Example of X-Y recorder waveform screen (in X-Y4 mode)

# 4.1 Measurement procedure

### 1 Inspecting the instrument before measurement

Refer to "3.2 Inspecting the Instrument Before Measurement" (p.59).

### 2 Configuring the basic measurement settings



### 3 Configuring the input channel settings

Configuring the analog channel settings

Refer to "3.4.2 Configuring Analog Channels Settings" (p.73).

Logic channels cannot be used.

### Advanced settings

Refer to the following pages:

- "8.6 Setting the Waveform Position (Variable Function)" (p. 178)
- "8.7 Fine-Adjusting Input Values (Vernier Function)" (p. 181)
- "8.1 Adding Comments" (p. 160)
- "8.5 Converting Input Values (Scaling Function)" (p. 171)

### 4 Starting measurement

(p. 140)

Refer to the following pages: "4.3 Starting and Stopping Measurement" (p.88) "7.1 Reading Measured Values (Using Cursors A and B)"

The X-Y recorder function does not support the following operations:

- Trigger setting
- Auto-saving
- Auto-printing

# 5 Completing the measurement

Refer to the following pages:

"4.3 Starting and Stopping Measurement" (p.88)

"4 Redraw X-Y composite curves" (p.88)

- "5.2.3 Saving Data Selectively (SAVE Key)" (p.103)
- "6.3 Manually Printing Data by Pressing the PRINT Key (Selection Print)" (p. 130)

# 4.2 Setting Measurement Conditions

To set the measurement conditions, press the **STATUS** key to display the status screen, and then select the **[Status]** sheet. (The measurement functions and sampling rates can also be set on the waveform screen.)

### Setting items

HIOKI Status		16-May 14:20:06
+ 【Recording setting】——		Function: X-Y REC
Sampling: Shot	100ms/S Cont	
-Format Format Dots-Line Disp Clear	X-Y Single Line On	

Measurement function

Set the measurement function to [X-Y REC].

Sampling

Set the sampling rate.

1 ms, 10 ms, 100 ms (Default setting)

The setting [1 ms] can be set only when the [Dots-Line] is set to [Dots].

Format	Select the graph format for the waveform screen display or printout of the input signal. Up to eight phenomena can be observed simultaneously.								
	X-Y Single	The waveforms of Graphs 1 through 8 are shown and recorded on a single screen. (Default setting)							
	X-Y Quad	The waveforms of Graphs 1 through 8 are shown and recorded on four screens.							
Dots-Line (interpolation)	Select whether to display and print the input waveform (sampling data) as dots (sampling points) or perform the linear interpolation. Dot display allows faster sampling.								
	Dots	Displays and prints sampling data as dots.							
	Line	Displays and prints linearly interpolated sampling data. (Default setting)							
Disp Clear	When previously plotted X-Y composite curves remain at the start of measurement, you can choose between leaving them and clearing them you choose to leave them, the new waveforms are displayed as an overl								
	Off	Overlays new waveforms with the existing waveforms.							
	On	Clears the previously plotted waveforms. (Default setting)							

Setting measurement conditions terminates.

Next, configure the analog channel settings.

For details, refer to "3.4.2 Configuring Analog Channels Settings" (p.73).

### To choose channels used to plot X-Y composite curves

Refer to "7.4 Plotting X-Y Composite Curves" (p. 148).

### **Starting and Stopping Measurement** 4.3

Press the **DISP** key to go to the waveform screen.

### 1 Start measurement.

Press the START key to start measurement.

### 2 Setting the X-Y composite curves plotting set to on and off (setting the pen setting to up and down)

You can choose this setting both before and during measurement. Setting the pen setting to Down enables the X-Y composite curve plotting function. Setting the pen setting to Up disables the X-Y composite curve plotting function. This setting applies to all channels. Move the cursor to the [Pen] box to change the setting.

Up Disable the X-Y composite curve plotting function.		Pressing the <b>TRIG.SET</b> key or the <b>Manual</b> <b>Trigger</b> key can switch the <b>[Pen]</b> setting
Down	Enable X-Y composite curves to be plotted.	between up and down as well.

Setting the pens in the Down position The pens are shown in colors and curves are plotted.

Setting the pens in the Up position The pens are shown in white, and no X-Y composite curves are plotted.

### 3 Stop the measurement in progress

Press the **STOP** key to stop the measurement in progress.

#### 4 **Redraw X-Y composite curves**

The instrument plots the X-Y composite curves that start from any specified sampling point and consists of 4,000,000 (if using the U8975, U8977, or U8978: 2,000,000) samples of the data recorded before the measurement terminated, playing back the X-Y composite curve plotting in the same manner as video recorders.

This setting applies to all channels. You can specify the playback speed. (You can change it also during playback.) X-Y composite curves are only played back on the screen, not affecting the printout data. To print the same X-Y composite curves as shown on the screen, use the screenshot function (p. 136).

Move the cursor to the [Player] box.

Clear	Clears only the displayed X-Y composite curves. (The instrument does not discard the waveform data written in the memory.)
Redraw	Redraws the X-Y composite curves. The X-Y composite curve display conditions can also be changed for plotting the curves again.
First	Moves the pens to the start points of the X-Y composite curves.
Last	Moves the pens to the end points of the X-Y composite curves.
Play/Stop	Starts and stops the X-Y composite curve playback.

Move the cursor to the **[Speed]** box. In the **[Normal]** setting, plays back the X-Y composite curves at the same speed as at which they recorded.

Very Fast / Fast / Normal (Default setting) / Slow / Very Slow

Inputting signals to the external control terminal can start and stop measurement and switch the **[Pen]** setting between up and down as well. (p. 371)

# To redraw the X-Y composite curves in different X-Y composite curve display settings

 Even after the X-Y composite curve display is cleared, the waveform data is still retained in the memory. This makes it possible to redraw the X-Y composite curves in different settings, which include the display format, display color, channels used for plotting the curves, channel magnification ratio, and channel offset, from those previously set. (Select [Redraw]) Executing [Redraw] update the screen and printout data.

(Until **[Redraw]** is not executed, the screen and print data are not updated, even if the settings are changed.)

The X-Y composite curves can also be redrawn by operating the jog dial and shuttle ring.
 Jog dial Plots the X-Y composite curves and plays back the plotting of the curves inversely in one sample increments.

- To play back the plotting of the X-Y composite curves inversely, plot curves in the direction of earlier data. Erasing the X-Y composite curves is not possible.
- If the measured data exceeds 4,000,000 (if using the U8975, U8977, or U8978: 2,000,000) samples, it is only possible to redraw up to 4,000,000 (if using the U8975, U8977, or U8978: 2,000,000) samples in the past, counting backward from the point when measurement terminated. The instrument discards waveform data obtained earlier.
- Redrawing the X-Y composite curves with the jog dial and shuttle ring affects the X-Y composite curves displayed on the screen only and does not affect the printout data. To print the same X-Y composite curves as shown on the screen, use the screenshot function (p. 136).

**Shuttle ring** Plots the X-Y composite curves and plays back the plotting of the curves inversely at speed proportional to the rotation angle.

# 4.4 Observing X-Y Composite Curves

Up to 4,000,000 samples of waveform data are written in the memory, and you can observe those measured values using Cursors A and B. (p. 140)

The bar at the top of the screen indicates the amount of the occupied memory.

When the number of samples reaches 4 million, the sign **[OVER]** appears next to the screen bar at the top.

s

Saving X-YPressing the SAVE key or executing the saving command using the file screen savescompositethe waveform data written in the memory as a file.curvesRefer to "5.2.3 Saving Data Selectively (SAVE Key)" (p.103).

OVER

The data saved in this way as a file can be loaded into the instrument; however, cannot be loaded into computers.

Printing X-Y	Pressing the <b>PRINT</b> key prints out the X-Y composite curves.	
composite	Refer to "6.3 Manually Printing Data by Pressing the PRINT Key (Selection Print)"	
curves	(p. 130).	

# 5 Saving/Loading Data and Managing Files

This chapter explains how to save and load data and manage files.

Before saving data, configure the save settings on the **[File Save]** sheet of the system screen. The **File screen** allows you to load data and manage files.

### To display the [File Save] sheet



### Operations available on the [File Save] sheet

The following settings are available on the [File Save] sheet. Refer to (p. 95).

### Auto-saving settings

Setting the method of the auto-saving of waveform data.

### SAVE key settings

Setting the method of saving the data when pressing the SAVE key.

## To display the file screen

					26-Mar 15:16	
FILE Indicated the order -	USB1:¥Name △	Туре	Date Time	Size		
in which the files are		Folder	08-05-13 16:11:	12 46 460VP		
hn sorted.		.CSV	08-04-03 18:01:	40 40 KB 38 693 B		
( ) $\triangle$ : Ascending order	idx 0000AL 10 M 0000AL 10	. IDX .MEM	08-05-07 17:20: 08-05-07 17:19:	02 776 B 44 16MB	Class on Markin	
C → C: Descending order	M 0001AL D	. MEM	08-05-07 17:20:	00 6.9MB		
Press [FILE] key.	MREADON .Y	. MEM	08-03-13 10:06:	58 32KB	Info	
The selected file is indicated	R NONAME SISTARTU	.REC .SET	08-02-27 14:50: 08-03-13 10:06:	14 71KB 58 32KB		
by the flashing cursor.		. TXT	08-05-13 15:39:	30 0 B		
Press Left/Right CURSOR	interface	.txt	08-05-13 15:41:	18 0 B		
key to move between folder	romram_check	.txt	08-05-13 15:41: 08-05-13 15:41:	10 0B	Save	
levels.	Media Information					
Press the up/down cursur		00 [0 .]			Open Folder	
Read-only files and folders are	1.Size 113MB	SB LLurrentJ 4.Count	4			
shown in blue.	2.Free 73MB	5.Dir Count	1		New Folder	
These files and folders cannot	0.05C 0.0D	0.00011	Ū			
be renamed or deleted.					Del Folder	
Character device information	iuide Press the [media change] k	eration commands, ey to change file	press the HELP key operations to ano	/. ther media.	1/2 Next Page	
Storage device information —			ANA2auto MEM size:	77KB		
Count: Displays the numb	er of files in the selected fol	der	Create: 08-03-	26 16:37:12		
Dir Count: Displays the numb	er of folders in the selected	folder.	Write date: 08-03- Last access: 08-03- Size: 78950	26 16:37:12 26 hytes		
Count: Displays the numb	er of files and folders you c	an create	Loadable: OK	.,		
at the selected fold	ler level.		Time: 1ms s Trig time: 08-03-	hot: 100DIV (10001 data) 26 16:37:12.625		
			8847: CS0.20 Title:	g data: 88470001		
When the storage device is	not displayed, and you o	cannot	Ch 1: Analog Ch 2:	0		
perform any operations ch	oose a setting option oth	er than	Logic LOA1:	ve informati	an of the	
[Mass storage HDD] or [M	ass storage CEI in the I		Displa	ys informati	on of the	
Eatl box	ass storage of J in the L	030	Selecti	eu me.		
Set] DOX.						
To change storage dev	vices					► F T
ge en ge en ge me					CF Card	
<b>1</b> Verify that a storage	e device is inserted.					12
Refer to "2.3 Preparing	Storage Devices" (n 47)					>
					USB Stick	¢.
<b>2</b> Select [Change Med	ia] and select a storage	e device typ	e.			F3
The files saved on the selected storage device appears on the file list.			ΜT1			
			E4			
			2			
					Blt-in Dr	ive
	Operations available	from the fi	e screen			
_		Manaq	ing files (p. 9	95)		
Formatting storage devi	ces (p. 49)			· \		
		Savin	g data (p. 115	)		
		Creat	ng a new tolo	aer (p. 118) 22)		
Loading data (p. 110)		• Sortin	ng a me (p. 1. a files (n. 120	<i>حد)</i> ۱)		
		Deleti	ng a file (n. 1	/) 19)		
Saving and loading auto	-settings files (n. 112)	Renai	ming a file (p. 1	121)		
Saving and loading auto	-settings mes (p. 113)	Printir	na a file table	(p. 123)		

• Printing a file table (p. 123)

### Data That Can Be Saved and Loaded 5.1

✓: Yes, –: No Save File Computer-File type Icon File extension and description Load format readable Auto. Manual Settings data (measurement පී SET Settings data<sup>\*1</sup> ~ Binary ~ conditions) Memory function waveform \_\*4 MÎ MEM 1 √ √ data Waveform data<sup>\*2</sup> The entire length Recorder function waveform RÎ \_\*4 / ~ REC ~ of the waveforms data or the portion of Binary X-Y recorder function X-Y waveforms within ΧŶ XYC √ √ \_ curve data the range between Cursors A and B F FFT ✓ ~ ~ FFT function data (acquired in the \_ instrument) Ē CSV ./ ./ Text Text data 1 \_ Waveform idx IDX Index data for division save 1 ~  $\checkmark$ management (Index Index data for memory data<sup>\*3</sup> file) SEU SEQ 1 (memory division / division (automatically ~  $\checkmark$ created during batch saving) division save) Captured screen images (Display/ BMP<sup>\*5</sup> BMP Image data ~ \_ \_ ~ Waveform screens) Numerical CSV ~ Text Text data ~ \_  $\checkmark$ calculation results Comments for ✓\*6 Text TXT Text data 1 printing Waveform Settings data ΑĨ ARE √ √ evaluation (Measurement conditions + Binary \_ waveform evaluation areas) settings data Waveform Waveform evaluation area **B** BMP **BMP** ~ ✓ \_ ⁄ image data evaluation area Arbitrary User-defined waveform data WFG WFG Binary ~ ✓ (For U8793) waveform data User-defined User-defined waveform data TFG TFG √ Text \_ 1 \_ (For U8793) waveform data Pulse pattern Pulse pattern data PLS PLS √ Binary ~ \_ (For MR8791) data Generation Generation program data FGP FGP Program ~ √ (For U8793) program data

\*1: Multiple files can be registered in the instrument and loaded selectively. Automatic loading at power-on is also possible. (p. 113)

\*2: To load the data onto the instrument Save the data in binary format. The waveform data and a part of the measurement settings data are saved. To load the data onto computers Save the data in text format. (p. 95) To save a portion of the waveform Specify the range to be saved with Cursor A and B. (p. 140), (p. 145)

- \*3: To load the data, which is saved with the memory division enabled, of entire blocks at once Save measured data in the [All blocks] setting. A directory including waveform data for each block and index data (SEQ) is automatically created. Load this index data. To load waveform data that is saved using division save Load the IDX index data.
- \*4: Load files with Wave Viewer (Wv).
- \*5: This is a standard Windows<sup>®</sup> graphics format. Many graphics programs can open files in this format.
- \*6: You can print out text files created with a computer along with loaded waveforms. Other processing operations are not available.

Files that exceed 2 GB cannot be saved.

### Data that cannot be loaded onto the instrument

- Data saved by other instruments
- Image files other than waveform evaluation areas (
   inf)
- Files displayed with the icon ?.



95

# 5.2.2 Automatically Saving Waveforms

The instrument automatically saves the waveform data as files every time it writes the recording length of the waveform data in the memory. Set the save destination and items to be saved before starting measurement.

### Procedure

### To display the screen

Press the SYSTEM key to open the system screen, and then select the [File Save] sheet.

### **1** Enable auto-saving.

Move the cursor to the [Auto Save] box, and select [On].

Default setting: Off (no automatic saving)

### **2** Set the save type.

Move the cursor to the [Save Type] box.

Wave Binary	Saves waveform data in binary format. (Only the data saved in binary format can be loaded onto the instrument.)
Wave Text	Saves waveform data in text format. The instrument decimates the data and saves it as a file. (You can open the files with editors and spreadsheet software installed in computers; however, cannot load onto the instrument.)

- 【Auto Save】——	
<b>1</b> Auto Save	On
<b>2</b> Save Type	Wave Binary
<b>3</b> Save to	
<b>4</b> Sa∨e Name	
<b>5</b> Save Area	Whole Wave
Division	Off

...

### **3** Set the save destination.

Move the cursor to the **[Save To]** box and select **[Edit]**.

The folder dialog box is displayed (at the bottom right).

Move the cursor to a device to be set as the save destination\*, and select [Confirm] to confirm the selection.

Automatically saves the waveform data on the built-in drive. (When Model U8331 SSD Unit is installed.)
Automatically saves the waveform data on a CF card.
Automatically saves the waveform data on a USB flash drive.
Automatically saves the waveform data on a computer connected via LAN. Model 9333 LAN Communicator is required.

When the root directory (the topmost folder on the storage device) is selected, the "HIOKI8847" folder is automatically created. (When the storage device has been formatted with the instrument, the instrument has already created the folder.) Files are saved in this folder.

To create a new folder to be set as the save destination,

select **[New Folder]**. When the save destination is set to **[LAN]**, the **[New Folder]** command is ignored, and a folder named with the current date is created.

### **4** Set the file name.

Move the cursor to the **[Save Name]** box and enter a file name.

Refer to "Save operations (When the save destination is set to [LAN])" (p. 102).

When the save destination is set to [LAN], the file is named in the previously-determined format and the name entered in the [Save Name] box is ignored. Refer to "Save operations (When the save destination is set to [LAN])" (p.102).

### File name

The maximum number of characters for **[Save Name]** is 123. The maximum path length including file name is 255 in characters.

HDD:¥		
S HDD:¥		
💊 USB1:	¥	
🧇 CF : ¥	To select a	Up/down
👒 LAN:¥	storage device	CURSOR
	To open the	Right
	lower level loider	CURSUR

### • To save the waveform data on a computer connected via LAN The 9333 LAN Communicator must be installed on the computer on which the data is to be saved. For more information about how to operate and configure the Model 9333 LAN Communicator, as well as install it on computers, refer to the instruction manual of Model 9333 LAN Communicator.

 When the save destination is set to [LAN]

The IP addresses of the instrument and the computer connected via LAN must be set. For more information about how to set the IP addresses, refer to (p. 342).

# **5** Specify the action when a file with the same name exists in the target folder.

Move the cursor to the [Same Name] box.

Auto	When no files with the same name exist, the instrument gives the predetermined name to a file and saves it. When another file with the same name exists, the instrument gives the name beginning with a 4-digit number to a file and saves it (default setting). When the name of the existing file begins with a numeral, the instrument gives the name beginning with the sequence number that follows the existing file name's number to a file.
Serial	Unconditionally, the instrument gives the name beginning with a 4-digit number to a file and saves it. When another file with the same name exists, the instrument gives the name beginning with a 4-digit number increasing the number in one increments to a file and saves it.

Save Channel	Disp Ch
Same Name	Auto
Folder to save	No
Save method	Normal Save

### **6** Set the save area.

Move the cursor to the [Save Area] box.

Whole	Saves the entire data written in the memory.
Wave	(Default setting)
A-B Wave	Saves the data within the range between Cursors A and B. When only Cursor A is set, the instrument saves entire data within the range after Cursor A point. To set Cursors A and B, refer to (p. 140).

### 7 (When [SaveType] is set to [Wave Binary]) Select whether to divide files.

Move the cursor to the [Division] box.

Off	Saves a file without dividing it.
16M, 32M, 64M	Divides a file into sections that have a selected size and saves them.

## (When [SaveType] is set to [Wave Text])

### Set the data decimation factor.

Move the cursor to the [Save Thin] box.

OFF	No data is decimated.	
1/2 to 1/1000	Sets the decimation factor (ratio of retained samples to whole samples).	

_ 【Auto Save】	
Auto Save	On
Save Type	Wave Binary
Save to	
Sa∨e Name	
Save Area	Whole Wave
Division	Off

–【Auto Save】———	
Auto Save	On
Save Type	Wave Binary
Save to	
Sa∨e Name	
Save Area	Whole Wave
Division	Off

_【Auto Save】—	
Auto Save	On
Save Type	Wave Text
Save to	CF:\HIOKI_MR88
Sa∨e Name	
Save Area	A-B Wave
Save Thin	1/2

Saving/Loading Data and Managing Files

### Division save

- You can divide the large size of waveform data and save them as multiple files.
- When saving data with **[Division]** is set to any setting options other than **[Off]**, a folder is automatically created, and then waveform files and an index file (extension: IDX) are created in the folder. Loading the IDX file allows the waveform files to be loaded in a batch.
- Activating the division save disables the delete save. Refer to (p. 100).
- Automatic division save is disabled when using the memory division function.

Refer to "Divided files are loaded in a batch." (p. 112) and "12 Memory Division Function" (p. 267).

### Decimation

A large amount of space is required to save files in text format. Data decimation reduced the file size. Example: When [Save Thin] is set to [1/2]

Every other data point is saved. The number of data points is reduced to 1/2 of the original amount.

### Save destination

Data can also be automatically saved on a USB flash drive; however, we recommend using Hioki's optional CF card instead for data protection.

### **8** Select the channels to be saved.

Move the cursor to the [Save Channel] box.

Disp Ch	Saves the data obtained through the channels the waveform displays of which are set to <b>[On]</b> on all sheets. (Default setting)
All Ch	Saves the data obtained through all measured channels (When using the memory function, it saves the data obtained through the channels that have been set to <b>[Used Ch]</b> on the status settings screen). Saves the data obtained through the channels the waveform displays of which are set to <b>[Off]</b> .

### **9** Select whether to create folders.

Move the cursor to the [New Folder] box.

No	Creates no folders at the start of measurement.
Yes	Creates a folder at the start of measurement and saves files in this folder.

When **[Save to]** is set to **[LAN]**, this setting is ignored, and a folder named as of the current date is created.

8 Save Channel	Disp Ch
<b>9</b> Folder to save	Yes
<b>10</b> Save method	Normal Save

### **10** Set the save method when the space of the storage device is insufficient.

Move the cursor to the [Save method] box.

Normal Save	Stops the automatic saving when the storage device is full.
Delete Save	Deletes old files and continue the automatic saving when the storage device is full. (Waveform files only.) Waveform files saved after measurement started are deleted in the order in which they were saved (oldest first). No waveform files already saved on the media when measurement started will be deleted.

When the save destination is set to [LAN], the save method is changed to [Normal Save], and this setting is ignored.

### **11** Confirm the measurement conditions and start measurement.

Press the **START** key.

After the instrument writes the data in the memory, the waveforms are saved on the specified storage device.

### Number of files a folder can retain

A folder can retain 5000 of files and folders collectively. Refer to "Auto-saving operations (When the save destination is set to a storage device)" (p. 101).

### • [Preparing files] display

Sometimes the **[Preparing files]** message is displayed after measurement starts. This indicates that the instrument is checking the state of the destination in which the file will be saved. The more the files exist in the destination folder, the longer it takes to check its state.

When a printing action is attempted simultaneously with a saving action, the printing action may be performed in priority to the saving action, with the result that the [Preparing files] message may be displayed for a long time.

### To close the auto-saving dialog box

Press the **SAVE** key to toggle dialog box display.


#### Auto-saving operations (When the save destination is set to a storage device)

5





#### Save operations (When the save destination is set to [LAN])

The file is saved according to the method (on the right figure) specified in the **[Save Settings]** dialog box of Model 9333 LAN Communicator. For more information about how to configure the save settings, refer to the instruction manual of Model 9333 LAN Communicator.

The instrument gives the names in the previouslydetermined formats to the destination folders and files, and then saves them as follows:



erver Settings 🛛 🔀				
Port number: 8801				
Save Settings Eolder to receive waveform data:				
C:¥user Browse Stop accepting waveform data when free disk space reaches 100  MB(0MB-999MB)				
☑ Delete old files         Delete old files when total size of file received exceeds         10				
Print Image Color Settings © Color © Monochrome © Colors set on the MEMORY HiCORDER				
Print Image Output Device     Or Printer     Or Save to File				
OK Cancel				

## 5.2.3 Saving Data Selectively (SAVE Key)

To save file instantly, by pressing the **SAVE** key, you need to specify the items to be saved beforehand. You can save the following types of data: Setting data, waveform data, display images, waveform images, and numerical calculation results.

#### Procedure

#### To display the screen

Press the SYSTEM key several times to display the [File Save] sheet on the system screen.

## **1** Set the save method when the SAVE key is pressed.

Move the cursor to the **[Select at save]** box, and select **[No]**.

	Yes	Displays a dialog box when the <b>SAVE</b> key is pressed to enable you to select the items to be saved, and then saves a file consisting of the selected items. (Default setting) Refer to "Selection Save" (p.95).
No Saves a fi predeterm pressed. Refer to "d		Saves a file instantly consisting of the predetermined items when the <b>SAVE</b> key is pressed. Refer to "Quick save" (p.95).

Once **[Select at save]** is set to **[Yes]**, the subsequent settings can be set in the dialog box that is displayed by pressing the **SAVE** key at the start of measurement. (See the center figure on the right.)

However, the dialog box cannot be disabled while another dialog box such as the folder dialog box is being displayed.



Save Area

Division



5

#### **2** Set the save destination.

Move the cursor to the **[Save to]** box, and select **[Edit]**.

The folder dialog box is displayed (See the bottom figure on the right).

Move the cursor to a storage device used as the save destination, and select [Confirm] to confirm the selection.

HDD	Automatically saves a file on the built-in drive. (When Model U8331 SSD Unit is installed)		
CF	Automatically saves a file on a CF card.		
USB	Automatically saves a file on a USB flash drive.		
LAN	Automatically saves a file on the computer connected via LAN. Model 9333 LAN Communicator is required.		

When the root directory (topmost folder on the storage media) is selected, the "HIOKI8847" folder is automatically created. (When the storage device has been formatted with the instrument, the instrument has already created the folder.) Files are saved in this folder.

To create a new folder to be set as the save destination, select [New Folder].

When the save destination is set to **[LAN]**, the **[New Folder]** command is ignored, and a folder named with the current date is created.

#### **3** Set the file name.

Move the cursor to the **[Save Name]** box and enter a file name.

Refer to "Save operations (When the save destination is set to [LAN])" (p. 102).

When the save destination is set to **[LAN]**, the file is named in the previously-determined format and the name entered in the **[Save Name]** box is ignored. Refer to "Save operations (When the save destination is set to [LAN])" (p.102).

#### File name

The maximum number of characters for **[Save Name]** is 123. The maximum path length including file name is 255 in characters.

HDD:¥					
Normal States (Second Second S					
≫ USB1: ≪ CF:¥	To select a storage device	Up/down CURSOR			
< LAN:¥	To open the lower level folder	Right CURSOR			

## **4** Specify the action when a file with the same name exists in the target folder.

Move the cursor to the [Same Name] box.

Auto	When no files with the same name exist, the instrument gives the predetermined name to a file and saves it. When another file with the same name exists, the instrument gives the name beginning with a 4-digit number to a file and saves it (default setting).
Serial	Unconditionally, the instrument gives the name beginning with a 4-digit number to a file and saves it. When another file with the same name exists, the instrument gives the name beginning with a 4-digit number increasing the number in one increments to a file and saves it.

] <b>(</b> S	ame Na	me	Auto	

If you specify a filename that begins with a single-byte character, its numerical portion will be incremented by one during subsequent saves. If there are more than 5 digits, numbering will start with "0001."

If you wish to use a date or other number as the filename, enter a letter or other character before the single-byte numerical portion.

Example: If you specify "A200817" as the filename

 Auto A200817 0001A200817 0002A200817 0003A200817
 Serial 0001A200817 0002A200817

0003A200817

#### **5** Set the items to be saved.

Move the cursor to the [Save Type] box.

Setting	Saves the settings data.
Wave Binary	Saves waveform data in binary format. Select this option to reload the waveforms with the instrument.
Wave Text	Saves waveform data in text format. Select this option to load the waveform data with a computer. (Memory, recorder, and FFT functions only)
Wave ALLWave Bin	Saves data included in all blocks in binary format. (Only when [Memory Div.] is set to [On].)
Wave ALLWave Txt	Saves waveform data in text format. (When [Memory Div.] is set to [On])
Display screen	Saves screen display data in BMP format. You can see data saved in BMP format on a computer with graphic viewing software.
Waveform screen	Saves printer output data of waveforms in BMP format. You can see the data saved in BMP format on a computer with graphic viewing software.
Numerical calculation results	Saves numerical calculation results. (Memory function only)
Waveform evaluation settings	Saves settings data and waveform evaluation areas.
Waveform evaluation area	Saves evaluation areas created with the waveform evaluation function in black-and- white BMP format. You can edit saved data with a computer and load back onto the instrument. Edit images using black and white only.
Pulse pattern	Saves pulse patterns registered in the MR8791.
Arbitrary waveform	Saves user-defined waveforms registered in the U8793.
Program	Saves program data registered in the U8793.

Select at save	No
Save Type	Wave Binary
Save to	CF:¥
Save Name	
Save Area	Whole Wave
Division	16M

5

6

#### **6** (When [Save Type] is set to [Wave Binary] or [Wave Text])

Move the cursor to the [Save Area] box.

Whole Wave	Saves the entire data written in the memory. (Default setting)
A-B Wave	Saves the data within the range between Cursors A and B. When only Cursor A is set, the instrument saves entire data within the range after Cursor A point. Refer to "7.2 Specifying the Waveform Range (Cursors A and B)" (p. 145).

The instrument saves the data obtained through the channels displayed on the screen.

#### 7 Advanced settings

Available settings differ depending on the saving type.

Save types	Settings	Description	Save Area
Setting	_	_	
Wave	Division	(Off, 16 M, 32 M, 64 M)	
Binary		Select this option to divide a large	Save Type
		file into several files and save them. The instrument creates a folder with the specified name, divides a file into several files, and then saves them in	Save to
			Save Name
			Save Area
		the folder.	Save Thin
Nave	ve Save (OFF, 1/2 to 1/1000)		
Text	Thin	Select this option to decimate data,	Course Trues
		and then save it.	Save Type
		Sets the decimation factor (ratio	Save to
		of retained sample to the whole sample).	Save Name
Display	Image Color	(Color, Gray, Mono, Mono [Rev])	Image Color
screen		Specifies the color of image files to	Image size
Hard		be created.	Save GUI
copy of	Image	(Uncompressed, Compressed)	
he	size	Specifies whether to compress	
display)		image files.	
	Save	(Yes, No)	
	GUI	Specifies whether to include the GUI in image files.	

Save Type	Wave Binary
Save to	CF:¥
Sa∨e Name	
Save Area	Whole Wave
Division	Off

~	<b>T</b>	
Save	Thin	OFF
Save	Area	Whole Wave
Save	Name	
Save	to	CF:¥
Save	Туре	Wave Text

Save Type	Screen copy
Save to	
Sa∨e Name	
Image Color	Color
Image size	Uncompressed
Save GUI	Yes

5 Saving/Loading Data and Managing Files

Save types	Settings	Description
Waveform screen (Print image)	Output File	(All, 1 through 250) Specifies the number of files to be saved. To specify a print range, open the [Printer] sheet using the system screen, and set the print range setting to [A-B Wave]. (Memory and recorder functions only)
	Wave Image Shot	(1 through 60 div) Specifies the number of samples per file. If the number of measurement samples is lower than the number of divisions entered in the [Wave Image Shot] box, the instrument saves the measured data of only the actual number. (Memory and recorder functions only)
Calc Result	Folder to save	(New File, Existing File) Specifies whether the instrument gives a new name to the file (adds sequential numbers when the file with the same name exists) to a file every time, or appends data to the existing file

Save Type	Wa∨e Image
Save to	HDD:¥
Sa∨e Name	
Save Area	Whole Wave
Output File	1
Wave Image Shot	30div
Save Type	Calc Result
Save to	CF:¥
Save Name	

New File

Folder to save

## **8** (For memory function) When using the memory division function

Select the blocks to be saved. Move the cursor to the **[Save Block]** box.

All Blks	Saves all blocks that include waveforms.
Start-End	Saves all used blocks beginning from the start block.

The data save settings are terminated. Whenever the **SAVE** key is pressed, the instrument saves data in these settings.

Display image files saved with the **[Image size]** setting set to **[Compressed]** cannot be displayed with some image viewer applications.

## 5.2.4 Saving Waveform Outputting Data to a Storage Device

You can save pulse pattern data registered in Model MR8791, arbitrary waveform data registered in Model U8793, or program data in a storage device.

Before attempting to save the data, make sure that a storage device is inserted and the destination to save is correctly specified.

#### Procedure

#### To display the screen

Press the FILE key to display the [File] sheet.

HIOKI File CE:\HIOKI8847\				F	20-Aug 16:36:43)
Name 🛆	Туре	Date	Time	Size	
<u>wrð</u> NDISE .	WFG	15-08-20	16:32:42	20KB	
					Contraction Contra
					Cance I
					FILL PALT
Command Save	9	Save Info			
Save Tyne Ark Waveform Save Name INVERTER_U1 Same Name Auto		Save Type Save Size	WFG 20KB		Arb Waveform FS
Channel No 1 Name NONAME					
Set the format to save the data. Hint Text data cannot be read in this instr	ument.				FR 3/3 Nave Darce

- **1** Press [Next Page].
- 2 Select [Pulse Patt], [Arb Waveform], or [Program].
- **3** Enter a file name in the [Save Name] box.
- **4** Register the unit number of the MR8971 or the U8793 in the [Unit No] box, the channel number in the [Channel No] box, and the data name in the [Name] box.
- **5** Press [Exec].

The data registered in the module is saved onto the storage device.

For each of detailed save settings, refer to the instruction manual of Models U8793, MR8790, and MR8791

## 5.3 Loading Data

You can load the data saved on a storage device or in the internal memory of the instrument.

#### Data loading procedure

Before attempting to save the data, make sure that a storage device is inserted, and the save destination is correctly specified.

Only settings and measured data saved in binary format can be loaded into the instrument.



For the detailed settings for loading (registration) of pulse pattern data, arbitrary waveform data, and program data, refer to "8.11 Registering Waveforms in the U8793 Arbitrary Waveform Generator Unit" (p. 206) or the instruction manual of Models U8793, MR8790, and MR8791.

#### Procedure

#### To display the screen

Press the **FILE** key to display the file screen.

#### **1** To load a text comment

Press the **SYSTEM** key to display the **[Printer]** sheet on the system screen.

Move the cursor to the [Text Comment] box, and select [Before Wave] (or [After Wave]).

Up/Low Print	Off
0-Pos Comment	Off
Text Comment	Before Wave
Print Counter	Off

#### **2** Select a file.

Use the **CURSOR** keys to select the file to be loaded.

(Identify the file type based on an extension.)

Refer to "(Extension)" in "Data loading procedure" (p. 110).

HIOKI File	
USB1:¥	
Name	Туре
📁 READONL Y	Folder
📁 H I OK 18847	Folder
RNONAME	.REC
Mauto	.MEM
M READONLY	.MEM
M NONAME1	.MEM
MINONAME	.MEM
M 0003auto	.MEM
M 0002at 2. Select a file.	.MEM
M0001-0070	MEM
COMMENT	.TXT
	RWh

#### **3** Load the file.

Select [Exec] to load the file.

The name of the loaded file is displayed at the top of the screen.

To cancel the file loading action, select [Cancel].

When loading data from the sources other than the internal memory or built-in drive Insert the storage media before selecting the media.

#### **Other limitations**

- You cannot load any data saved with other instruments.
- Loading waveform data changes the settings of the instrument to the settings when the data was saved. To reset the instrument settings, execute [Clear Wave Data] (p. 436) or start measurement.

#### To load waveform files in a bundle

Loading the following index files permits waveform files to be loaded in a batch. The following settings create index files along with waveform files.

Extension	Explanation
IDX	Divided files are loaded in a batch. (To create index files, on the system screen, select the [File Save] sheet, enter the dividing size in the [Division] box, and then save the waveform files. Note: When [Save type] is not set to [Wave Binary], no index files are created.) Refer to "5.2.2 Automatically Saving Waveforms" (p.96) and "5.2.3 Saving Data Selectively (SAVE Key)" (p.103).
SEQ	<ul> <li>(When using the memory division function of the memory function)</li> <li>Waveform files of all blocks are loaded in a batch.</li> <li>(To create index files, first, on the status screen, select the [Memory Div] sheet, set [Memory Div] to [On]. Next, on the system screen, on the [File Save] sheet, set [Save Type] to [ALL-Wave Bin]. Then, save the waveform files.)</li> <li>Refer to "12.1 Configuring the Recording Settings" (p.269) and "5.2.3 Saving Data Selectively (SAVE Key)" (p.103).</li> </ul>

#### Loading a waveform evaluation area

The files with the following two extensions can be loaded onto the instrument.

Extension	Explanation
ARE	Files with an ARE extension contain a waveform evaluation area and settings data. (Files that are saved with the [Area settings] setting.)
BMP	Files with a BMP extension contain a waveform evaluation area. (Files saved with the <b>[Area image]</b> setting can be edited on computers and loaded back onto the instrument.)

#### Loading data for waveform generation (registration)

The files with the following extensions, which are for waveform generation modules, can be loaded onto the instrument.

You can load the data on the signal generator screen of the channel screen (displayed by pressing the **CHAN** key) or of the file screen (displayed by pressing the **FILE** key).

For details, see the instruction manual of Models U8793, MR8790, and MR8791.

Extension	Explanation
WFG,TFG	Loading a file with a WFG or TFG extension permits its waveform generation data to be registered in channels of a specified arbitrary waveform generator module. The loaded (registered) waveform data is output from Model U8793 Arbitrary Waveform Generator Unit. Refer to "8.11 Registering Waveforms in the U8793 Arbitrary Waveform Generator Unit" (p.206).
PLS	Loading a file with a PLS extension permits its pulse pattern data to be registered in channels of a specified arbitrary wave generator module. The loaded (registered) pulse pattern waveform is output from Model MR8791 Pulse Generator Unit.
FGP	Loading a file with an FGP extension permits its waveform generation program file to be registered in channels of a specified arbitrary waveform generator module.

# 5.4 Automatically Loading Settings (Auto-setup Function)

The saving settings described below permit themselves to be automatically loaded at startup.

The auto-setup function supports the STARTUP file saved on a CF card only. When the STARTUP file is saved on the built-in drive, USB flash drive, or RAM (internal memory), it is not be referred. Always create the STARTUP file on a CF card.

#### Procedure

#### To display the screen

Press the FILE key to display the file screen. (p. 92)

- **1** Select [Change Media] and specify the CF card.
- 2 When the "HIOKI8847" folder exists in the root directory (topmost folder on the storage device), move the cursor to that folder.

When the folder does not exist, go to the root directory. (The instrument creates the "HIOKI8847" folder and saves settings in it.)

- **3** Select [Save] and set the [Save Type] setting to [Setting].
- 4 Move the cursor to the [Save Name] box and enter "STARTUP."

Refer to "8.1.3 Entering Alphanumeric Characters" (p. 163).

**5** Move the cursor to the [Same Name] box and select [Overwrite].

#### **6** Select [Exec].

**To cancel the automatic file loading action** Select **[Cancel]**.

When the instrument is turned on next, the settings are loaded automatically.

CF:¥HIOKI8847¥		
	Name	
2 READONLY		
📁 HIOKI		
RNONAME		
Mauto		
<u>M</u> ÎREADONLY		
MÎNONAME1		
MÎ NONAME		
Command	Save	
Save Type 3	Setting	
Sa∨e Name 🏼 4	STARTU	Р
Same Name 🏼 5	Overwrite	

5

### 5.5 Managing Files

Press the **FILE** key to display the file screen. The file screen allows you to manage data saved in storage devices.

Select a file on the file list with the **CURSOR** key.

Before performing an operation, insert a storage device (except for the optional built-in drive). If no storage device is inserted, the **[NO FILE]** message appears on the file list of the file screen.

#### List of file operations

Operation key	Function indication (GUI)	Description	Reference page
CH.SET	Media Change	Changes storage devices.	(p. 92)
F1	Save	Selects channels, and then saves settings data and waveform data that belong to the selected channels as files.	(p. 115)
	Sort	Sorts the files on the file list in the selected order.	(p. 120)
F2	Open Folder	Opens the selected folder.	(p. 118)
	Load	Loads settings data or waveform data from a file.	(p. 110)
	Сору	Copies a file to a specified folder. When a folder is selected, displays items in the folder.	(p. 122)
F3 New Folder Creates a new folder.		Creates a new folder.	(p. 118)
	Rename	Renames a file or folder.	(p. 121)
F4	Delete	Deletes a file or folder.	(p. 119)
	Initialization	Formats the selected storage device.	(p. 49)
F5	Next Page	Switches the operations assigned to the F keys (GUI).	

#### 5.5.1 Saving Data

You can save settings data, waveform data, and waveform generation data in a storage device. The instrument saves data in the folder indicated by the cursor.

You can specify a range using Cursors A and B and save a portion of waveform data.

#### Procedure

1

#### To display the screen

Press the **FILE** key to display the file screen. (p. 92)

Select a storage device. Refer to "To change storage devices" (p.92).

2 Move the cursor to the target folder.

#### 3 Set the items to be saved.

Select [Save], and then move the cursor to the [Save Type] box.

Setting	Settings data
Wave Binary	Waveform data (Binary)
Wave Text	Waveform data (Text) (Memory, recorder, FFT function)
Numerical calculation results	Numerical calculation results (Text)
Waveform evaluation settings	Settings data and evaluation area
Waveform evaluation area	Evaluation area data
Pulse pattern	Pulse pattern data registered in the MR8791*
Arbitrary waveform	User-defined waveform data registered in the U8793*
Program	Program data registered in the U8793*

\*Refer to "5.2.4 Saving Waveform Outputting Data to a Storage Device" (p. 109) for more information about how to save data.

#### **4** Enter a file name.

Move the cursor to the [Save Name] box. Enter a file name. Refer to "8.1.3 Entering Alphanumeric Characters" (p. 163).

CF:¥HIOKI8847¥	
	Name
2 READONLY	
📁 HIOKI	
RNONAME	
<u>M</u> auto	
M READONLY	
M NONAME1	
MONAME	
	/



• Only the files in text

• When [Memory (Int)] is selected as the save

- can be saved. Waveform evaluation areas can be saved in black-andwhite BMP format.
- · You can edit the saved data with a computer and load it back onto the instrument.
- · Edit images in black-andwhite only.

## **5** Specify the action when a file with the same name exists in the target folder.

Move the cursor to the [Same Name] box.

Auto	When no files with the same name exist, the instrument gives the predetermined name to a file and saves it. When another file with the same name exists, the instrument gives the name beginning with a 4-digit number to a file and saves it (default setting). When the name of the existing file begins with a numeral, the instrument gives the name beginning with the sequence number that follows the existing file name's number to a file.
Serial	Unconditionally, the instrument gives the name beginning with a 4-digit number to a file and saves it. When another file with the same name exists, the instrument gives the name beginning with a 4-digit number increasing the number in one increments to a file and saves it.
Overwrite	The instrument saves the file with the specified name.
Error	When a file with the same name exists, the instrument displays an error message.

#### **6** (When the save type is set to [Wave Binary])

Select whether to divide files.

Move the cursor to the [Division] box.

OFF	Saves a file without dividing it.
16M, 32M, 64M	Divides a file into sections with a selected size and saves them.

Refer to "Division save" (p. 117).

#### (When the save type is set to [Text])

#### Set the data decimation factor.

Move the cursor to the [Save Thin] box.

OFF	No data is decimated.
1/2 to 1/1000	Sets the decimation factor (ratio of retained sample to the whole sample).

#### Select the channels to be saved.

Move the cursor to an item under [Save Ch].

	Ana cha	log nnels	Logic channels	Waveform calculations (When [Wave Calculation] is set to [On].
	Sav	e Ch	Save L	Z
	12345678	11121314	L L8	ALL
	0000000000	0000	0 0	0
	-	The data of	otained thro	ough the channel is not saved.
	0	The data of	otained thro	ough the channel is saved.
- 1				

Saves waveforms acquired across all channels

(analog, logic, calculated waveforms).

Returns to previous settings.

( Com	ma	nd						S	a٧	'e					)
Sav	е	Ту	pe				Wave Text								
Sav	е	Na	me												
Sam	е	Na	me					Α	ut	0					
Save Thin					(	DFI	=			)					
							Sa	ave	e l	Ch					
	1	2	3	4	5	6	7	8	9	10	11	12	13	14	
	0	0	0	0	0	0	0	0	0	0	0	0	0	0	

When saving settings data, you can create a settings file for the automatic settings loading as follows: (1) specified the folder [HIOKI8847] on the CF card as the save destination, and (2) select [Save Name]. Refer to "5.4 Automatically Loading Settings (Auto-setup Function)" (p.113).

All Ch

Reset

7

#### 8 Execute the save operation.

#### Select [Exec].

To cancel the file saving action, select [Cancel].

#### File name

The maximum number of characters for **[Save Name]** is 123. The maximum path length including file name is 255 in characters.

#### **Division save**

- You can divide the large size of waveform data and save them as multiple files if necessary.
- When saving data with [Division] is set to any setting option other than [Off], a folder is automatically created, and then waveform files and an index file (extension: IDX) are created in the folder.
- Loading the IDX file allows the waveform files to be loaded in a batch. Refer to "To load waveform files in a bundle" (p. 112).
- Each file can be treated as a separate waveform data file.

#### Other limitations

Data saved in text format cannot be loaded onto the instrument.

### 5.5.2 Checking the Contents in a Folder (Opening a Folder)

Opening a folder enables you to observe its contents. (The instrument displays the contents of the folder.)

#### Procedure

#### To display the screen

Press the FILE key to display the file screen. To change storage devices (p. 92)

Move the cursor to the folder in which you want to see contents.

#### **2** Select [Open Folder], or press the Right CURSOR key.

The list of the folder contents will be displayed.

To move up to a higher-level folder

Press the Left CURSOR key.

#### 5.5.3 Creating New Folders

You can create new folders in the presently displayed folder.

#### Procedure

#### To display the screen

Press the **FILE** key to display the file screen.

To change storage devices (p. 92)

- **1** Have the instrument display a folder in which you want to create a new folder.
- **2** Select [New Folder].
- **3** Enter the folder name in the [Folder Name] box.

Refer to "8.1 Adding Comments" (p. 160).



#### **4** Select [Exec].

The instrument creates the new folder. **To cancel the folder creating action** Select **[Cancel]**.

#### Folder name

The maximum number of characters for **[Folder Name]** is 127. The maximum path length including file name is 255 in characters.

#### **Deleting Files and Folders** 5.5.4

Follow this procedure to delete files or folders.

#### Procedure

#### To display the screen

Press the **FILE** key to display the file screen.

To change storage devices (p. 92)



#### **2** Select [Del Folder].

[DeleteOne] is displayed in the [DeleteTarget] box.

### **3** (When multiple files are to be deleted)

#### Select [Multi Files].

[DeletePlural] is displayed in the [DeleteTarget] box.

Slct/Deslct	Selects the individual file or folder at the cursor. When any file or folder is presently selected, the selection is cleared.
Slct/Deslct All	Selects all files and folders. When any file or folder is presently selected, the selection is cleared.
Rev Slct	Presently selected files and folders are cleared and presently unselected files and folders are selected.

Selected files or folders are shown in red (See the right figure).

#### **4** Select [Exec]

The selected files or folders are deleted.

#### To cancel the deleting action

Select [Cancel].



seι	Dereteriurar
Y	
0	
0	
0	

5

### 5.5.5 Sorting Files

You can sort files in the selected order.

#### Procedure

1

#### To display the screen

Press the **FILE** key to display the file screen.

To change storage devices (p. 92)

Select <mark>[So</mark> box.	ort], and then select a sort criterion in the [Type]
OFF	Does not sort files.
Name	Sorts files in alphabetical order.
Туре	Sorts files by type of data (settings, MEM waveforms, etc.)
Date	Sorts files in creation date and time order.
Size	Sorts files in size order.



#### **2** Move the cursor to [Order].

Ascending order	A to Z, old to new, small to large
Descending order	Sorts files in the reverse order

Folders and files are sorted in the specified order.

#### **3** Select [OK].

The sort screen is closed.

An item selected as the sort criterion is displayed in the file list (with  $\triangle$ : Ascending order mark;  $\bigtriangledown$ : Descending order mark) and its GUI is marked. When the folder contains both files and folders, folders are listed upper than files.

### 5.5.6 Renaming Files and Folders

You can rename files and folders.

#### Procedure To display the screen Press the **FILE** key to display the file screen. To change storage devices (p. 92) 1 Select the file or folder you want to rename. 2 Select Rename 2 Select [Rename]. the icon. 3 Select [Enter Char], and enter a name in the [Save Name] Format box. 3 Command Refer to "8.1 Adding Comments" (p. 160). Rename Save Name NONAME1 4 Select [Exec]. The file or folder is renamed. To cancel the renaming action Select [Cancel].



## 5.5.7 Copying a File Into a Specified Folder

You can copy files into the specified folders.

#### Procedure

#### To display the screen

Press the **FILE** key to display the file screen. (p. 92)



#### **2** Select [Copy].

Move the cursor to [Copy Place].

#### **3** Select [Edit].

The folder dialog box appears (See the right figure).

#### **4** Move the cursor to the target folder and select [Confirm].

#### 5 (When copying multiple files) Select [Multi Files].

Slct/Deslct	Selects the individual file or folder at the cursor. When any file or folder is presently selected, the selection is cleared.
Slct/Deslct All	Selects all files and folders. When any file or folder is presently selected, the selection is cleared.
Rev Slct	Presently selected files and folders are cleared and presently unselected files and folders are selected.

Selected files or folders are shown in red (See the right figure).

#### Select [Select End].

#### **6** Select [Exec].

The files are copied to the specified destination.

To cancel the file copying action Select [Cancel].









$\bigcirc$	HIUK1884/
R	NONAME
M	auto
M	READONLY
M	NONAME1
M	NONAME
M	0003auto
M	0002auto
M	0001auto
?	MEAS /

### 5.5.8 Printing the File Table

You can print the file table displayed on the file list of the file screen. The file table containing all displayed items are printed.

Only folder names are printed. Any other information on the contents contained in folders is not printed.

#### Before printing file tables, make sure the recording paper is loaded correctly.

Refer to "2.4 Loading Recording Paper" (p.49).

#### Procedure

#### To display the screen

Press the FILE key to display the file screen. To ch

To change storage devices (p. 92)

#### Press the **PRINT** key.

The file table is printed.

To stop the printing action before it has finished

Press the **STOP** key.

The contents printed on file tables are as follows.

#### **Print Example**

No.	File Name	Туре	Date	Size	Attribute
1 2	0001AUTO 0002AUTO	MEM MEM	15-10-30 00:00:00 15-10-30 00:01:00	21kB 21kB	[]

File attributes are represented by single letters as follows.

R	For loading only	
Н	Hidden file	
S	System file	
D	Folder	
А	Archive (Backup)	

Managing Files

The [Printer] sheet enables you to set the print method and detailed printer options.

#### To display the [Printer] sheet



#### What you can do on the [Printer] sheet

#### Setting the print methods

Refer to the following pages: "6.1 Print Type and Procedure" (p. 126) • Auto-printing (p. 127) • Manual print (p. 130) "6.6.1 Printing the Screenshot" (p. 136) "6.6.2 Printing Reports (A4-Sized Print)" (p. 136) "6.6.3 Printing a List" (p. 138) "6.6.4 Printing the Text Coments" (p. 138)

#### Configuring the printer settings

- Print speed (p. 133)
- Grid type (p. 133)
- Channel marker type (p. 133)
- List (p. 134)
- Gauge (p. 134)
- Printer density (p. 133)
- Horizontal axis (Time axis) Zoom (Mag/Comp) (p. 134)
- Upper/Lower limit print (p. 135)
- Zero-position comment print (p. 135)
- Print counter (p. 135)

#### On/off setting of printing comment and setting condition

Refer to the following pages:

"8.1.1 Adding, Displaying, and Printing the Title Comment" (p. 160) "8.1.2 Adding, Displaying, and Printing the Channel Comments" (p. 161)

- As much as possible, avoid printing in hot and humid environments. Otherwise, the printer life may be severely shortened.
- If you continue solid printing (black print), print may be blurred. In such a case, stop the printing and start printing after a while.

## 6.1 Print Type and Procedure

There are three basic types of printing.



\* When using the roll mode function, you can print waveforms simultaneously with displaying them. (However, when the timebase is set to any settings higher than 500 ms/div, the start of the print is delayed.)



When both the auto-printing and auto-saving are enabled, the auto-saving is executed first. However, when the roll mode function (default setting: **[Auto]**) is used with the memory function, the auto-printing is executed first.

6

Printing Data

## 6.2 Setting Auto-printing

This function can be used in the memory, recorder, and FFT functions. These settings must be set before starting measurement.

When you press the **START** key to start measurement, measured data will be printed automatically. When using the printer output, make sure that the recording paper is loaded correctly. When using the LAN output, make sure that the computer connected via LAN is prepared.

#### Procedure

#### To display the screen

Press the SYSTEM key and then select the [Printer] sheet.

#### Enable auto-printing.

#### (When using the memory or FFT function)

Move the cursor to the [Auto Print] box, and select [On].

Default setting: Off (no automatic printing)

#### (When using the recorder function)

Move the cursor to the [Realtime Print] box, and select [On].

### 2 (When using the memory or FFT function)

Designate the output destination.

Move the cursor to the [Output] box.

Printer	The data is automatically printed by the internal printer. (Default setting)
LAN	The data is automatically output to the computer connected via LAN. Model 9333 LAN Communicator is required.

## **3** (When using the memory function) Specify the print area as required.

Move the cursor to the [Print Area] box.

Whole waveforms	Prints the entire waveform data written in the internal memory of the instrument. (Default setting)
A-B waveforms	Prints only the portion specified with Cursors A and B out of the entire waveform data written in the internal memory of the instrument.

While the recorder function is being used, the entire length of the waveform is printed during measurement regardless of the print area setting.







#### To output waveform data to the computer connected via LAN Model 9333 LAN

Communicator is required to be installed on the computer to which the data is to be output. For more information about how to operate and configure it as well as install it on the computer, refer to the instruction manual of Model 9333.

• When the output destination is set to [LAN] The IP addresses of the instrument and the computer connected via LAN must be set. For more information about how to set the IP addresses, refer to (p. 342).



## **4** Set the print margins between two actions of the automatic print

Move the cursor to the [Feed] box.

Yes	Leaves a margin. (Default setting)
No	Does not leave margins.*

Print GUI	Yes
Feed	Yes
Auto Print	
Auto Print	Off
Output	Printer
Uutput	Printer
lla (Laur Dalat	044

#### \* Leaves a 2-mm-width margin.

The setting in the [Feed] box is also applicable for normal printing.

**5** Check the measurement conditions and start measurement. (Press the START key.)

#### When using the memory function

The recording length of data is written into the memory and then printed automatically.

#### When using the recorder function

The data is written in the memory and printed in real time.

#### When using the FFT function

Data is analyzed with the FFT method and then printed automatically.

#### To stop the printing action before it has finished

Press the **STOP** key. Measurement in progress is also stopped.

You can suspend the printing action and resume it by pressing the **F** key during the real-time printing (recorder function).

Move the cursor to the [Realtime Print] box and select [On] or [Off].

When the suspended printing action is resumed, the data is printed according to the print range setting.

- When both the auto-printing and auto-saving are enabled, the auto-saving is executed first. However, when the roll mode function (default setting: [Auto]) is used with the memory function, the auto-printing is executed first.
- When manually printing data after waveform is written in the memory with Cursors A and B setting set to on, the selected range of data is printed.

Timebase (Time/div)	Measurement conditions	Printing action	
Up to 200 ms/div	Memory function (roll mode: Off)	The recording length of data is written into the memory and then printed automatically.	
	Memory function (roll mode: On) Recorder function (Recording length: Other than [Cont.])	The data is printed with the minimum of delay behind the data recording.	
	Recorder function (Recording length: [Cont.])	Printing disabled	
More than 500 ms/	Memory function (roll mode: Off)	The recording length of data is written into the memory and then printed automatically.	
div	Memory function (roll mode: On) Recorder function	The data is printed simultaneously with the data recording.	

When the waveform evaluation is performed, the evaluation area is printed at the same time. To disable the evaluation area to be printed, set the waveform evaluation to **[Off]**. (p. 326)

When **[Output]** is set to **[LAN]**, real-time printing is disabled. The instrument with the auto-printing setting prints the data automatically after the recording length of the data is written in the memory regardless of the timebase setting.

#### Printing numerical calculation results simultaneously

On the status screen, select the [Num Calc] sheet, and set [Print Calc Result] to [On].

Refer to "10.5 Printing the Numerical Calculation Results" (p. 248).

# 6.3 Manually Printing Data by Pressing the PRINT Key (Selection Print)

Pressing the **PRINT** key on the waveform screen enables you to specify the print range and data type, and then start printing of the data.

This action can prevent inadvertent printing due to operator error.

#### Procedure

#### To display the screen

Press the SYSTEM key and then select the [Printer] sheet.

#### **1** Enable the selection at time of printing.

Move the cursor to the [Select at print] box, and select [Yes].

(Printer)	Y
Print Speed	Fast/Coarse
Print Density	Standard
PRINT key	
Select at print	No
Output	Printer

#### **2** Specify the output destination.

Move the cursor to the [Output] box.

Printer:	The data is automatically printed with the internal printer. (Default setting)
LAN	The data is automatically output to the computer connected via LAN. Model 9333 LAN Communicator is required.

#### **3** Start and then stop measurement.

Press the **START** key to start measurement. Press the **STOP** key to stop the measurement in progress.

Printing is not possible during measurement. Stop the measurement in progress before start printing.

#### **4** Select print contents and execute printing.

When you press the **PRINT** key, the "Exec Select print" GUI appears on the right side of the screen.

Whole Wave	Prints the entire waveform data written in the internal memory of the instrument. (Default setting)
A-B Wave	Prints only the portion specified with Cursors A and B out of the entire waveform data written in the internal memory of the instrument. (Memory and recorder functions only)
About Trig	Prints each 10 divisions of the waveform data before and after the trigger point. (Memory function only)
List	Prints the main settings.
Report	Prints the report. Refer to "6.6.2 Printing Reports (A4-Sized Print)" (p. 136).

When the selection has been made, the printing is started.

#### To stop the printing action before it has finished

Press the **STOP** key.

When the waveform evaluation is performed, the evaluation area is printed at the same time. To disable the evaluation area to be printed, set the waveform evaluation to **[Off]**. (p. 326)



#### To output waveform data to the computer connected via LAN Model 9333 LAN

Communicator is required to be installed on the computer to which the data is to be output. For more information about how to operate and configure the Model 9333 LAN Communicator, as well as install it on computers, refer to the instruction manual of Model 9333 LAN Communicator.

• When the output destination is set to [LAN] The IP addresses of the instrument and the computer connected via LAN must be set. For more information about how to set the IP addresses, refer to (p. 342).

### 6.4 Setting the Print Density of the Waveform

You can set the printing density of the waveform with respect to each channel.

#### Procedure

#### To display the screen

Press the CHAN key to open the channel screen, and then select the [Unit List] sheet or [Each Ch] sheet.

	Ch			Mode			Zod
Unit		Wa	ve		Rans	(e	
HICH DES	1		1	/oltage		5mV	
IIIUII KES	2		1	/oltage		5mV	
EDEN	3		1	Freq		1Hz	
TREW	4		1	Freq		1Hz	
ANAL OC	5		I	/oltage		5mV	
ANALUU	6		1	/oltage		5mV	
CTDAIN	7		I			20 <i>μ</i> ε	
	8		U			20με	



Coupling	DC	_
LPF	Off	Prob
-【Disp】——		
Wave_Disp (		Grap
Variable	Off	Zoom
Range(/div)	) 200mV	Uppe
Zero pos %	50%	Lowe
[Scaling] -		

[Each Ch] sheet

#### Move the cursor to the [Wave] column or the [Wave\_ Disp] box.

Light, Midlight, Standard (Default setting), Middark, Dark

When the waveform print density is set to **[Light]**, a temporary drop in power voltage (for example, a momentary power failure) during printing may cause the print to fail.

## 6.5 Configuring the Printer Settings

Configure the printer settings on the [Printer] sheet of the system screen.

#### Printer settings

#### To display the screen

#### Press the SYSTEM key and then select the [Printer] sheet.

1 Print Speed	Fast/Coarse	Print GUI	Yes	(p. 136)
<b>2</b> Print Density	Standard	Feed	No	(1 /
PRINT key Select at print Output	No Printer	-Auto Print Auto Print Output	On Printer	
-【Waveform Printing】-				
3 Grid	Standard	Up/Low Print	Off	
4 Ch Mark	Ch No.	Zero-Pos Comment	Off	
Time Value	Time	Text Comment	Off	(p. 138)
List	Off	Print Counter	Off	
Gauge	Off			
Mag/Comp	Same to display			
Print Area	Whole Wave			

- 1 Select the print speed (quality). Move the cursor to the [Print Speed] box.
- 2 Select the printer density.

Move the cursor to the [Print Density] box.

**3** Select the grid type.

Move the cursor to the [Grid] box.

4 Select the channel marker type. Move the cursor to the [Ch Mark] box. <Print Example>



Channel number

Comment

Fast (coarse, default setting), Normal, Slow (fine)

Light, Midlight, Standard (Default setting), Middark, Dark

Off, Standard (Default setting), Fine, Std Dark, Fine Dark

OFF	Print waveforms without any channel numbers or comments.
Ch No.	Prints waveforms including channel numbers. (Default setting)
Comment	Prints the comments entered in the [Comment] sheet on the channel screen, over the waveform. A comment must have been set. Refer to "8.1 Adding Comments" (p. 160).

#### Grid type

Even when the grids are displayed on the screen, no grids are printed.

#### **Print speed**

When [USB Set] is set to [Mass Storage HDD] or [Mass Storage CF], the instrument always prints data at a speed of the [Slow/Fine] setting.

When the save destination for the auto-saving is set to the USB flash drive, the instrument with the auto-printing setting prints data at a speed of the [Normal] setting even when the print speed is set to [Fast].

The [Fast/Coarse] setting has the maximum print speed of 50 mm/s; [Normal], 20 mm/s; and [Slow/ Fine], 10 mm/s. The speed, however, depends on printing conditions.

Print Speed	Fast/Coarse	Print GUI	Yes	(p. 136)
Print Density	Standard	Feed	No	
PRINT key Select at print Output	No Printer	Auto Print Auto Print Output	On Printer	
–【Waveform Printing】—				
Grid	Standard	9 Up/Low Print	Off	
Lh Mark	Uh No.	Tout Comment	UTT	(n. 120)
5 lime value	0 f f	Text Comment	044	(p. 136)
<b>7</b> Gauge	011 Nff		UII	
8 Mag/Comp	Same to display	У		
Print Area	Whole Wave			

## **5** Select the horizontal axis (time axis) display value.

Move the cursor to the **[Time Value]** box. <Print Example>



#### **6** Configure the list setting

Move the cursor to the [List] box.

#### **7** Configure the gauge setting.

Move the cursor to the **[Gauge]** box. <Print Example>



8 Configure the horizontal axis (time axis) magnification and demagnification setting.

Move the cursor to the [Mag/Comp] box.

Horizontal axis (Time axis) zoom When the time axis zoom setting is used, printing will be executed with this zoom setting, regardless of the zoom setting set on the waveform screen.

Time*	Prints waveforms on the scale markings based on the time from the trigger point (the unit is fixed). (Default setting)
Time (60)*	Prints waveforms on the scale markings based on the time from the trigger point (in sexagesimal [base-60] system).
div	Prints waveforms on the scale markings based on the number of divisions from trigger event.
Date*	Prints waveforms on the scale markings based on the date and time when waveform was written in the memory.
Sample Num	Prints waveforms on the scale markings based on the number of samples from the trigger point.

\* Printing for external sampling is done according to the [Sample Num] setting.

Off	Prints waveforms without any lists. (Default setting)
On	Prints a list following waveform print.
Off	Print waveforms without any gauges. (Default setting)
Before Wave	Prints the gauge proceeding waveform print.
After Wave	Prints the gauge following waveform print.
Before&Aft Wave	Prints the gauges following and proceeding waveform print.

<ul> <li>× 10 to</li> <li>× 1/200,000</li> <li>(When using the memory function)</li> <li>× 1 to × 1/50,000</li> <li>(When using the recorder function)</li> </ul>	Prints waveforms in the magnification or demagnification ratio set here.
Same to display	Prints waveform in the magnification or demagnification ratio set for the waveform screen. (Default setting)

#### **9** Set the upper and lower limit value.

Move the cursor to the **[Up/Low Print]** box. <Print Example>

Upper and lower limits



OffPrints waveforms without upper and lower<br/>limits. (Default setting)OnPrints waveforms with upper and lower limits.

**10** Set the zero-position comment. Move the cursor to the [Zero-Pos Comment] box.

<Print Example>

Comment



**11 Configure the counter print setting.** Move the cursor to the **[Print Counter]** box.

Off	Prints waveforms with channel numbers. (Default setting)
On	Prints waveforms with the comment at the zero position .

• The comment is not printed when the X-Y display or the FFT function is used.

• No zero-position comments are printed at the channels for which no comments have been set.

Refer to "8.1 Adding Comments" (p. 160).

Off	Prints waveforms without any counter. (Default setting)
Date	Prints the date of printing and the number of waveforms written in the memory. (Example: 04-8-1-0001)
Counter Name	Prints waveforms with the counter name and the number of waveforms written in the memory. (Example: Device A-0001)

#### (When [Print Counter] is set to [Date] or [Counter Name])

#### To assign the first counter number freely, set the counter number.

Move the cursor to the **[Counter Num]** box and set a count. Refer to "8.1.3 Entering Alphanumeric Characters" (p. 163).

The count is automatically cleared to zero when the instrument is turned on. The count is increased in one increments every time a waveform is written in the memory. (Maximum count 9999)

#### (When [Counter Name] is selected)

#### Enter a counter name.

Move the cursor to the **[Counter Name]** box and enter a counter name. (Up to 10 characters) Refer to "8.1.3 Entering Alphanumeric Characters" (p. 163).

<Example of Date and Counter Num>

Date Counter Num



<Example of Counter name and Counter Num>

Counter Name Counter Num



#### 6.6 **Advanced Print Functions**

You can print the screenshot of the screen display, reports, and lists.

#### 6.6.1 Printing the Screenshot

Press **COPY** key while the screen you want to print is displayed. The screenshot is printed. The GUI section can be included on the print.

<Print

#### Configuring the GUI print setting

#### To display the screen

Press the SYSTEM key and then select the [Printer] sheet.



Set [Print GUI] to [Yes].

To stop the printing action before it has finished Press the **STOP** key.



#### Printing Reports (A4-Sized Print) 6.6.2

You can print the screen-displaying range of waveforms, upper and lower limit values, and channel settings in A4 size. When the zoom display is used, two zoom display screens are printed. Cursors A and B shown on the waveform screen can also be printed.

When the comment type is set to [Comment] or [Set&Com] on the [Comment] sheet of the channel screen, the title comment can also be printed.

Refer to "8.1.1 Adding, Displaying, and Printing the Title Comment" (p. 160).

#### Procedure

To display the screen

- 1. Press the **DISP** key to open the screen. The waveform screen is displayed.
- 2. Press the **DISP** key. The display menu is displayed.
- 3. Select the [WAVE WIDTH] menu.


### 6.6.3 Printing a List

You can print lists of function status information and channel setting information. The items included in the printed list are the same as those in the list function setting. Refer to "Configure the list setting" (p. 134).

Press the **PRINT** key while any screen other than the waveform and file screen is displayed.

To stop the printing action before it has finished Press the **STOP** key.

The list to be printed contains the setting conditions for the waveform data written in the memory. The list content does not change even when the settings are changed after the waveform data was written in the memory.

### 6.6.4 Printing the Text Coments

You can print a text document edited on a computer together with a waveform.

**1** Create a text file using [Notepad] or another suitable application on the computer.

The maximum size of the text comment that can be imported to the instrument is  $104 \times 200$ . Print width will be adjusted to the widest line.

#### **2** Press the SYSTEM key and set [Text Comment] on the [Printer] sheet.

Off	Prints waveforms without any text comment. (Default setting)
Before Wave	Prints a text comment proceeding waveforms.
After Wave	Prints a text comment following waveforms.

# **3** Press the FILE key to display the file screen and import a text file, which is created on the computer, into the instrument.

Refer to "5.3 Loading Data" (p. 110).

The text file contents are printed along with the waveform.

Print example: Positioning with regard to other print items
<When Before Wave is selected>
<When After Wave is selected>





# 7 Monitoring and Analyzing Waveforms on the Waveform Screen

Analytical operations such as the display magnification, display demagnification, and search are available on the waveform screen. The measurement conditions or other configuration can also be changed on this screen.

#### To display the waveform screen



#### Operations available on the waveform screen

#### **Cursors A and B**

- Reading measured values (p. 140)
- Specifying the waveform range (p. 145)

#### Moving the waveform display position

- Moving the waveforms with the jog dial and shuttle ring (p. 146)
- · Move the waveform position (p. 147)

#### Plotting X-Y composite curves (p. 148)

#### Magnifying and demagnifying waveforms

- Magnifying and demagnifying waveforms horizontally (in the time axis direction) (p. 150)
- Magnifying a part of waveforms horizontally (in the time axis direction) (p. 150)
   Magnifying a part of waveforms horizontally (in the time axis direction) (zeom function) (p. 151)
- the time axis direction) (zoom function) (p. 151)Magnifying and demagnifying waveforms
- vertically (in the voltage axis direction) (p. 153)

#### Monitoring input levels (p. 154)

#### Switching the Waveform Screen (p. 156)

- Displaying the upper and lower limit values
- Displaying comments
- · Switching the waveform display width

# 7.1 Reading Measured Values (Using Cursors A and B)

- You can read time lag, frequency, and potential difference (and scaling values when the scaling is enabled) as numerical values using Cursors A and B on the waveform screen. The cursors also enable you to specify ranges used for calculating values and the X-Y composite curve printing.
- When X-Y composite curves are displayed, you can read measured values using Cursors A and B. For split-screen display, you can read the potential difference even when each of Cursors A and B are set on different graphs.

#### Setting Cursors A and B

#### To display the screen

Press the **DISP** key to display the waveform screen, and then press the **AB CSR** key to display Cursors A and B settings window.

Gr8

Ch

Analog

Ch⇔Calc

#### **1** Select the cursor type.

Move the cursor to the [AB Cursors] box.

2	Select the cursors to be moved.
	Move the cursor to the [Kind] box.

**3** Select the channels to be measured with Cursors A and B.

Move the cursor to the [A] or [B] boxes.

OFF	Uses no cursors.
Div	Moves the cursors horizontally (in the time axis direction) (for X-Y composite curves, in the X-axis direction)
Range	Moves cursors vertically (in the voltage axis direction) (for X-Y composite curves, in the Y-axis direction)
Trace	Traces waveform data.
А	Uses only Cursor A
A-b	Uses Cursors A and B, but moves Cursor A only.
a-B	Uses Cursors A and B, but moves Cursor B only.
A&B	Moves both Cursors A and B together.
ALL	Shows measured values of all channels. (When cursor type is set to <b>[Trace]</b> or <b>[Range]</b> .
CH1 to CH16	Shows measured values of the channels selected from CH1 through CH32. (In Single, Dual, Quad, and Oct mode)
Gr1 to	Chooses the channels to be used for plotting

X-Y composite curves from Gr1 through Gr8 .

analog channel and the waveform calculation

Switches the cursor target between the

data when calculated data exists .

(for X-Y screen)

#### **4** Move Cursors A and B with the jog dial or shuttle ring.

(When the **AB CSR** key LED is on, you can move the cursors with the jog dial or the shuttle ring.

Pressing any key other than the **AB CSR** key closes the setup screen.)

#### If numerical values are hard to read

Press the **DISP** key to display measured values separately from the waveforms.

Refer to "7.7.3 Switching the Waveform Display Width" (p. 156).

## If Cursors A and B are not displayed on the screen even though engaged

You can check the positions of Cursors A and B on the scroll bar. (p. 146) Turning the jog dial and shuttle ring allows each of the cursors to be displayed on the screen.

When the cursor type is set to **[div]** or **[Trace]**, you can perform the cursor measurement even if Cursors A and B are not displayed on the screen.

## To view the waveforms recorded before or after Cursors A and B that are out of display range

When using Cursors A and B, you can display the waveforms that are presently being out of display range immediately using the jump function. Refer to "7.3.3 Changing Position (Jump Function)" (p. 147).



#### Reading measured values on the waveform screen (in Single, Dual, Quad, and Oct mode)

#### To display the screen

Press the **DISP** key to display the waveform screen.

#### <Screen display (for time axis cursor)>



Waveform values of the points at which each cursor crosses the waveforms are displayed.

refer to "Time Value" (p.336).

#### <Cursor values>

Cursor type	Cursor value	Cursor value display example (when two cursors are used)
<b>Div</b> (Time and frequency)	<ul> <li>t: Values at Cursors A and B: Time from the trigger point or the start of recording</li> <li>B-A value: Time lag between Cursors A and B</li> <li>A B</li> <li>B-A</li> <li>B-A</li> <li>Intervention (Intervention (Inte</li></ul>	See "Screen display" above.
<b>Range</b> (Measured values)	Each value at Cursor A and B: Measured value of the channel B-A value: Difference between measured values at Cursors A and B A B B-A	1: A B B 1:40.40mV B B-A 2: -40.40mV
<b>Trace</b> (Time and measured values)	Time values Values at Cursors A and B: Time from the trigger point or the start of recording B-A value: Time lag between Cursors A and B Measured values Values at Cursors A and B: (Memory function) measured value (Recorder function) maximum, minimum values B-A value: Difference between measured values at Cursors A and B A B A B B-A (Difference between measured values) B-A (Time lag)	Time t:

When you press the **DISP** key and then change the waveform display width, the waveforms and cursor values are displayed separately.

Refer to "7.7.3 Switching the Waveform Display Width" (p. 156).

- When using the external sampling, the value t represents the number of samples.
- When the voltage range is changed during measurement using the recorder function or X-Y recorder function, measured values are acquired by tracing the waveforms in the range settings when the measurement was stopped. The data measured with MR8990 Digital Voltmeter Unit is updated every time Cursor A and B moves two points.

#### Reading measured values on the waveform screen (in Single, Dual, Quad, and Oct mode)

#### To display the screen

Press the **DISP** key to display the waveform screen.

#### <Screen display (X-axis cursor)>

X-Y composite curve of waveforms obtained through CH1 and CH2



Values at

#### <Cursor values>



## 7.2 Specifying the Waveform Range (Cursors A and B)

When the waveforms are displayed on the voltage-time graph, you can specify the range with the time axis cursor or trace cursor.

The specified range is applicable for saving files, printing waveforms, plotting X-Y composite curves, and performing the numerical calculation. The range selection is retained even when the waveform display format is changed.



The rough procedure is as follows.

#### **1** Set Cursors A and B.

Refer to "Setting Cursors A and B" (p. 140).

#### 2 Specify a range.

#### · For saving files

Display the system screen, select the [Save file] sheet, move the cursor to the [Save Area] box, and then select [A-B Wave].

Refer to "5.2.2 Automatically Saving Waveforms" (p.96) and "5.2.3 Saving Data Selectively (SAVE Key)" (p.103).

For printing data

Display the system screen, select the [Printer] sheet, move the cursor to the [SIct Print Area] box, and then select [A-B Wave].

Refer to "6.2 Setting Auto-printing" (p. 127) and "6.3 Manually Printing Data by Pressing the PRINT Key (Selection Print)" (p. 130).

• For plotting X-Y composite curves

Display the status screen, select the [Status] sheet, move the cursor to the [Combo Area] box, and then select [A-B Wave].

Refer to "7.4 Plotting X-Y Composite Curves" (p. 148).

#### For performing numerical calculation

Displays the status screen, select the [Num Calc] sheet, move the cursor to the [Calc Area] box, and then select [A-B Wave].

Refer to "6.2 Setting Auto-printing" (p. 127).

#### About how to read measured values and cursor types

Refer to "7.1 Reading Measured Values (Using Cursors A and B)" (p. 140).

#### Available range in which Cursor A and B can be specified

The available range depends on the function.

- · Memory function: Measured data recorded during one time of measurement
- Recorder function: The range of the measured data recorded during one time of measurement or the range of measured data the instrument can record internally, calculated from the end of recording The maximum measured data the instrument can record internally is as follows:

MR8847-51: Up to 20,000 div (if using Model U8975, U8977, or U8978: 10,000 div) MR8847-52: Up to 80,000 div (if using Model U8975, U8977, or U8978: 40,000 div) MR8847-53: Up to 160,000 div (if using Model U8975, U8977, or U8978: 80,000 div)

# 7.3 Moving the Waveform Display Position MEMREC

This function can be used in the memory and recorder functions.

### 7.3.1 Display Position

The scroll bar provides the relative position and size of the displayed portion of the waveforms within the entire recording length of the waveforms. The trigger time, trigger position, and positions of Cursors A and B (When using voltage axis cursor or trace cursor) are also displayed.

#### To verify the display range on the scroll bar



## 7.3.2 Scrolling the Waveforms With the Jog Dial and Shuttle Ring

Rotating the jog dial and shuttle ring allows you to scroll waveforms that have been measured or those exist.

The scrolling speed varies depending on the rotation angle of the shuttle ring. Pressing the WAVE key assigns the jog dial and shuttle ring to scroll dia waveforms. (While the WAVE key LED is on, you can scroll the waveforms with the jog dial and shuttle ring.) Scroll direction Screen display Shuttle ring Farlier Later Turn jog dial or shuttle ring CCW Turn jog dial or shuttle ring CW Scrolls the waveforms backward Scrolls the waveform forward. To see previously obtained waveforms in roll mode

Rotating the jog dial or shuttle ring allows you to observe the previously obtained waveforms during measurement.

To redisplay the waveforms, select [Scroll].

### 7.3.3 Changing Position (Jump Function)

You can specify the portion of the waveforms and display them immediately. You can choose a display location from the following:

- Trigger point
- · Positions of Cursor A and B
- Specified location (from 0%, beginning of the waveform, to 100%, end of the waveform)



#### Procedure

#### To display the screen

Press the **DISP** key to display the waveform screen, and then press the **WAVE** key to display the wave settings GUI displays.



To move the display position when waveforms are written in the memory with the [Memory Div: On] setting of the memory function

Press the **F1** key **[Pos↔Block]**. Move the position with no blocks displayed in the upper part of the screen.

When a block is displayed in the upper part of the screen, you can select a block of the waveforms written in the memory and display it. (p. 157)

#### 7.4 **Plotting X-Y Composite Curves**

MEM X-Y

This function can be used in the memory and X-Y recorder functions.

- Using the recorder function causes Model 8990 to acquire data with a resolution of 16 bits.
- To plot X-Y composite curves, display the status screen, follow the procedure below: (1) Select the [Status] sheet.

(2) Set [Format] to X-Y1 screen or X-Y4 screen. (3) Assign any analog channel to the X-axis and Y-axis.

Up to eight X-Y composite curves can be plotted.

• The magnification/demagnification ratio in the vertical axis (voltage axis) direction also applies for plotting X-Y composite curves simultaneously.

#### Procedure

#### To display the screen

Press the STATUS key to display the status screen, and then select the [Status] sheet.



- 1 Move the cursor to the [Format] box.
- 2 Move the cursor to the [Dots-Line] box.

Move the cursor to the [Format] box.	X-Y Single	Displays and records the waveforms of graphs 1 through 8 in Single mode .
	X-Y Quad	Displays and records the waveforms of graphs 1 through 8 in Quad mode.
Move the cursor to the [Dots-Line] box.	Dots	Displays dots representing only measured data points. The order written in the memory does not appear.
	Line	Displays the data as a waveform by drawing lines connecting measured data points in the order written in the memory. (Default setting)
Move the cursor to the [Combo Area] box		
Refer to "7.2 Specifying the Waveform Range	Whole Wave	Plots X-Y composite curves using all data.
(Cursors A and B) (p. 145).	A-B Wave	Plots X-Y composite curves using only data included in the range specified by Cursors A and B.

- To shorten the time taken to display waveforms after measurement
  - Set the dot-line interpolation setting to [Dots].
  - · Specify the plotting range using Cursors A and B. (memory function only)

3

#### Procedure

#### To display the screen

Press the **DISP** key to display the waveform screen, and then press the **CH.SET** key to display the X-Y settings window.

4	Set the waveform color used in the graph
	display.

Move the cursor to the graph line color map to be set, and choose a color.

You can also select the same color as other lines.

OFF	Displays no waveform. When <b>[Save Channel]</b> of the channel is set to <b>[Disp Ch]</b> , the data obtained through the channel is not saved automatically. Refer to "Select the channels to be saved." (p.99).
ON	Displays the waveform. Select the display color by pressing the [ $\uparrow$ ] and [ $\downarrow$ ] key in the <b>F</b> keys.

# **5** Select the channels for plotting the X-Y composite curve.

Move the cursor to the X (time axis) and Y (voltage axis) column, and assign channels.

You can assign the same channel multiple times.



**To plot X-Y composite curves using the data included in the range between Cursors A and B** Follow the procedure below.

- 1. Press the **STATUS** key to display the status screen, and then select the **[Status]** sheet.
- 2. Set [Format] to Single, Dual, Quad, Oct, or Hex.
- 3. Press the **DISP** key to display to the waveform screen.
- 4. Specify the range for plotting X-Y composite curves with Cursors A and B. Refer to the following pages: (p. 140), (p. 145).
- 5. Press the STATUS key to display the status screen, and then select the [Status] sheet.
- 6. Set [Format] to [X-Y1 Single] or [X-Y Quad].

#### To move the pen displayed on the X-Y composite curves

Pressing the **WAVE** key, which puts the LED on, enables the pens on all the waveforms to be moved with the jog dial and shuttle ring. The time at the pen position is displayed at the top right of the screen.

# 7.5 Magnifying and Demagnifying Waveforms

# 7.5.1 Magnifying and Demagnifying Waveforms Horizontally (in the Time Axis Direction)

This function can be used in the memory and recorder functions. (However, with the recorder function, waveform magnification is not available.)

Magnifying waveforms horizontally (in the time axis direction) enables you to observe data in detail. Also, demagnifying waveforms horizontally (in the time axis direction) enables you to observe overall waveform fluctuations easily.

Waveforms displayed on the screen are magnified and demagnified with reference to the left edge of the screen. However, when Cursors A and B are displayed on the screen, waveforms are magnified or demagnified with reference to Cursor A and B. You can change the magnification/demagnification ratio even after measurement.



#### Procedure

#### To display the screen

Press the **DISP** key to display the waveform screen.



**2** Select a magnification ratio.

Memory function

×10, ×5, ×2, ×1, ×1/2, ×1/5, ×1/10, ×1/20, ×1/50, ×1/100, ×1/200, ×1/500, ×1/1000, ×1/2000, ×1/5000, ×1/10000, ×1/20000, ×1/50000, ×1/100000, ×1/200000

Selecting [Zoom On] enables a part of the waveforms to be magnified in the time axis direction.

Refer to "7.5.2 Zoom Function (Magnifying a Section of the Horizontal Axis (Time Axis))" (p.151).

Selecting **[All Wave]** enables the entire recording length of the waveforms to be displayed.

Recorder function

```
×1, ×1/2, ×1/5, ×1/10, ×1/20, ×1/50, ×1/100, ×1/200, ×1/500, ×1/1000, ×1/2000, ×1/5000, ×1/2000, ×1/20000, ×1/50000
```



To print the waveforms in a different magnification/demagnification ratio from the ratio used to display the waveforms

Specify the ratio on the [Printer] sheet.

Refer to "Configure the horizontal axis (time axis) magnification and demagnification setting." (p. 134).

It may take a long time to display waveforms loaded from the storage device in a high demagnification ratio.

### 7.5.2 Zoom Function (Horizontally Magnifying a Part of Waveforms [in the time axis direction])

This function can be used in the memory function only.

You can display partly magnified (zoomed-in) waveforms together on the horizontally split dual displays with the normal waveforms.

The normal waveforms are displayed on the upper half of the screen, whereas the zoomed-in waveforms are displayed on the lower half.



When the zoom function is used, pressing the **PRINT** key prints the waveforms displayed on the lower half of the screen. (The print format is that for a single screen waveform. If Cursors A and B are used, the selected section is printed.)

Procedure

3

#### To display the screen

Press the **DISP** key to display the waveform screen.

#### 1 Move the cursor to the [Zoom Mag] box.

#### 2 Select [Zoom On].

The zoom function is enabled, and the screen is horizontally split into two: the upper and lower screens. (Upper: waveforms magnified in the specified ratio; lower: partly magnified (zoomed) waveforms)

Move the cursor to the [Zoom Mag] box, and set





The zoomed-in waveforms are displayed on the lower screen. When the [Zoom Mag] setting is set to the same or a lower one than the magnification/demagnification ratio, the zoom-in waveforms are displayed automatically in the next

**4** Scroll the zoomed-in waveforms.

higher ratio of the [Zoom Mag] setting.

Select the zoom-in ratio.

the zoom-in ratio.

Refer to "7.3.2 Scrolling the Waveforms With the Jog Dial and Shuttle Ring" (p. 146).

#### To clear the zoom-in display

Move the cursor to the **[Zoom Mag]** box, and select [Zoom Off]. (The zoom-in display is cleared with the magnification/demagnification ratio set to the same ratio as the zoom-in ratio.) Example: When the zoom-in display is cleared with the zoom-in ratio set to × 5, the magnification/demagnification ratio is set to [×5].

#### To view the entire length of waveforms (Memory function only)

Move the cursor to the magnification/demagnification ratio box in the settings window and select [All Wave]. The entire recording length of the waveforms are displayed on the screen.

ratio

ratio

#### Logic waveform display

When the zoom function is enabled and the logic waveform display position is set to one that is less than the **[50pos]** setting, no logic waveforms are displayed. Example: With the display position set to **[30pos]** 



# 7.5.3 Magnifying/demagnifying the Waveforms Vertically (in the Voltage Axis Direction)

This function can be used in the memory and recorder functions.

You can magnify and demagnify the waveforms vertically (in the voltage axis direction) for the display or printing with respect to each channel.

The waveforms are magnified and demagnified with reference to the zero position.



#### Procedure

#### To display the screen

Press the **DISP** key to display the waveform screen, and then press the **CH.SET** key to display the channel settings

window ([Analog] sheet).

Move the cursor to the [Mag] box of the channel to be adjusted.

×1/10, ×1/5, ×1/2, ×1, ×2, ×5, ×10, ×20, ×50, ×100

Selecting **[Invert]** inverts the sign (positive and negative) of the waveforms. Refer to "8.8 Inverting the Waveform (Invert Function)" (p. 182). 
 Analog
 Variable
 Logic

 ChCol
 Range
 Mag
 PositionL.P.F.

 1
 5mV ×1
 50%

 2
 5mV ×1
 50%

 3
 5mV ×1
 50%

 4
 5mV ×1
 50%

#### To display waveforms in a freely selected ratio

Refer to "8.6 Setting the Waveform Position (Variable Function)" (p. 178).

# 7.6 Monitoring Input Levels (Level Monitor)

### 7.6.1 Level Monitor

You can monitor all input waveform levels in real time. You can display analog channels and logic channels at a time.

#### Procedure

To display the menu

Press the **DISP** key to display the display menu.

Selecting [Monitor] allows the analog channel level monitor to be displayed in the left part of the waveform screen and the logic channel level monitor to be displayed on the right side of the waveform screen.

To clear the level monitor Select [Monitor] again.



When waveforms are displayed in Dual, Quad, Oct, or Hex mode (p. 69) The level monitors are displayed with respect to each graph.

You can combine the upper and lower limits indication with the level monitor.

Refer to "7.7.1 Displaying Upper and Lower Limits on the Waveform Screen" (p. 156).



#### How to read the level monitors

Analog channel level display



When the display setting is On, the part indicated in white takes the color specified for the waveform display. When the setting is Off, the part becomes gray. The part indicated in black is the background color.

- No input levels for channels in which no modules are installed are displayed.
- No analog levels of channels that are unavailable due to the **[Use Ch]** settings are displayed. (Example: When **[Use Ch]** is set to **[Ch1-4]**, the levels for CH5 through CH16 are not displayed.

Logic channel level display

### 7.6.2 Numerical Value Monitor

You can read input signals as numerical values displayed in the same way as digital multimeters (DMMs).

#### Procedure

To display the screen

Press the **DISP** key twice.

нокі				13-Apr 10:46:44	
				DMM	
CH 1:	0.50mV	CH17:	+OVER		
CH 2:	0.90mV	CH18:	+OVER		
СН 3:	0.65mV	CH19:	+OVER		
CH 4:	-0.45mV	CH20:	+OVER		
CH 5:	0.70mV				
CH 6:	-0.90mV				
СН 7:	1.00mV	CH23:	-1.331mV		
CH 8:	0.85mV	CH24:	1.912mV	Fí	— Display menu
СН 9:	1.09mV	CH25:	0.331mV	Hold On/Off	Display menu
CH10:	1.35mV	CH26:	0.631mV		
CH11:	0.44mA	CH27:	0.62mA		
CH12:	0.25mA			Exec <b>ov</b> →	
CH13:	0.36mV	CH29:	-0.10mV	Zero-Adjust	
CH14:	0.88mV	CH30:	0.72mV		
CH15:	0.000 Hz			FR	
CH16:	0.000 Hz			Back to waveform	

When the mouse is connected, clicking the **[DMM]** icon displayed at the upper right of waveform screen allows numerical value (DMM display) to be displayed.

DMM

#### To return to the waveform screen

Press **[Return to Waveform screen]** displayed at the right side of the display menu screen or the **DISP** key.

#### To suspend (hold) the display update

Press **[HOLD On/Off]** displayed on the right side of the display menu screen. The HOLD mark, which indicates that the display update is suspended, is displayed on the screen.

#### To resume the display update

Press [HOLD On/Off] to resume the display update.

#### To execute the zero-adjust

The zero-adjust (calibration for Model MR8990) can also be executed on the numerical value (DMM) display screen. Press the **[Exec. Zero-Adjust]** displayed at the right side of the display menu screen.

# 7.7 Switching the Waveform Screen Display (Display Menu)

You can display the additional information such as upper and lower limit values and comments using the display menu. You can also set the waveform display width. Refer to "7.6.1 Level Monitor" (p. 154).

#### Procedure

#### To display the menu

Press the **DISP** key to display the waveform screen, and then press the **DISP** key again to display the display menu.



# Select the same menu again.

### 7.7.1 Displaying Upper and Lower Limits on the Waveform Screen

Select [Limit Value] to display the upper and lower limit values on the waveform screen.

### 7.7.2 Displaying Comments on the Waveform Screen

Select [Comment] to display the comment on the waveform screen.

- You have to enter a comment on the [Comment] sheet of the channel screen. Refer to "8.1 Adding Comments" (p. 160).
- Other windows and monitors will appear overlapping the comment. Hide the channel settings window, trigger settings window, level monitor, etc., or set [Wave Width] to a narrower setting.

### 7.7.3 Switching the Waveform Display Width

Selecting [Wave Width] allows you to change the display width of the waveform screen. If waveforms are hard to see because numeric values or settings information are overlaid, this function is useful to display the other information separately from the waveforms.

The function is available for the channel settings window and trigger settings window.

# 7.7.4 Switching Channel Information (U8975, U8977, and U8978 only)

Selecting [<=Change Ch] will switch the set range information on the bottom of the screen to CH1 to CH16 or CH17 to CH32.

If the level monitor is on, the monitor values will switch to CH1 to CH16 or CH17 to CH32.

### 7.7.5 Switching the Sheet to Be Displayed

Select between  $[\uparrow]$  and  $[\downarrow]$  to switch the sheet to be displayed.

You can specify the settings with respect to each displayed sheet on the unit list tab of the channel settings window.

Refer to "3.4.4 Display Sheet" (p.78).

# 7.8 Viewing Waveforms Divided Into Blocks

This function can be used in the memory function only.

You can check usage of blocks when waveforms were recorded by using the memory division.

Furthermore, you can select any block to display waveforms recorded in it.

When the memory division is not used, you can display up to 16 measured waveforms depending on the recording length.

Refer to "7.3 Moving the Waveform Display Position" (p. 146).



To display waveforms overlapping those recorded in other blocks (reference blocks) Display the status screen, select the [Memory Div] sheet, set [Ref Block] to [On], and select [All Blks On]. Refer to "12.2 Configuring the Display Settings" (p.270). Viewing Waveforms Divided Into Blocks

# 8 Advanced Functions

Adding comments (p. 160)

Converting input values (scaling) (p. 171)

Freely setting the waveform display (p. 178)

Fine-adjusting input values (p. 181)

Inverting waveforms (p. 182)

Copying a setting to another channel (p. 183)

#### Advanced measurement and settings

- Displaying waveforms during the recording (p. 167)
- Overlay waveforms with the waveforms recorded before (p. 168)

#### Detailed module settings (p. 184)

- Setting the anti-aliasing filter
- Setting thermocouple types
- Setting the reference point compensation
- Setting the wire break detection
- Setting the data update
- Executing the auto-balance
- Setting the voltage dividing ratio of the probe
- Setting the response time
- Setting the measurement mode

# 8.1 Adding Comments

### 8.1.1 Adding, Displaying, and Printing the Title Comment

Entering a title comment enables itself to be displayed at the top of the waveform screen and to be printed on the recording paper. (Available number of characters: up to 40) Refer to "6.6.2 Printing Reports (A4-Sized Print)" (p. 136).

#### Procedure

#### To display the screen

Press the CHAN key to display the channel screen, and then select the [Comment] sheet.

<mark>нюкі</mark> – Unit Li	ist / Ea	ach Ch	Scalin	8	Comment	CHAN (Push)	
+[Title]—							Analog
<b>1</b> Title <b>2</b> Title	Print Comment	5	Getting				Logic Logic6
[Each Channel]							
Each Ch Print	Input Uni	tCh C	Comment				
	ANAL OC	1					
	ANALUU	2					
	темп	3					
	ICI'IP'	4					

#### **1** Set the print content of the title.

Move the cursor to the [Title Print] box.

OFF	Does not print any setting conditions or title comment.
Setting	Prints the setting conditions of the instrument.
Comment	Prints the title.
Set& Comment	Prints both the setting conditions and title.

#### **2** Enter the title comment.

Move the cursor to the **[Title Comment]** box.

Enter Char	Enables you to enter the comment. Refer to "Entering texts" (p. 163).
Clear	Clears the entered comment.
Undo	Returns to the state before the most recent change.

#### To select the comment from the previously registered terms

Pressing the **WAVE** key after activating the text input displays the list of previously registered terms.

It is also possible to select a comment from previously entered titles (history list). Refer to "Entering texts from the term list or history list" (p. 165).

## 8.1.2 Adding, Displaying, and Printing the Channel Comments

Entering comments with respect to each channel enables you to confirm the comments of each channel on the screen. The comments can also be printed on the recording paper. (Available number of characters: up to 40)

#### To copy the comment to another channel

You can copy the comment on the **[Comment]** sheet. Refer to "8.9 Copying Settings to Other Channels (Copy Function)" (p. 183).

#### Procedure

#### To display the screen

Press the CHAN key to display the channel screen, and then select the [Comment] sheet.

[Each Channel]				
Each Ch Print	Input Uni	tCh	2 Comment	
	ANAL OG	1		
	TIMIEOG	2		
	темо	3		
		4		
	DC ZDMS	5		
	DUZKINO	6		
1	ANALOC	7		
Catting	ANALUG	8		
Jerting		9		
	ANALUG	10		
		11	Enter on LogicPage	

**1** Select contents to be printed for each analog channel.

Move the cursor to the box in the **[Each Ch Print]** column for each channel.

OFF	Does not print any setting items and channel comments.
Setting	Prints the settings for each channel. (Not displayed on the screen)
Comment	Prints the comments of each channel.
Set& Comment	Prints both the settings and comments of each channel.

# 2 Enter comments for each analog channel.

Move the cursor to the **[Comment]** column.

Enter Char	Enables you to enter the comment. Refer to "Entering texts" (p. 163).
Clear	Clears the entered comment.
Undo	Returns to the state before the most recent change.

To select the comment from the previously registered terms

Pressing the **WAVE** key after activating the text input displays the list of previously registered terms.

It is also possible to select words from the previously entered analog channel comments (history list).

Refer to "Entering texts from the term list or history list" (p. 165).

<mark>нюкі</mark> Unit L	ist / I	Each Ch	Scal	ing 🦯	Comment		AN (Push)		16-May 15:54:41
								Analog	Function:
[Self Logic]								Logic	MEMUKI
								VTRIG.	
Each Ch Print	Input Un	i tPr 4	Comment					Logic6	3
3		1				].			
Off	LA	2							<b>_</b>
		3							Analog/Logic
		4				·			1
		2				·			Analog/Ingin
Off	LB	3							
		4							
		1							j

**5** Select the print content for each logic channel.

Select **[Analog/Logic]** to display the logic channel page.

Off	Does not print any comments.
Comment	Prints comments.

Move the cursor to [Each Ch Print].

**6** Enter the comment for each logic channel.

Move the cursor to the **[Comment]** column.

Enter Char	Enables you to enter the comment. Refer to "Entering texts" (p. 163).
Clear	Clears the entered comment.
Undo	Returns to the state before the most recent change.

#### To select from the previously registered terms

Pressing the **WAVE** key after activating text input displays the list of the previously registered terms.

It is also possible to select words from the previously entered logic channels (History List). Refer to "Entering texts from the term list or history list" (p. 165).

### 8.1.3 Entering Alphanumeric Characters

Move the cursor to the setting item for which you wish to enter text and choose the content with the F key.

**Entering texts** 

Move the cursor to the comment field and select [Enter Char].

The virtual keyboard is displayed.



2 Select characters by pressing CURSOR keys on the virtual keyboard, and select [Enter Char] to enter the comments.



RESET	Deletes all of the entered characters. (Move the cursor to <b>RESET</b> , and press [Enter Char].)
SPACE	Inserts a space. (Move the cursor to <b>SPACE</b> , and press [Enter Char].)
OVWR/INS	Switches between overwrite mode (OVWR) and insert mode (INS). (Move the cursor to <b>[OVWR/INS]</b> , and press <b>[Enter Char]</b> to switch between OVWR and INS.)
<<	Moves the character input position to the left.
>>	Moves the character input position to the right.

Press the **CH.SET** key or **TRIG.SET** key to change the input mode.

#### **3** Select [Confirm] to confirm the entry.

The virtual keyboard is closed. Press the **ESC** key to suspend the entering. (Pressing the ESC key again closes the virtual keyboard.)

#### To enter units and symbols

Some characters are saved using alternative characters.

(When saved as numerical calculation results or in text format) "<sup>2</sup>" is saved as "^2"; "<sup>3</sup>," as "^3"; " $\mu$ ," as "<sup>c</sup>u"; " $\Omega$ ," as "<sup>c</sup>o"; " $\epsilon$ ," as "~e"; "°," as "<sup>c</sup>c"; and "±," as "<sup>+</sup>+."

Characters not allowed to be used in file names cannot be entered.

#### Entering texts from the term list or history list

While the virtual keyboard is being displayed, pressing the **WAVE** key displays the term list, and pressing the **AB CSR** key displays the history list.

They are available to enter the previously registered terms or the previously entered terms.

#### Move the cursor to the comment box and select [Enter Char].

The virtual keyboard is displayed.



**2** Press the WAVE key to select from the previously registered terms. The list of the previously registered terms is displayed.



Press the AB CSR key to select from the previously entered terms.

The history list is displayed.



Press the **ESC** key to suspend the entry from the list.

**3** Press the up and down CURSOR keys or rotate the jog dial to select a term from the list, and select [Enter Char].

#### **4** Select [Confirm] to confirm the entry.

The virtual keyboard is closed. Select **[Go back]** to undo the changes after you have confirmed the text.

#### Entering numerals by increasing and decreasing them

**1** Move the cursor to the numeric input box and select [Up-Down]. The virtual keyboard for digit input is displayed.



#### **2** Enter numerals using the virtual keyboard.

(Press F1 and F2 to move the digit. Press F3 and F4 to increase and decrease the value, respectively.)



**3** Select [Confirm] to confirm the entry. Press the ESC key to suspend the entering.

#### Entering numerals with the numerical keypad

Move the cursor to the numeric input box and select [Tenkey entry].

The virtual numerical keypad is displayed.



2 Enter numerals using the virtual numerical keypad.

<b>7</b>	8	9	E	$ \mu $
4	5	6		m
1	2	З	—	k
Q	9	•	+	М
ESC	BS	С	En	ter
MA	X 1	E+0	10	

ESC: Cancels the input.BS: Deletes a character.C: Deletes all characters.Enter: Confirms the entry

**3** Select [Confirm] to confirm the entry. Press the ESC key to suspend the entering.

# 8.2 Displaying Waveforms During the Writing in the Memory Simultaneously (Roll Mode)

This function can be used in the memory function only.

You can display and print the waveforms at the same time as the data is acquired (with the auto-print set to on). (p. 127)

- If the instrument measures signals at low sampling rate using the memory function, it takes a long time to write the entire recording length of data in the memory. Measurement in roll mode is useful in such cases.
- The waveforms scroll automatically.

#### Procedure

#### To display the screen

Press the **STATUS** key to display the status screen, and then select the **[Status]** sheet.

#### Move the cursor to the [Roll Mode] box.

OFF	Writes the data normally in the memory. After writing the specified recording length of data in the memory, displays the waveforms.	+Cha Use + CU
On	Displays the waveforms while writing the data in the memory (with the setting of 10 ms or slower). However, when the timebase is set to 5 ms/div or faster, the instrument displays the waveforms after the writing in the memory.	
Auto	Displays the waveforms in the specified magnification ratio during the writing in the memory regardless of the timebase setting. (Default setting) However, when the waveforms are displayed using a time axis faster than 100 ms per division, or when the timebase is set to 5 $\mu$ s/div, the instrument displays the waveforms after the writing in the memory.	

Channels to use	
Used Ch	Ch 1-16
+【Utility functions】———	
Roll Mode	Auto
Uverlay	Uff
【Waveform Judge Setting】——	
Warnetann Tudea	0.f.f

#### When the roll mode function is set to [On]

- The roll mode function and the overlay function cannot be used simultaneously.
- When the roll mode function is enabled, the overlay function is automatically set to **[Off]**. Besides when the overlay function is enabled, roll mode is set to **[Auto]**. (p. 168)
- The roll mode, memory division, and waveform calculation functions cannot be used simultaneously.

Roll mode function	Memory division function	Waveform calculation function
On	Off	Off
Off	On	Off
Off	Off	On

Note: When any one of the functions is set to [On], the other functions are automatically set to [Off].

• When the auto-print (p. 127) is enabled, the printing is available while the waveforms are being displayed simultaneously. However, for X-Y composite curves, all data must be written in the memory before the printing.

In addition, while evaluating data by calculating the numerical values, the instrument automatically prints the waveforms based on the evaluation conditions on completion of the numerical calculation.

#### When the roll mode function is set to [Off]

Since the instrument displays the waveforms after storing the entire recording length of the data, it takes a long time after starting measurement until displaying the waveforms with a relatively slower sampling.

### 8.3 Overlaying New Waveforms With Past Waveforms

This function can be used in the memory function only.

The instrument overlays the new waveforms with the presently displayed waveforms.

- You can compare the new waveforms with those recorded before. (Available with the trigger mode set to [Repeat] or [Auto]) (p. 213)
- There are two overlaying methods: the automatic overlaying during measurement and the manual overlaying.



Waveforms plotted using the overlay function



#### Procedure

#### To display the screen

Press the STATUS key to display the status screen, and then select the [Status] sheet.

#### Move the cursor to the [Overlay] box.

Off	Does not overlay the waveforms. (Default setting)
Auto	Overlays the waveforms newly written in the memory with the presently displayed waveforms every time the new ones are written in the memory. When the trigger mode is set to [Cont.] or [Auto], the instrument overlays the new waveforms with the presently displayed waveforms from the start of the measurement to the stop.
Manual	Overlays the new waveforms with the presently displayed waveforms manually. (See the next section for the method of the overlaying.)

-Channels to use Used Ch	Ch 1-16
LUtility functions]	
Roll Mode	Auto
Roll Mode Overlay	Auto Off
Roll Mode Overlay CWaveform Judge Setting]	Auto Off

(M E M)

This mode cannot be used simultaneously with roll mode. Refer to "When the overlay function is enabled (set to [Auto] or [Manual])" (p. 169).

#### Overlaying the waveforms manually (Leaving any waveforms to be displayed on the screen)

#### To display the screen

Press the **DISP** key to display the waveform screen.

#### Move the cursor to the [Overlay] box.

Overlay (F1 key)	Leaves the waveforms written in the memory on the screen. The overlay setting continues to be available until the waveforms are cleared.	Shi [
Clear ( <b>F5</b> key)	Clears all the overlaid waveforms that are displayed on the screen. Cleared waveforms cannot be displayed again.	



#### When the overlay function is enabled (set to [Auto] or [Manual])

- The roll mode function (p. 167) and overlay function (p. 168) cannot be used together. When the roll mode function is enabled, the overlay is automatically set to [Off].
   Besides, when the overlay function is enabled, roll mode is set to [Auto].
- The printing and tracing with Cursors A and B apply only to the last acquired waveforms.
- The following operations are not available on the waveform screen:

Scrolling waveforms, switching zoom function between on and off, changing horizontal (in the time axis direction) magnification/demagnification ratio, changing the zero position.

- In the following cases, the instrument leaves only the most recent waveform and clears the others.
  - When the [Format] setting is changed on the [Status] sheet
  - When the [Combo Area] setting is changed (with the [Format] set to [X-Y Single] or [X-Y Quad])
  - When the waveform display settings (display magnification, zero position, variable, display on/off, waveform color) are changed on the [Unit List] or [Each Ch] sheets

### 8.4 Setting Channels to Be Used (Extending the Recording Length)

```
MEM
```

This function can be used in the memory function only.

Select the analog and logic channels to use.

The fewer the number of the channels in use is, the longer the recording length becomes.

Minimizing the number of channels to be used allows the storage memory to be allocated to the channels.

#### Procedure

To display the screen

Press the STATUS key to display the status screen, and then select the [Status] sheet.

Move the cursor to the [Used Ch], and select the number of channels to be used.

Ch1-2, Ch1-4, Ch1-8, Ch1-16 (Default setting)

If using If using Model U8975, U8977, or U8978, this setting will not be available (the setting is fixed to Ch1-32).

Channels to use	
Used Ch	Ch 1-16
+【Utility functions】	
Roll Mode	Auto
Overlay	Off
- 【Waveform Judge Setting】——	
	0.44

Data obtained through the standard logic channels LA to LD are written in the memory using 4 bits of the analog channels CH1 to CH4.

### Available channels

When the **[Used Ch]** setting is used, the available analog channels, standard logic channels, and the logic channels of Model 8973 Logic Unit are as follows:

Used channel	Analog	Standard logic	8973 Logic Unit * <sup>1</sup>
Ch1-2	CH1, CH2	LA, LB	L1
Ch1-4	CH1 through CH4	LA through LD	L1, L2
Ch1-8	CH1 through CH8	LA through LD	L1 through L4
Ch1-16	CH1 through CH16	LA through LD	L1 through L8
Ch1-36*2	CH1 through CH32	LA through LD	L1 through L8

\*1: Up to three logic modules can be installed in the instrument.

\*2: If using Model U8975, U8977, or U8978

#### Precautions for using Model MR8791 Pulse Generator Unit

- · Changing the used channel settings causes the pattern data to be erased.
- If the channels to be used are Ch1-16 or Ch1-32, you can select pattern output.

# 8.5 Converting Input Values (Scaling Function)

#### About the scaling function

The scaling function enables you to convert the measured voltage output from measurement devices such as sensors to physical quantities of measurement targets.

Hereafter, "scale" refers to converting numerical values using the scaling function.

Gauge scales, scaled values (upper and lower limits of the vertical axis [voltage axis]), and measured values at Cursors A and B are expressed as scaled values in terms of the specified units. You can set the scaling with respect to each channel.



#### Scaling setting examples

Refer to "When using a clamp sensor" (p. 174) (Example: Scaling from [V] to [A]) and "When using Model 8969 or U8969 Strain Unit" (p. 175) (Example: Scaling from  $[\mu\epsilon]$ ) to [G]).

#### **Scaling Methods**

Two scaling methods are available:

- Conversion ratio method
- Two-point method

#### Setting the scaling that uses the conversion ratio method

Set the physical quantity per volt (conversion ratio: change in terms of engineering units [eu] per change in terms of volts) of the input signal, the offset value, and the measurement unit name. The instrument converts measured values acquired in terms of volts into those in terms of the specified one employing the settings. Example:

Conversion ratio: Change in terms of amperes per change in terms of volts, Offset value: B Unit name: Ampere (A)

#### Setting the scaling that uses the two-point method

Set two points of the input signal in terms of volts, those after conversion, the name of the converted measurement unit. The instrument converts measured values acquired in terms of volts into those in terms of the specified one employing the settings. Example:

Two points of values in terms of volts	Values to be converted in terms of the specified one		
$V_{H}$ : Higher potential point	A <sub>H</sub> : Value for higher potential point		
$V_L$ : Lower potential point	A <sub>L</sub> : Value for lower potential point		



#### (Example: Scaling from [V] to [A])

Converts values using slope (conversion ratio) and offset value



Converts values using conversion ratio and offset value, both of which are calculated using two points.



converted unit

When the conversion ratio setting is changed,  $V_L$  and  $V_H$  set as two points used for conversion do not change, whereas the values for  $A_L$  and  $A_H$  change.

#### Procedure

#### To display the screen

Press the CHAN key to display the channel screen, and then select the [Each Ch] sheet.



**1** Enable the scaling function. Move the cursor to the [Set] box.

**2** Select the scaling method.

Off	Does not scale any values.		
NUM	Displays values in decimal notation adding the metric prefix such as milli (m) and kilo (k).		
SCI	Displays values in scientific notation (as a power of 10).		
Ratio	Converts values using the conversion ratio method.		
Point	Scales values using the two-point method.		

**3** Specify the unit of measurement.

Move the cursor to the [Method] box.

Move the cursor to the **[Unit]** box and enter the unit name. (Up to 7 characters) Refer to "Entering texts" (p. 163).

4 Enter the numerical values for conversion.

#### For the [Ratio] setting

(Set the conversion ratio and offset.)

Move the cursor to the **[Ratio]** and **[Offset]** boxes in turn.

#### For the [Point] box

(Enter two input values and those after conversion.)

Move the cursor to the [Input P1], [Scale P1], [Input P2], and [Scale P2] boxes in turn.

Input example: Decimal 1.2345 mV Exponent 1.2345E-03 V

Enter numerical values in each field.

-9.9999E+9 to 9.9999E+9

Refer to "Entering Alphanumeric Characters" (p. 163).

Enter numerical values in each field.

-9.9999E+9 to 9.9999E+9

Refer to "Entering Alphanumeric Characters" (p. 163).

• When data is saved in text format or as numerical calculation results, some characters and symbols are saved using alternative characters.

• "<sup>2</sup>" is saved as "^2"; "<sup>3</sup>," as "^3"; "μ ," as "<sup>°</sup>u"; "Ω," as "<sup>°</sup>o"; "ε," as "<sup>°</sup>e"; "°," as "<sup>°</sup>c"; and "±," as "<sup>°</sup>+."
To enter the current input values in the [Input P1] and [Input P2] boxes with no change. Select [Monitor Val].

#### To reset the scaling settings

Move the cursor to the [Set] box and select [Reset].

#### To copy the scaling setting to another channel

Display the channel screen, and select the **[Scaling]** sheet. Refer to "8.9 Copying Settings to Other Channels (Copy Function)" (p. 183).

#### To use a combination of the scaling and variable functions (p. 178)

The signal output from the sensor is displayed as a vertically maximized waveform. (p. 180)

By factory default, the automatic correction of the variable function (p. 337) has been set to **[On]**. In this setting, the variable setting changes along with the vertical axis (voltage axis) range and scaling settings.

When you prefer to prioritize the variable function setting, follow either of the following procedures:

Set the scaling first, and then set the variable function

• Set the variable using values to which the scaling has not been applied, then set the scaling.

Setting the automatic correction of the variable function to **[Off]** disables the interaction between the scaling and variable settings.

# 8.5.1 Example of Scaling Settings

#### When using the clamp sensor

#### Example 1

# To display values measured with Model 9018-50 Clamp On Probe using the 10 A range in terms of amperes (A)

The 9018-50 Clamp On Probe provides 0.2 V output when measuring a current of 10 A. The scaling should be set to display 0.2 V input as 10 A and 0 V input as 0 A.

–【Scaling】 Set	NUM	Clamp	Clamp
Method Ratio	Ratio 1.0000	Model Clamp Range	9000~ 9018-50 10A

Set	NUM or SCI		
Clamp	9018-50		
Unit*	Ampere (A)		
Method*	Ratio		
Ratio*	50.000		

\*: Set automatically when a clamp sensor is selected.

#### To select the clamp sensor

- 1. Move the cursor to the **[Clamp]** box and select **[Select]**. The cursor moves to the **[Model]** box.
- Select [9000~]. The cursor moves to the [Clamp] box.
- 3. Select [9018-50] from the clamp list by pressing the F keys, and select [Confirm]. The unit of measurement, scaling method, and conversion ratio will be set automatically.
- 4. Select the same range as that of the clamp sensor when using the range selection type of clamp sensors. Select [10A] here.

Set the vertical axis (voltage axis) range according to the output of Model 9018-50. For example, to display a voltage of 0.2 V at the full-scale value (maximum displayable value), set the vertical axis (voltage axis) range to 20 mV/div (a division of the vertical axis [voltage axis] corresponds to 20 mV).



Scaling the signals from the sensor enables them to be displayed as current values.

Values at the Cursors A and B and gauges are displayed and printed as current values.

Refer to "Gauge" (p. 134) and "Value at Cursors A and B" (p. 127).

#### When using Model 8969 or U8969 Strain Unit

#### Example 2

#### To display data measured with the strain gauge transducer with a rated capacity of 20 G and a rated output of 1000 µV/V in terms of gees (G).

For the rated capacity and rated output, consult the inspection record of the strain gauge transducer to be used. Set the rated capacity and rated output so that the following expression holds:



Set the parameters such that the rated capacity divided by two times the rated output is less than or equal to  $9.9999 \times 10^{9}$ .

Refer to Gauge (p. 134) and Values at Cursors A and B (p. 127).

# When the strain gauge transducer's inspection record provides the calibration factor

Set [Method] on the [Scaling] sheet to [Ratio].

#### Example 3

To display the data measured with the strain gauge transducer with a calibration factor of 0.001442 G /  $1 \times 10^{-6}$  strain\* in terms of gees (G).

Set the conversion ratio to the value of the calibration factor (0.001442 [G]). (\*10<sup>-6</sup> strain =  $\mu\epsilon$ )

Move the cursor to the appropriate channel and set the settings as follows.

Set	NUM
Unit	G
Ratio (Conversion ratio)	0.001442 [G] (Displayed as "1.4420m")

Met	thod	Ratio		
Ch	Set	Ratio	Offset	Unit
1	Off	1.0000	0.0000	V
2	Off	1.0000	0.0000	V
3	Off	1.0000	0.0000	V
4	Off	1.0000	0.0000	V
5	Off	1.0000	0.0000	°C
6	Off	1.0000	0.0000	°C
7	Off	1.0000	0.0000	V
8	Off	1.0000	0.0000	V
9	NUM	1.4420m	0.0000	G
10	Off	1.0000	0.0000	G
11	Off	1.0000	0.0000	Hz
12	Off	1.0000	0.0000	Hz

#### Using the strain gauge with a gauge rate of other than 2.0

The Model 8969 or U8969 Strain Unit measures outputs of the gauge supposing that the gauge rate is 2.0.

When using a strain gauge with a gauge rate of other than 2.0, the gauge rate needs to be set as the conversion ratio.



The gauge ratio is fixed.

For example, if the gauge rate is 2.1, the conversion ratio is 0.952 ( $\Rightarrow$  2/2.1).

#### Example 4

# To display data measured with the strain gauge (gauge rate: 2.1), in terms of gees (G).

The scaling using both the gauge rate and the ratio that converts outputs into the physical values are required. In this case, set the conversion ratio to the product of the conversion ratios of the gauge rate and the scaling ratio.

Where the conversion ratio of the gauge rate is 0.952, and the conversion ratio to convert outputs into the physical values is 0.001442 \* Conversion ratio = 0.952 × 0.001442 = 0.0013728

As with Example 3, enter [0.0013728] as the conversion ratio.

\* To convert values measured with the strain gauge into physical values, calculate using Young's modulus or Poisson's ratio of the measurement object. The conversion method varies depending on the conditions in which the strain gauge is used. Refer to "Appx. 2.2 Files Size of Setting and Image Files" (p. Appx.5).

#### Using the decibel values

Example 5 To convert 40 dB of input into 60 dB

- **1** For scaling values, set [Method] to [Ratio].
- **2** Move the cursor to the conversion rate setting. Select [dB Scaling] in the function keys.

Met	hod	Ratio	] 1			MEMURY
Ch	Set	Ratio	Offset	Unit		
1	NUM	1.0000	2 0.0000	V		
2	Off	1.0000	0.0000	V		
3	Off	1.0000	0.0000	V		
4	Off	1.0000	0.0000	V		
5	Off	1.0000	0.0000	°C		
6	Off	1.0000	0.0000	°C		
7	Off	1.0000	0.0000	A		
8	Off	1.0000	0.0000	A		
9	Off	1.0000	0.0000	Hz		
10	Off	1.0000	0.0000	Hz		
11	Off	1.0000	0.0000	G	2	1.0 (1.0)
12	Off	1.0000	0.0000	G		40 60
						dB Scaling
						110
15	Off	1.0000	0.0000	V		<b>₹</b> 1.0
16	Off	1.0000	0.0000	V		Up-Down
						718191 41 11 1.0
						Tenkey ent

**3** Enter 40 dB in the entry field and 60 dB in the physical quantity field.

#### **4** After entering the values, select [Confirm].

Refer to "8.1.3 Entering Alphanumeric Characters" (p. 163).

Me +	hod	Ratio						MEM
мет	nou	Natio						
Ch	Set	Ratio	Offset			Unit		
1	NUM	1.0000	0.0000			V		
2	Off	Norify				V		
3	Off	Inp	out			V		
4	Off		1.0000 V	10.000 V		V		
5	Off	dB value inc	ut			°C		
6	Off					°C		
7	Off		40.000 dB	60.000 dB		A		
8	Off				_	A		
9	Off	1.0000	0.0000			Hz		
10	Off	1.0000	0.0000			Hz		
11	Off	1.0000	0.0000			G		
12	Uff	1.0000	0.0000			li		
45	0.4.4	1 0000	0.0000					
15	UTT	1.0000	0.0000			<u> </u>		He D
10	UTT	1.0000	0.0000			V		Up-Di
								Teuler
								Tenke
		Set the desir	ed physical va	lue in dB.				
Hin	t l	Conversion ra	te of the scal	ing function ça	n be se	t by us	ing the input	Cant
		value(dB) and	the desired p	hysical value(d	B).			Lonti

The conversion rate corresponding to the entered decibel values is entered. (The offset becomes zero.)

Metho	d	Ratio			
t Ratio Offset	Ratio Offset	Offset		Unit	
JM 10.000 0.00	10.000 0.00	0.00	00	V	
ff 1.0000 0.0000	1.0000 0.0000	0.0000		V	
A 0000 0 0000	4 0000 0 0000	A AAAA			

# 8.6 Setting the Waveform Position (Variable Function)

You can freely set the waveform height and display position along the vertical axis (voltage axis).

#### Precautions when using the variable function

- Verify that the proper vertical axis (voltage axis) range is set for the input signal.
- Even when the upper and lower limits of the variable setting are changed, the vertical axis (voltage axis) range does not change.

The following two setting methods are available:

#### • Set the displaying range per division (one-division setting)

Set the displaying range per the vertical division and the zero position of the waveform on the vertical axis (voltage axis).



#### · Set the upper and lower limits (upper-lower setting)

Set the upper and lower limits on the vertical axis (voltage axis) to display the vertically maximized waveform.



The two variable methods are available: the **[Each Ch]** sheet accessible from the channel screen allows you to configure settings with respect to each channel (p. 179), and the display range window, which displays the waveforms obtained through all of the channels, allows you to configure a common setting for all channels. (p. 180).

#### Setting the variable function with respect to each channel

#### Procedure

#### To display the screen

Press the CHAN key to display the channel screen, and then select the [Each Ch] sheet.

#### **1** Enable the variable function.

Move the cursor to the [Variable] box, and select [On].

#### **2** Set the display range per division

Move the cursor to the **[Range(/div)]** box, and enter a numerical value.

(The unit of measurement varies depending on the measurement mode of the module.)

(When you change the value, the upper and lower limit values for the display also change accordingly.)

# **3** Set the waveform displaying position in the vertical axis (vertical axis) direction by entering the zero position.

Move the cursor to the **[Zero pos %]** box, and enter the numerical value in terms of **[%]**.

(When you change the value, the upper and lower limit values for the display also change accordingly.)

# 4 (When setting the variable by entering upper and lower values)

Move the cursor to the **[Upper]** and **[Lower]** boxes in turn, and enter the values.

(When you change these values, the display range and zero position values also change accordingly.)

- Setting the variable using upper and lower values allows waveforms to be displayed as a vertically maximized waveform.
- Depending on the scaling setting, the displayed upper and lower values may be less than one. In such cases, set [Variable] to [On] and then select [Auto Set].

The upper and lower limit values are set so that the waveforms are displayed in such a way that they are directly readable based on the presently set values.

- For information on the numeric input method, refer to "8.1.3 Entering Alphanumeric Characters" (p. 163).
- The [Unit List] sheet accessible from the channel screen also allows you to switch the variable function between on and off with respect to each channel.
- Using a combination of the scaling and variable functions enables a sensor's output to be displayed as a vertically maximized waveform. (p. 180)
- When the scaling is enabled, the scaled values are displayed. When these settings are changed, the numerical values indicating the display range of the level monitor change accordingly.

Wave_Disp		Gra
<b>1</b> Variable	On	Zoc
2Range(/div)	2.5000	Uрр
<b>3</b> Zero pos %	50.000	Low
_【Scaling】_		
Disp	NUM	Cla
Method	Ratio	Uni



#### To reset the settings

Select [Reset] to reset the values to default.

# Setting the variable function while the waveforms obtained through all of the channels are being displayed

#### Procedure

1

#### To display the screen

Press the **DISP** key to display the waveform screen, and then press the **CH.SET** key to display the display range window.

- Enable the variable function. Move the cursor to the [Variable] box, and select [On].
- **2** Set the upper and lower limits.

Move the cursor to the **[Upper]** and **[Lower]** boxes in order, and enter numerical values.

# ChVariable Lower Upper 1 On -50.000m 50.000m 2 -50m 50m 3 -50m 50m 4 -50m 50m 5 -50m 50m

#### When using a combination of the scaling and variable functions

#### When the auto-correction of the variable function (p. 337) is set to on (Default setting)

The variable function setting changes according to the scaling and vertical axis (voltage axis) range settings. Set the scaling function, and then set the variable function.

If you change the scaling setting after enabling the variable function, the displayed size of waveforms does not change because the variable setting is automatically corrected.

#### When the auto-correction of the variable function is set to off

Set the scaling function, and then set the variable function. If you want to set the variable function first, enter the values that are scaled (converted physical values).

#### To display the waveform output from the sensor as vertically maximized waveforms

Using the variable function in combination with the scaling function enables the voltage output from the sensor to be converted into the physical units of the measurement object.

Example:
Set the scaling as follows:
Scaling: Decimal or exponent, Two-point setting
Units: A
A sensor output voltage of 1.23 V (Input 1) is converted into a current of 0 A
(Physical quantity 1).
A sensor output voltage of 1.23 V (Input 2) is converted into a current of 0 A
(Physical quantity 1).

(With the variable function set to off) The output voltage from the sensor is displayed as the value in terms of volts.

It is displayed with the vertical axis (voltage axis) range setting and the zero position set on the channel settings window ([Analog] sheet).

Set the variable function as follows: Variable: On, Upper/lower limits setting Lower limit: 0 [A], upper limit: 10 [A] The output from the sensor is displayed as a vertically maximized waveform.



# 8.7 Fine-Adjusting Input Values (Vernier Function)

You can fine-adjust the input voltage freely on the waveform screen. When recording physical values such as noise, temperature, and acceleration with sensors, you can adjust those amplitudes, facilitating calibration.



#### Procedure

#### To display the screen

Press the **DISP** key to display the waveform screen, and then press the **CH.SET** key to display the analog channel settings window.

**1** Move the cursor to the vernier setting column [\*] of the channel to be adjusted.

Variable Logic tionL 1 5mV  $\times 1$ 50% 2 📕 ٠ 5mV ×1 50% 3 -5mV ×1 50% 5mV ×1 50% 4 -

2	Make the adjustment with the F keys while watching the
	waveform.

Vernier↑	Magnifies the waveform.		
Vernier↓	Demagnifies the waveform.		
Vernier Reset	Returns the waveform to the original position.		

- The adjustable range is from 50% to 200% of the original waveform. The magnification and demagnification ratios are not displayed.
- You cannot check if the vernier function has adjusted waveforms by observing printed waveforms or lists.
- The waveform data (printed data, saved data as files) is adjusted by the vernier function.

# 8.8 Inverting the Waveform (Invert Function)

This function can be used for analog channels only. You can turn over the waveforms upside down by inverting signs.

Example:

- When a current sensor is clamped around a wire with its current direction mark mistakenly in the direction opposite to the current flow
- When a signal is inputted with spring-pulling force negative and spring-compressing force positive; however, you would like to display the results with spring-pulling force positive and spring-compressing force negative

#### Procedure

#### To display the screen

Press the **DISP** key to display the waveform screen, and then press the **CH.SET** key to display the analog channel settings window.

**1** Move the cursor to the [Mag] column of the channel to be inverted.

**2** Select [Invert].

Analog Variable Logic Gener							
ele - I	Devete	14-14	•	Destates	LDE		
LUNCO	Kange	Mag	Ŧ	Position	LPF		
1	5mV	v1	٠	50%	-		
2 🔲	5mV	×-1	ŀ	50%	-		
3 -	20V	×1	•	50%	-		
4 -	5V	×1	٠	50%	-		

The waveform data (printed data, saved data as files) is inverted by the invert function.

# 8.9 Copying Settings to Other Channels (Copy Function)

You can copy a setting to other channels and calculation numbers (when using the FFT function) on the following screens:

- · Channel settings window
- · Display range window
- Trigger settings window
- Status screen > [Status] sheet > "Analysis" list and "Scale" list (When using the FFT function only)
- Status screen > [Num Calc] sheet
- Status screen > [Wave Calc] sheet
- Channel screen > [Unit List] sheet
- Channel screen > [Scaling] sheet
- Channel screen > [Comment] sheet

The procedure below explains how to copy settings on the channel settings window.

#### Procedure

#### To display the screen

Press the **DISP** key to display the waveform screen, and then press the **CH.SET** key to display the channel settings window.

- 1 Move the cursor to the channel number (calculation No.) of the copy source.
- 2 Select [Copy].
- 3 Move the cursor to the channel number (calculation number) to which the settings are pasted.

**4** Select [Paste].

To copy the settings to all channels (calculations), move the cursor to a channel number (calculation number) other than the copy source and select [All Paste].

To copy all the settings including the unit list, scaling, and variable, select [All setting Paste] or [All setting All paste].

$\sim$	Ar	nalog	Varial	ble	= \	Log	ic	25-No	/ 14:52:21
				_		_			MEMORY
								Trig	ger:
Ch	Coll	Range	Mag	\$	Posit	ion	LPF		Repeat
1		5mV	×1	٠		50%	-	Ð	0%
2		5mV	×1	٠		50%	-	Time	base:
3		5mV	×1	٠		50%	-		5µs/div
4		5mV	×1	٠		50%	-	(	50ns/S)
5		5mV	×1	٠		50%	-		×1
6		5mV	×1	٠		50%	-	(	5.00µs)
-7		5mV	×1	٠		50%	-		
8		5mV	×1	٠		50%	-	Shot	:
									25div
								(	125µs)
11		200mV	×1	٠		50%	-		
12		200mV	×1	٠		50%	-		E F
13		200mV	×1	٠		50%	-		
14		200mV	×1	٠		50%	-	Сору	/
15		200mV	×1	٠		50%	-		F2 F2
16		200mV	×1	٠		50%	-		
								Past	е
								ALL	paste
									re_ F4
			Ze	ro	-Adiu	st		ALL-	setting
					-,-	-		Past	e
				_					<b>P</b>
		E 110 E.	E 112		_			ALL	setting
1	20	5MV1 71 0mV1151	5mVI) 200mVI1	81 61	<u>50</u> 200	NV NV		ALL	paste ,

When channel settings are copied to different model modules, settings other than the scaling cannot be copied.

# 8.10 Setting Details of Modules

You can configure detailed settings with respect to each module on the **[Each Ch]** sheet of the channel screen.



#### How to display the [Each Ch] sheet and select channels

#### Logic channel allocation when using the standard LOGIC terminals

	Madula	Memory for each channel (16 bits)					
	wodule	4 bits	4 bits	4 bits	4 bits		
CH1*	Apolog		Analog CH1		LA		
CH2*	Analog		LB				
CH3*	Logio	L2A	L2B		LC		
CH4*	Logic	L2C	L2D	_	LD		
CH5	Analog	Analog CH5					
CH6	Analog	Analog CH6					
CH7	Logio	L4A	L4B				
CH8	Logic	L4C	L4D	-	_		
CH9	Apolog	Analog CH9					
CH10	Analog		Analog CH10				
CH11	Angles	Analog CH11					
CH12	Analog		Analog	g CH12			
CH13	Apolog		Analog	g CH13			
CH14	Analog	Analog CH14					
CH15	Analog		Analog	g CH15			
CH16	Analog		Analog	g CH16			

\* When the logic channels LA through LD are allocated to CH1 through CH4, they provide 12-bit precision.

When Model 8970 Freq Unit is allocated to CH1 through CH4, using the standard logic channels LA through LD prohibits the modules of corresponding channels from being used. When Model MR8990 Digital Voltmeter Unit, U8793 Arbitrary Waveform Generator Unit, MR8790 Waveform Generator Unit, or MR8791 Pulse Generator Unit is allocated to CH1 through CH4, the corresponding standard logic channels described in the above table cannot be used.

#### If using Model U8975, U8977, or U897

	Linit		Memory for each	each channel (16 bits)			
	Unit	4 bits	4 bits	4 bits	4 bits		
CH1*			Analog CH1 LA				
CH2*	40H analog* <sup>1</sup>	Analog CH2 LB					
CH17			Analog CH17				
CH18			Analog	g CH18			
CH3*		L2A	L2B		LC		
CH4*	Logic	L2C	L2D	-	LD		
CH19	LOGIC			-			
CH20				-			
CH5			Analo	g CH5			
CH6	Analog		Analo	g CH6			
CH21	Analog	-					
CH22			-				
CH7		L4A	L4B				
CH8	Logic	L4C	L4D		-		
CH23		-					
CH24		-					
CH9		Analog CH9					
CH10	Angler	Analog CH10					
CH25	Analog	-					
CH26		-					
CH11		Analog CH11					
CH12	20H opolog* <sup>2</sup>		Analog	g CH12			
CH27	SCITATIAIOg	Analog CH27					
CH28		-					
CH13			Analog	g CH13			
CH14	4CH opolog* <sup>1</sup>		Analog	g CH14			
CH29			Analog	g CH29			
CH30			Analog	g CH30			
CH15			Analog	g CH15			
CH16	Analog		Analog	g CH16			
CH31	Analog			-			
CH32				-			

\*1: U8975 4CH Analog Unit or U8978 4CH Analog Unit

\*2: U8977 3CH Current Unit

# 8.10.1 Setting the Anti-aliasing Filter (A.A.F)

The anti-aliasing filter (A.A.F) setting is configurable for Model 8968 High Resolution Unit and Model U8979 Charge Unit only.

Refer to "How to display the [Each Ch] sheet and select channels" (p. 184).

【Unit】—			
InputUnit	HIGH RES		
Mode	Voltage	A.A.F	Off
Range	5mV		

A.A.F

The anti-aliasing filter can prevent aliasing distortion. The cutoff frequency automatically changes according to the timebase or, when the FFT function is used, the frequency range setting.

MEM

Off	Disables the anti-aliasing filter. (Default setting)
On	Enables the anti-aliasing filter. (Using the external sampling disables the anti-aliasing filter [A.A.F])

# 8.10.2 Setting the Probe Voltage Dividing Ratio

Refer to "How to display the [Each Ch] sheet and select channels" (p. 184).

Range	5mV			
Resolution	3.125,N	16-bit)		
Coupling	DC			
LPF	Off		Probe	1:1

Probe

Set this setting when performing measurement with a connection cable or probe.

1:1	Select this option when Model L9197, L9198 or L9217 Connection Cord is connected to the input module. (Default setting)
10:1	Select this option when Model 9665 10:1 Probe is connected to the input module.
100:1	Select this option when Model 9666 100:1 Probe or P9000-01/-02 Differential Probe is connected to the input module.
1000:1	Select this option when Model 9322 Differential Probe or P9000-01/-02 Differential Probe is connected to the input module.

# 8.10.3 Setting Model 8967 Temp Unit

E

Slow

InputUnit	TEMP		
Mode	Temp-K	RJC	INT
Range	10°C	Burn Out	Off
Resolution	0.01°C	(16·bit) Renew Data	Normal

Refer to "How to display the [Each Ch] sheet and select channels" (p. 184).

#### Mode

Choose an option depending on the type of thermocouple to be used.

Selection	Measurement input range	Selection	Measurement input range
0010001011	incucation in partiange	0010001011	incubal chiefte input range
Temp-K	-200°C to 1350°C	Temp-R	0°C to 1700°C
Temp-J	-200°C to 1100°C	Temp-S	0°C to 1700°C
Temp-E	-200°C to 800°C	Temp-B	400°C to 1800°C
Temp-T	-200°C to 400°C	Temp-W	0°C to 2000°C
Temp-N	-200°C to 1300°C		

RJC (Reference junction compensation)	The reference junction compensation is performed in the module. When connecting a thermocouple via a reference junction device (e.g., zero-point bath), select <b>[EXT]</b> .					
	INT	Performs the reference junction compensation inside the module. (Default setting) (Measurement accuracy: The sum of the accuracy of the temperature measurement and that of the reference junction compensation.)				

хт	Does not perform the reference junction compensation inside the module. (Measurement accuracy: The accuracy of the temperature measurement only)
	(Measurement accuracy: The accuracy of the temperature measurement only)

**Burn Out** You can detect a broken thermocouple wire during temperature measurement. When a thermocouple wire breaks, measured values will fluctuate.

Off	Does not check wires for breaks.
On	Checks wires for breaks. The instrument flows approximately 100 nA of minuscule current through the thermocouple to detect breaks. If the thermocouple wires are long or have a relatively high resistance, set [Burn Out] to [Off] not to cause measurement errors.

 

 Renew Data (Data refresh)
 The data refresh rate has three options: Fast, Normal, and Slow. The default setting is [Normal]. This setting eliminates noise, allowing stable measurement. For quicker response, select [Fast]; however, note that this setting makes the measurement more susceptible to noise. For further improved measurement stability, select [Slow].

 Fast
 Updates data approximately every 1.2 ms. Normal

 Updates data approximately every 100 ms. (Default setting)

Updates data approximately every 500 ms.

# 8.10.4 Setting Model 8969 and U8969 Strain Unit

The Model 8969 or U8969 Strain Unit can perform the auto-balance.

Executing the auto-balance adjusts the reference output level of the transducer to the specified zero position.

This function can be used for Model 8969 or U8969 Strain Unit only.

The instrument describes Model U8969 as "8969."

#### Before executing the auto-balance

- Turn on the instrument and leave it for 30 minutes to allow the internal temperature of the module to stabilize.
- After connecting a strain gauge transducer to the module and a measuring target, execute the auto-balance without any input including distortion.
- The auto-balance cannot execute during measurement.
- Key operations are not accepted during the auto-balance.

#### To execute the auto-balance

Refer to "How to display the [Each Ch] sheet and select channels" (p. 184).

InputUnit	STRAIN		
Range	20με		
Resolution	0.0160µ2 (16-bit)	Gauge Rate	2.00

#### Setting Item: [Range]

Auto Bal All Chs	Executes the auto-balance for all of the channels in which Model 8969 or U8969 Strain Unit is installed.
Auto Bal Ch 1	Executes the auto-balance for the presently selected channel.

You can execute the auto-balance also on the **[Analog]** sheet of the channel settings window. (when selecting the range of a channel in which the Strain Unit is installed.)

#### To display the channel settings window ([Analog] sheet)

Refer to "3.4.2 Configuring Analog Channels Settings" (p. 73).

#### In the following cases, execute the auto-balance again.

- · After changing the vertical axis (strain axis) range
- · After replacing the module
- · After replacing the strain gauge transducer
- After cycling the instrument
- · After performing the system reset
- When the ambient temperature has changed significantly (the zero position may drift)

#### If the message "Warning: Auto balance failed." appears

The channel for which the auto-balance failed is displayed. Verify the following, and execute the auto-balance again.

- Is the strain gauge transducer not subject to any load? (Make sure that it is not subject to vibration, etc.)
- Is the strain gauge transducer correctly connected to a measuring target?

# 8.10.5 Setting Model 8970 Freq Unit

When the standard logic (LA, LB, LC, LD, LE, LF, LG, and LH) is displayed, Model 8970 Freq Unit installed as modules 1, 2, 9, or 10 cannot be used.

InputUnit	FREQ		VRange	±10V
Mode	Count		Threshold	+2.5V
Range	2k		Timing	Start
Resolution	1.00	( <u>16-bit</u> )	Count O∨er	Hold
Coupling	DC		Slope	t
LPF	Off		Divide	1

Refer to "How to display the [Each Ch] sheet and select channels" (p. 184).

Mode

Switches the measurement mode.

Frequency	Measures the frequency of the measurement waveform (hertz, Hz) (Default setting)
RPM	Measures the number of rotations of the measurement target (rotations/ minute, r/min)
Power Frequency	Measures the power frequency variation (hertz, Hz)
Count	Accumulates the number of input pulses
Duty	Measures the duty ratio of the measurement waveform (percent, %)
Pulse width	Measures the pulse width (seconds, s)



VRange (Input voltage)	Set the maximum level of the input signal.	
	±10 V (Default setting), ±20 V, ±50 V, ±100 V, ±200 V, ±400 V	
	Select the value by pressing the <b>F</b> keys.	
Threshold	<ul> <li>Measured values are acquired based on the following: the time interval between the times when the measurement waveform exceeds or falls below the threshold value, and the number of times when the waveform exceeds or falls below the threshold value.</li> <li>The upper and lower limits of the threshold value and the fluctuation in the threshold value vary depending on the VRange setting.</li> </ul>	

- While setting the threshold, the level monitor displays the voltage level.
- Select the value by pressing the **F** keys.

To prevent measurement errors due to noise, the hysteresis width that is approximately 3% of the input voltage is tolerated for the threshold.

(When [VRange] is set to [±10V], it is approximately ±0.3 V.)

Set a threshold allowing for tolerance exceeding the hysteresis width relative to the peak voltage.

SlopeThe instrument detects the waveform when the waveform crosses the specified level<br/>in the direction specified here, which is used in each measurement mode.

1	Detects the waveform when it exceeds the specified level. (Default setting)
$\downarrow$	Detects the waveform when it falls below the specified level.

**Divide** The instrument determines the frequency every time this number of pulses are counted.

1 (Default setting) to 4096

Select the figure by pressing the **F** keys.

Example: For the encoder that outputs 360 pulses per rotation, set the number of divisions to [360] to measure the frequency of each rotation. When frequency dividing is not needed, set the number of divisions to [1].

Timing

You can use this setting only when setting **[Mode]** to **[Count]**. You can set when to start accumulating the number of the pulses.

Start	Starts the accumulating when the START key is pressed. (Default setting)
Trigger	Starts accumulating the number of the pulses when the instrument triggers.

- When **[Timing]** is set to **[Start]**, some internal processing time is required between the pressing of the **START** key and the start of measurement. Thus, the count value is not zero at the start point.
- When **[Timing]** is set to **[Start]** and the input signal exceeds the trigger level while the pre-trigger length of data is being acquired, the instrument does not trigger even when the input signal exceeds the specified trigger level. Furthermore, the time for internal processing at the start and the trigger priority setting may cause the instrument not to trigger even when the input signal exceeds the specified trigger level.
- When the memory division is used, the last data in the previous block may remain in the first part of the block.

Count Over

You can use this setting only when setting [Mode] to [Count].

Hold	Counting the pulses, and stops the counting when the number of pulses reaches the upper limit (65535 for the 2 k range).
Back	Starts counting the pulses, and bring the count back to zero when the number of pulses reaches five times of the range (50000 for the 2 k range).

Refer to "How to display the [Each Ch] sheet and select channels" (p. 184).

【Unit】——			
InputUnit	FREQ	VRange	±10V
Mode	Duty	Threshold	+2.5V
Range	5%		
Resolution	0.01%	( <u>16·bi+</u> )	
Coupling	DC	Level	High
LPF	Off		

#### Level

You can use this setting only when setting [Mode] to [Pulse Width] or [Duty]. For the pulse width measurement and duty ratio measurement, you can select whether to detect the parts that are above the threshold level or those that are below the level.

High	Measures the parts of waveforms that are above the threshold value. (Default setting)
Low	Measures the parts of waveforms that are below the threshold value.

Refer to "How to display the [Each Ch] sheet and select channels" (p. 184).

InputUnit	FREQ	VRange	±10V
Mode	Freq	Threshold	+2.5V
Range	1kHz	Smoothing	Off
Resolution	2.00 Hz (16-	bit) Hold	Off(0.5Hz)

#### Smoothing

You can use this setting only when setting [Mode] to [Freq] or [RPM].

#### Sets the smoothing.

Off	Records the measured data without the smoothing. (The waveforms are recorded in a staircase pattern.) (Default setting)
On	Interpolates the measured data to smooth the waveforms and outputs the waveforms. (Upper limit: 10 kHz, outputting data with this setting to On lags behind that with this setting set to Off.)

#### Hold

You can use this setting only when setting [Mode] to [Freq] or [RPM].

Sets the hold for frequencies and counts.

Off (1Hz/0.5Hz/ 0.2Hz/0.1Hz)	When the instrument does not determine the measured value even when the frequency reaches one of the values in the brackets, the measurement is defined to stop and regards the measured value to be 0 Hz (0 rpm). (Default setting)
On	Retains the value settled last time.

# 8.10.6 Setting Model 8971 Current Unit

There's no need to change the mode as it is set when the clamp sensor is automatically detected.

Refer to "How to display the [Each Ch] sheet and select channels" (p. 184).

InputUnit CURREN	NT
Mode 20A/2V	V
Range 100mAg	div

Mode

20A/2V	Sets this option when Model 9272 (20 A range), 9277, or CT6841 Clamp Sensor is connected. (Default setting)
200A/2V	Sets this option when Model 9272 (200 A range), 9278, CT6843, or CT6863 Clamp Sensor is connected.
50A/2V	Sets this option when Model CT6862 Clamp Sensor is connected.
500A/2V	Sets this option when Model 9279, 9709, CT6844, CT6845, CT6846*, CT6865*, CT6875, or CT6876* Clamp Sensor is connected.

\* When Model CT6846, CT6865 or CT6876 is connected to Model 8971 Current Unit through Model 9318 Conversion Cable (Model CT9901 Conversion Cable), the instrument recognizes that as an 500 A AC/DC sensor is connected; set the scaling ratio to 2.00.

Range	DC	Current measurement (Default setting)
	RMS	RMS current measurement

### 8.10.7 Setting Model 8972 DC/RMS Unit

Refer to "How to display the [Each Ch] sheet and select channels" (p. 184).

InputUnit	DC/RMS		
Mode	DC	Response	Normal
Range	5mV		

Mode

Switches the measurement modes.

DC	Voltage measurement (Default setting)
RMS	RMS measurement

**Response** You can set the response time for the RMS measurement to one of the three speeds: Fast, Normal, and Slow.

Usually, set the response time to **[Fast]**; however, setting the response time to **[Normal]** or **[Slow]** can stabilize the measured value when the frequency is relatively low or when the voltage fluctuates severely.

Fast	Sets the response time to approx. 100 ms. (Default setting)
Normal	Sets the response time to approx. 800 ms.
Slow	Sets the response time to approx. 5 ms.

# 8.10.8 Setting Model MR8990 Digital Voltmeter Unit

- Installing the Model MR8990 Digital Voltmeter Unit as Unit 1 and Unit 2 disables the standard logic channels.
- The resolution of the data measured by the recorder function is 16 bits.
- If you start a measurement that uses a higher-sensitivity measurement range than 5 V/div with the input terminals opened, the instrument will reach an over-range state.

Refer to "How to display the [Each Ch] sheet and select channels" (p. 184).



Freq

You can switch the power frequency.

Switch between 50 Hz and 60 Hz according to the power frequency in your region.

50Hz	Sets the period to 20 ms (Default setting)
60Hz	Sets the period to 16.67 ms

If the power frequency setting is not configured correctly, measured values will fluctuate.

**NPLC** The power line cycle (PLC) is the time equivalent to a period of the power frequency. Set the integration time based on one PLC.

0.1 to 0.9, 1 (Default setting) to 10, 20, 30, 40, 50, 60, 70, 80, 90, 100

Example: When the power frequency is 50 Hz and NPLC is set to 10, 20 ms × 10 = 200 ms.

The measured data refresh rate is calculated to be 200 ms.

Response

Refreshes data at high speed.

Off	Refreshes data at the integration time set for NPLC. (Default setting)
On	Calculates the moving average and refreshes the data at high speed. Refreshes the data at 0.1 PLC when NPLC is set to 9 or less. Refreshes the data at 1 PLC when NPLC is set to 10 or above.

**CAL** Enabling this setting calibrates the instrument or synchronizes the channels with each other automatically when measurement starts. The synchronizing between the channels allows the integration calculations to synchronize with each other.

Off	Does not calibrate the instrument or synchronize between the channels. (Default setting)
On	Calibrates the instrument and synchronizes between the channels.
Synchronization	Only synchronizes between the channels.

- It takes approximately 150 ms to calibrate the MR8990. During this period, no measurement is performed.
- If the channels are synchronized with each other, the signal that interrupts the integration is sent to each module at the start of measurement; thus, the instrument has to wait until the first integration finishes.
  - The wait time required for this process is (10 ms + integration time\*).
  - \* The integration time varies depending on the NPLC setting.

Even when synchronization is not performed, the wait time described above is also required for measurement performed immediately after the settings of the Model MR8990 Digital Voltmeter Unit are changed. However, no wait time is required when the measurement is performed with the same settings.

• When [CAL] is set to [Off] (Default setting), perform calibration manually. Refer to "2.8 Performing Calibration (When Model MR8990 is Installed)" (p. 55).

#### 8.10.9 Setting Model U8974 High Voltage Unit

Refer to "How to display the [Each Ch] sheet and select channels" (p. 184).

ÍnputUnit	HI VOLT		
Mode	RMS	Response	Normal
Range	RMS200mV		

Mode

Switches the measurement mode.

DC	Voltage measurement (Default setting)	
RMS	RMS measurement	

**Response** You can set the response time for the RMS measurement to one of the three speeds: Fast, Normal, and Slow.

Setting the response time to **[Slow]** can stabilize the measured values when the frequency is relatively low or when the voltage fluctuates severely.

Fast	Sets the response time to 150 ms.
Normal	Sets the response time to 500 ms. (Default setting)
Slow	Sets the response time to 2.5 s.

# 8.10.10 Setting Model U8977 3CH Current Unit

Each of Model 9709, Model CT6860 series, and Model CT6840 consists of a current sensor with the sub model-number "-05," which has a metal connector, and that without the sub model-number "-05," which has a black plastic connector.

You can directly connect a current sensor that has the sub model-number "-05," which has a metal connector, with Model U8977 3CH Current Unit. Using Model CT9900 Conversion Cable, you can connect a current sensor without the sub model-number "-05," which has a black plastic connector, to Model U8977 3CH Current Unit.

Refer to "How to display the [Each Ch] sheet and select channels" (p. 184).

InputUnit	3CH CURR
Mode	20A/2V Unconnected
Range	100mAdiv
Resolution	62.50µА (16-bi+)
Coupling	DC
LPF	Off

Current sensors to be connected determine whether the instrument automatically recognizes mode or whether you have to choose a current sensor setting.

Mode

(When the instrument automatically recognizes the sensors connected) Confirm the output rate displayed in the **[Mode]** area.

Available measurement ranges, which depend on automatically recognized output rates, are as follows:

20A/2V	2 A, 4 A, 10 A, 20 A, 40 A, 100 A
50A/2V	4 A, 10 A, 20 A, 40 A, 100 A, 200 A
200A/2V	20 A, 40 A, 100 A, 200 A, 400 A, 1000 A
500A/2V*	40 A, 100 A, 200 A, 400 A, 1000 A, 2000 A
1000A/2V	100 A, 200 A, 400 A, 1000 A, 2000 A, 4000 A
2000A/2V	200 A, 400 A, 1000 A, 2000 A, 4000 A, 10000 A
None	When no current sensor is connected.

\*: When Model CT6846-05 or Model CT6865-05 connects via Model CT9900 Conversion Cable, the instrument recognizes the sensor as a 500 A AC/DC sensor. Set the conversion ratio at 2.00 in the scaling setting.

(When you have to choose a current sensor setting) Tap the [Mode] box, and then choose a connected current sensor.

Available measurement ranges, which depend on chosen current sensors, are as follows:

CT7631/CT7731	200 A
CT7636/CT7736	200 A, 400 A, 1000 A
CT7642/CT7742	2000, 4000
CT7044/CT7045/CT7046	2000, 4000, 10000
0.1mV/A	2000, 4000, 10000, 20000, 40000, 100000
1mV/A	200, 400, 1000, 2000, 4000, 10000
10mV/A	20, 40, 100, 200, 400, 1000
100mV/A	2, 4, 10, 20, 40, 100
1000mV/A	0.2, 0.4, 1, 2, 4, 10

When a current sensor included in Model CT7000 series connects via Model CT9920 Conversion Cable, set a current sensor model name or its output rate.

# 8.10.11 Setting Model U8979 Charge Unit

This setting allows you to choose between voltage measurement and acceleration measurement (chargeoutput or built-in pre-amplifier) for a channel.

A channel can measure either one of them.

[Voltage] mode and [PreAmp] mode use BNC connectors, whereas [Charge] mode uses miniature connectors.

Model U8979 can automatically recognize TEDS-compliant\* sensors.

\*: Transducer electronic data sheet

### 



Setting the measurement mode to [PreAmp] allows Model U8979 Charge Unit to constantly provide power (3.5 mA, 22 V) to sensors. Set any measurement mode other than [PreAmp] or tum off the instrument before connecting a sensor or probe with a BNC terminal to avoid an electric shock or damage to the measurement target.

Refer to "How to display the [Each Ch] sheet and select channels" (p. 184).

InputUnit	CHARGE		
Mode	Charge	A.A.F	Off
Range	500mM/s²/div	Sens.	1.000

Mode

Switches the measurement mode.

Mode	Measurement target	Measurement sensitivity
Voltage	Voltage	_
Charge (Default setting)	Charge-output acceleration sensor	0.1 pC/(m/s <sup>2</sup> ) to 10 pC/(m/s <sup>2</sup> )
PreAmp	Acceleration sensor with a built-in preamplifier	0.1 mV/(m/s <sup>2</sup> ) to 10 mV/(m/s <sup>2</sup> )

<sup>(</sup>When setting mode to [PreAmp])

Move the cursor to the [Sens.] box and execute [TEDS Load].

Acquires sensitivity of a connected sensor. However, the instrument can acquire sensitivity of TEDS-compliant acceleration sensors with a built-in pre-amplifier only. When sensor sensitivity has been acquired, it is automatically set.

#### A.A.F The anti-aliasing filter can prevent aliasing distortion that may be produced during FFT calculation. The cutoff frequency automatically changes according to the sampling rates or frequency range (for the FFT function) settings.

OFF	Disables the anti-aliasing filter. (Default setting)
ON	Enables the anti-aliasing filter. (Disabled when the external sampling is used, or the sampling rate is set at 100 kS/s or faster)

# Sensitivity You can enter sensor sensitivity to two decimal places. For a charge-output acceleration sensor or non-TEDS-compliant sensor, enter its sensitivity marked on the sensor, which represents sensitivity per meter per second squared.

#### Setting example for sensor sensitivity

#### Example 1

For a sensor with its sensor sensitivity per meter per second squared marked

Sensor sensitivity	(setting value)
1.08 pC/(m/s <sup>2</sup> )	1.08

#### Example 2

#### For a sensor with its sensor sensitivity per gee (G) marked.

For a sensor with its sensitivity marked, enter a quotient of the marked sensitivity divided by  $9.8 \text{ m/s}^2$ .

Sensor sensitivity	(setting value)
For sensor sensitivity of 64 pC/G 64.0 / $9.8 = 6.53061 pC/(m/s^2)$	6.531 (to two decimal places)

#### To convert a unit from meter per second squared into gee (G)

The instrument measure charge quantities per meter per second squared. You can convert such charge quantities into those per gee (G) using the scaling function. Refer to "8.5 Converting Input Values (Scaling Function)" (p. 171).

Configure the scaling setting as follows;

#### Example 1

#### Specifying a conversion ratio

Ratio	0.1020E+00 (= 1/9.8)
Offset	0.0000E+00
Units	G

# Example 2

#### Specifying two points

Input1	9.8000E+00	Scale1	1.0000E+00
Input2	0.0000E+00	Scale2	0.0000E+00
Units	G		

#### When using an out-of-setting-range current sensor

You can use an out-of-setting-range current sensor using the scaling function. Refer to "5.2.2 Automatically Saving Waveforms" (p. 96).

- **Sensitivity** Multiply the sensor sensitivity of a sensor to be used by a certain value to allow a product to fall within the setting range (0.1 to 10), and enter the product.
- **Scaling** Configure the scaling setting so that a scaling ratio is the same value as the number you multiplied the sensor sensitivity by.

#### Example 1

#### For sensor sensitivity of 23.4 pC/(m/s<sup>2</sup>)

Specify 10 pC/(m/s<sup>2</sup>), which results from multiplying the sensor sensitivity by 1/2.34, as the sensor sensitivity. To display measured values after multiplying them by 1/2.34, configure the scaling setting as follows:

To configure the scaling setting using the conversion ratio method

Ratio	0.4274E+00 (= 10/23.4)
Offset	0.0000E+00
Units	m/s <sup>2</sup>

To configure the scaling setting using the 2-point method

Input1	2.3400E+00	Scale1	1.0000E+00
Input2	0.0000E+00	Scale2	0.0000E+00
Units	m/s <sup>2</sup>		

#### Example 2

#### For sensor sensitivity of 0.05 pC/(m/s<sup>2</sup>)

Specify 0.1 pC/(m/s<sup>2</sup>), which results from multiplying the sensor sensitivity by two, as the sensor sensitivity. To display measured values after multiplying them by two, configure the scaling setting as follows:

To configure the scaling setting using the conversion ratio method

Ratio	2.0000E+00 (= 0.1/0.05)
Offset	0.0000E+00
Units	m/s <sup>2</sup>

To configure the scaling setting using the 2-point method

Input1	0.0500E+00	Scale1	1.0000E+00
Input2	0.0000E+00	Scale2	0.0000E+00
Units	m/s <sup>2</sup>		

# 8.10.12 Setting MR8790 Waveform Generator Unit

The channels with Model MR8790 installed cannot be used for measurement.

нок	🖌 Unit L	.ist / Each	Ch / Sca	ling 🦯	Comment	Generator		9-Dec 11:26:18
MDST	90 Waya C	oporator Unit					Unit1	Function:
MICO	90 mave u	enerator onit					UNITZ ▲CH.SET	
Ch	Туре	Frequency	Amplitude	Offset	Output	When Off	Unit3	
1	DC			5.000V	On	Open	Unit4	
2	Sine	100Hz	10.000Vpp	0.000V	On	Open	Unit5	
3	DC	8000011	5.00011	1.500V	Off	Short	Unit6	
4	Sine	20000Hz	5.000vpp	0.000V	UTT	Upen	Unit7	Select Unit
							Unit8	
								Select Unit
								F1
								DC
							F2	
<del> </del>   [ 6	ienerator ]			(	Control —			$\sim$
								Sine
Me	ethod	Manua	1					
				- <b>C</b> 7	ΓΟΙ	D		
						Γ		
Ц:5	Selects the waveform type.							
$\lfloor \dots \rfloor$								

Refer to "How to display the [Each Ch] sheet and select channels" (p. 184).

Туре	Selects the v	vaveform types.				
	DC	Outputs a DC signal (Default setting)				
	Sine	Outputs a sine wave				
Frequency	Sets the freq	uency of the output signal.				
	0 Hz to 2000	0 Hz				
Amplitude	Sets the amplitude of the output signal. The output voltage range the accuracy of which is guaranteed is between $-10$ V and $+10$ V, which includes the amplitude and the offset. If the sum of the amplitud and the offset is set to the outside of the guaranteed accuracy range, parts of the waveform will be clamped to the upper limit, approximately $+14$ V and the lower lin approximately $-14$ V.					
	0.000 V p-p to 20.000 V p-p					

#### Offset For DC output: Sets a DC voltage.

For sine wave output: Sets an offset voltage.

The output voltage range the accuracy of which is guaranteed is between -10 V and +10 V, which includes the amplitude and the offset. If the sum of the amplitude and the offset is set to the outside of the guaranteed accuracy range, parts of the waveform will be clamped to the upper limit, approximately +14 V and the lower limit, approximately -14 V.

-10 V to +10 V

#### When Off

Sets the output terminal condition when no signals output.

Open	Separates the output terminals from the internal circuit and opens the terminals.
Short	Separates the output terminals from the internal circuits and short-circuits the terminals.

#### Output Switches the waveform output.

On	Outputs the waveform.
Off	Does not output any waveform.

#### Control Sets the waveform output.

RUN	Starts outputting waveforms.
PAUSE	Pauses the output of the waveforms. Outputs the voltage that was being outputted when <b>[PAUSE]</b> was pressed.
STOP	Stops outputting the waveforms.

#### Method

#### Selects the control method for the waveform output.

Manual	Enables the control of waveform output only on the signal generation screen.
Sync.	In addition to the manual control, outputs waveforms synchronizing with the start and end of the measurement. <b>START</b> key: Starts the output when the measurement starts. <b>STOP</b> key: Stops the output when the measurement stops.
Keys	In addition to the manual control, enables the instrument's keys to be used for the waveform output control. <b>START</b> key: Starts the output. <b>STOP</b> key: Stops the output. Manual trigger key: Pauses the output.

For details, see the instruction manuals of Models U8793, MR8790, and MR8791.

# 8.10.13 Setting MR 8971 Pulse Generator Unit

The channels with Model MR8791 installed cannot be used for measurement.

нокі	Unit List	/ Each (	h / 9	Scaling	Comment	Generator		9-Dec 11:29:37
	al Dulca Capa	rator Unit					Unit1 ▲ CH.SET	Function:
MINO7	vi ruise dene						Unit2	MEMORI
Mo	ode						TRIGSET	
Pu	lse						Unit4	
							Unit5	
Ch	Frequency	Duty Ou	it−Config	Output			Unit6	
1	1.0Hz	10.0%		Un			Unit7	Select Unit
2	20.0HZ	20.0%		0n 0n			Unit8	
4	200.0Hz	40.0%	TTL	On				Select Unit
5	1000.0Hz	50.0%	00	On				
6	2000.0Hz	60.0%	00	Off				
/	10000.0Hz	/0.0%	00	Un				
0	10000.002	00.0%	UL	UII				F3
								Pulse
								Furse
+ 🕻 Ge	enerator】——			(	Control			
								Pattern
Me	thod	Manua I						
				S		$\boldsymbol{P}$		
						1		
	0 1							
   Hint	Selects th	ne generat	ion mode	•				

Refer to "How to display the [Each Ch] sheet and select channels" (p. 184).

#### Mode

#### Select the output types.

Pulse	Outputs a pulse signal (Default settings)	
Pattern	Output a pattern signal	

Refer to the instruction manual of Models U8793, MR8790, and MR8791 for details of the pattern output setting.

Setting the channel to be used to Ch1-16 or Ch1-32 allows the pattern output to be selected.
When the channel to be used is changed, the pattern data is erased. How to set the channel to be used

Refer to "8.4 Setting Channels to Use (Extending the Recording Length)" (p. 170).

**Frequency** Sets the frequency of the pulse output.

0 Hz to 20000 Hz

**Duty** Sets the duty ratio of the pulse signal.

0% to 100%

Out-Config	Sets the outp	ype.					
	TTL	ts the output type to T	٢L				
	OC	Sets the output type to open collector					
Output	Switches the signal output.						
	On	tputs signals.					
	Off	es not output signals.					
Control	Sets the sign	utput.					
	RUN	Starts the output.					
	PAUSE	Pauses the output. Outputs the voltage that was being outputted when <b>[PAUSE]</b> was pressed.					
	STOP	Stops the output.					
Method	Selects the c	ol method for the si	gnal output.				
	Manual	Enables the contro screen.	ables the control of signal output only on the signal generation een.				
	Sync.	In addition to the n the start and end o <b>START</b> key: Starts <b>STOP</b> key: Stops t	nanual control, outputs signals synchronizing with f the measurement. the output when the measurement starts. he output when the measurement stops.				
Keys		In addition to the n be used for the sig <b>START</b> key: Starts <b>STOP</b> key: Stops t Manual trigger key	nanual control, enables the instrument's keys to nal output control. the output. he output. : Pauses the output.				

For details, see the instruction manuals of Models U8793, MR8790, and MR8791.

### 8.10.14 Setting U8793 Arbitrary Waveform Generator Unit

The channels with Model U8793 installed cannot be used for measurement.

<mark>нюкі</mark> UnitLi	st / Each Ch /	Scaling	Comment	Genera	ator 🔊 🕒		9-Dec 11	:31:16
110702 Arbitro	ru Wayoform Conorato	r lloit				Unit1	Functio	in:
UO/%S AIDILIA	ry waverorm Generato	runnu				▼ TRIGISET		,Ϊ
Ch Type	Clock Freq Amp.Adj.	Offset Dela	y Loop	Filter	Output	Unit3		
1 Arbitrary	1000.00Hz × 1.000	10.000V	0 00	Off	On When Off	Unit4		
IESI(I)					Short	Unit5	4	î I
www	Number	Frequency				Unit7	Select	Unit
	20000 50.0000000	ImHz				Unit8		L
Ch Type	Frequency Amplitud	e Affset Du	tv Phase		Output		Select	Unit
2 Sine	1000.00Hz 15.000V	op 0.000V	0.0	0	On			
					When Off			
					open		<b>/</b>	F1
							Maria I.	
							Manua I	F2
+ 【Generator】		C	ontrol					
							Sync.	
Method	Manua I		1 I N					FS
		<b>_</b>	Uľ	V			Keys	
				-				
-								
Select	s the method by which	a to control 4	waveform (	outout				
Hint	s are method by WHICH		νανστυτΗΗ Ι	σατρατι				
<								

Refer to "How to display the [Each Ch] sheet and select channels" (p. 184).

#### Туре

#### Selects the waveform types.

DC	Outputs a DC signal (Default setting)
Sine	Outputs a sine wave.
Square	Output a rectangular wave.
Pulse	Output a pulse wave.
Triangle	Output a triangular wave.
Ramp-up	Outputs a ramp-up wave.
Ramp-down	Outputs a ramp-down wave.
Arbitrary	Outputs user-defined waveform.
Program	Outputs the waveform set by using a program.

Refer to the instruction manuals of Model U8793, MR8790, and MR8791 for the **[Program]** setting.

**Frequency** Sets the frequency of an output signal.

0 Hz to 100000 Hz

Amplitude	Sets the amplitude of an output signal. The output voltage range the accuracy of which is guaranteed is between $-10$ V and $+10$ V, which includes the amplitude and the offset. If the sum of the amplitude and the offset is set to the outside of the guaranteed accuracy range, parts of the waveform will be clamped to the upper limit, approximately $+16$ V and the lower limit, approximately $-11$ V.					
	0.000 V p-p to 20.000 V p-p					
Offset	For DC output: Sets a DC voltage. For sine wave output: Sets an offset voltage. The output voltage range the accuracy of which is guaranteed is between -10 V and +10 V, which includes the amplitude and the offset. If the sum of the amplitude and the offset is set to the outside of the guaranteed accuracy range, parts of the waveform will be clamped to the upper limit, approximately +16 V and the lower limit, approximately -11 V.					
	-10 V to +15	V				
Phase	Sets the pha	se.				
	300 10 300					
Duty	Sets the duty ratio for the pulse wave output.					
	%					
When Off	Sets the outp	out terminal status when no signals output.				
	Open	Separates the output terminals from the internal circuit and opens the terminals.				
	Short	Separates the output terminals from the internal circuits and short-circuits the terminals.				
Output	Switches the	signal output.				
	On	Outputs signals.				
	Off	Does not output signals.				
Control	Sets the sign	al output.				
	RUN	Starts the output. (Output indicator: Red)				
	PAUSE	Pauses the output. Outputs the voltage that was being outputted when [PAUSE] was pressed. (Output indicator: Red)				
	STOP	Stops the output. (Output indicator: Off)				

#### Method Selects the control method for the signal output.

Manual	Enables the control of signal output only on the signal generation screen.
Sync.	In addition to the manual control, outputs signals synchronizing with the start and end of the measurement. <b>START</b> key: Starts the output when the measurement starts. <b>STOP</b> key: Stops the output when the measurement stops.
Keys	In addition to the manual control, enables the instrument's keys to be used for the signal output control. <b>START</b> key: Starts the output. <b>STOP</b> key: Stops the output. Manual trigger key: Pauses the output.

#### Settings for [Arbitrary]

Data name	Registers and deletes data of an output waveform. Up to eight waveforms can be registered.
Filter	Filters the output waveform.
	Off (Default setting) to 1 MHz
Clock Freq	Set the clock frequency of the D/A converter that generates waveforms. The period and frequency of the output waveform are displayed on the lower level.
Delay	Set the delay for the waveform generation. A positive delay value represents that the phase leads.
	-250,000 data to 250,000 data (Default settings: 0)
Loop	Set the repeat count for generating waveforms.
	1 to 50,000, ∞ (Default setting: ∞)
Amp Adj	Set the amplitude level for the output waveform.
Offset	Set the offset voltage for the output waveform.

# 8.11 Registering Waveforms in the U8793 Arbitrary Waveform Generator Unit

You can register waveforms in the Model U8793. You can output the registered waveforms from the Model U8793.

<mark>нюкі</mark> Unit L	ist 🖉 Each Ch 🏒	Scaling	Comment	Generato	r ⊋⊡	IAN Push	9-Dec 11:32:23
U8793 Arbitra	ary Waveform Generato	or Unit				Unit1	No Data
Ch Type 1 Arbitrary	Clock Freq Amp.Adj. 1000.00Hz x 1.000	. Offset [ 0 10.000V	)elay Loop 0 ∞	Filter Off	Output On	Unit2 Unit3 Unit4	
TEST(1)	Number	Freesee		N	hen Off Short	Unit5 Unit6	
0000000	20000 50.000000	OmHz				Unit7 Unit8	
Ch Type 2 Arbitrary	Clock Freq Amp.Adj 1000.00Hz × 1.000	. Offset [ 0.000V	)elay Loop 0 ∞	Filter Off	Output On		
	Number	Frequency		14	Open		F1
	0.000000	0 Hz					Register: From File
+ 【Generator】			Control				Register: From Meas.
Method	Manua I	S	TO	P			<b>1</b>
+	ts the arbitrary wave	eform to ge	nerate.				F5
Hint							Delete

#### Procedure

#### To display the screen

Press the CHAN key to display the channel screen, and then select the [Generator] sheet.

#### **1** Set Type to Arbitrary.

Move the cursor to the **[Type]** box on the settings screen, and select **[Arbitrary]** by pressing the **F** keys.

#### **2** Register the waveform.

Move the cursor to the item listed below [Arbitrary] on the settings screen.

#### **3** Select the waveform data.

Register: From File	Registers the data by loading data saved in a storage device.
Register: From Meas.	Registers the data that has been measured using the memory function. You can also register the data after loading the MEM files from a storage device onto the instrument.
↑ or ↓	Resisters the data by selecting the arbitrary waveform data registered in the U8793. (Used for selecting and deleting output waveforms.)
Delete	Deletes the data written in the U8793 memory. If eight waveforms are already registered, delete any of them and then register the data.

#### Registering a waveform by selecting a file

**1** Select [Register..from file] by pressing F keys

HIOKI Unit List	/ Each Ch /	Scaling	Comment	Generator	<u></u>	IAN Push	9-Dec 11:42:37
U8793 Arbitrary (	Waveform Generato	or Unit				Unit1	Function: MEMORY
Ch Type Clo 1 Arbitrary : TEST(1) MMMMMMMMMMMMMMMMMMMMMMMMMMMMMMMMMMMM	ck Freq Amp.Adj. 1000.00Hz × 1.000 mber 20000 50.000000	Offset Da 10.000V Frequency OmHz	elay Loop 0 ∞	Filter C Off Wh	lutput On en Off Short	Unit2 Unit3 Unit4 Unit5 Unit5 Unit6 Unit7 Unit8	File Screen
Ch Type Clo 2 Arbitrary : Nur	ck Freq Amp.Adj. 1000.00Hz × 1.000 mber 0.0000000	Offset Do 0.000V Frequency 0 Hz	elay Loop 0 ∞	Filter C	lutput On Jen Off Open		Cance I
+ 【Generator】 —— Method	Select a WFG on the File s	or TFG arbi creen from	trary wavefi which to lo	orm file ad data.			
Selects th Hint	ne arbitrary wave	form to gen	erate.				

**2** Select [to File scrn] by pressing the CH.SET key.

The file screen is displayed.

**3** Select a user-defined waveform file with the WFG or TFG extension on the file screen and then register the file.

#### Registering a waveform from measured data

#### **1** Select [Register..from measurement data] by pressing F keys

нюки / Unit L	st / Each Ch / Scaling / Comment / Generator マ 🖭	HAN (Push) 8-Dec 11:05:38
118792 Arhitr-	ry Wayoform Congrator Unit	Unit1 Function:
	ny maveronni denerator onnt	TRIGSET
Ch Type	Clock Freq Amp.Adj. Offset Delay Loop Filter Output	Unit3
1 Arbitrary	1000.00Hz × 1.000 0.000V 0 ∞ 0ff 0ff	Unit4
	Short	Unit5
	Number Frequency	Unit7 Execute
	0 0.0000000 HZ	Unit8
Ch Type	Frequency Amplitude Offset Duty Phase Output	Cance I
2 DC	0.000V Dff	
	When Uff Short	
		F1
		Analas Ch
		And tos on
+ [Generator]	Waveform registration from the measured data	
Method	Channel Ch15 7	
	Data Count 250000	
	Conv. Ratio 1.000	F4
	Name NONAME	
0		F5
Sets 1 Hint	he measurement data channel.	
		Wave Calc.Z.

#### 2 Select the waveform to be registered by pressing F keys.

Analog Ch	Registers the waveform measured through an analog channel.
Wave Calc. Z	Registers the waveform obtained from a waveform calculation result.

#### **3** Select the waveform channels to be registered.

Analog waveform

Ch1 through Ch16

Waveform calculations

Z1 through Z16

#### **4** Set the data count to be registered.

Whole waveform	Registers the whole wave.*
A-B waveforms	Registers the waveform between Cursors A and B.*
Tenkey input	Sets the data starting position and data count freely using the numeric keypad.

\* Up to 250,000 data point can be registered.

#### **5** Set the conversion ratio.

Amplifies or attenuates voltage values of the measured data and register them.

0.001 times to 100 times

#### 6 Enter a data name.

Enter the data name registered as a user-defined waveform data in the memory of the U8793 into the **[Name]** box.

When no data name is entered, the data is registered as [NONAME].
### 8.12 Saving Waveforms Registered in Model U8793 onto a Storage Device

You can save the user-defined waveform data registered in Model U8793 onto a storage device. For saving methods, refer to "5.2.4 Saving Waveform Outputting Data to a Storage Device" (p. 109).

## 8.13 Setting Output Waveform Parameters on the Waveform Screen

You can configure the output settings of the MR8790, MR8791, and U8793 on the waveform screen. You can configure and change these settings during measurement or output.



- **1** Display the waveform screen (if another screen is displayed, press DISP to display the waveform screen).
- **2** Press CH.SET (to display the tabs).
- **3** Press CH.SET or select the [Generator] tab with the mouse.
- **4** Set the following parameters.

Frequency	Sets the frequency.
Amp	Sets the amplitude.
Offset	Sets the offset.
Output	Turns on and off the output.

For details, see the instruction manuals of Models U8793, MR8790, and MR8791.

Setting Output Waveform Parameters on the Waveform Screen

## 9 Setting the Trigger

The trigger function allows you to start and stop measurement using signals or conditions. When recording is started or stopped by specific signals, it is called "the instrument triggers." You can configure the trigger settings on the trigger settings window of the waveform screen. The X-Y recorder function does not support the trigger function.

#### How to open the trigger settings window



The window changes every time the **TRIG.SET** key is pressed.





If the trigger setting screen is difficult to see because it is overlapped with the waveforms, narrow the waveform display width so that the waveform display screen and trigger settings screen are displayed separately from each other.

Refer to "7.7.3 Switching the Waveform Display Width" (p. 156).





- The instrument triggers based pm the logical trigger connective (AND/OR) among the trigger sources except for the manual trigger. (p. 232)
- When triggering, the instrument output the TRIG OUT signal from the external control terminals. (p. 377)

If using Model U8975 4CH Analog Unit, Model U8977 3CH Current Unit, U8978 4CH Analog Unit or MR8990 Digital Voltmeter Unit, the trigger point display may shift by 1 sample.

## 9.2 Setting the Trigger Mode

Set whether the instrument repeatedly waits for a trigger after measurement. If all trigger sources are set to Off (i.e., with no trigger setting), measurement starts immediately (freely running).

#### Procedure

#### To display the screen

Press the **DISP** key to open the waveform screen.



#### 2 Select the trigger mode.

Single	Triggers on an event. Pressing the <b>START</b> key triggers recording the specified recording length of waveforms, and then the measurement stops.
Repeat	Triggers on events repeatedly. When no trigger events occur, the instrument waits for a trigger. Pressing the <b>STOP</b> key stops the measurement. (See below)
Auto	MEM FFT Triggers on events repeatedly. When no trigger events occur within approximately one second, records the specified recording length of waveforms automatically. Pressing the STOP key stops the measurement.



Available options vary depending on the function.

Tringer mede	Function		
ingger mode	MEM FFT	REC	
Single	$\checkmark$	✓ (Default setting)	
Repeat	$\checkmark$	✓	
Auto	✓ (Default setting)	_	

To stop the measurement

Press the **STOP** key.

Press the key once: Records the recording length of waveforms, and then stops it. Press the key twice: Stops the recording immediately.

#### When the trigger mode is set to [Repeat]

During the processing period (auto-save, auto-print, waveform display processing, numerical calculation) after recording stops until the instrument is set to wait for a trigger, the instrument does not trigger.

Q

## 9.3 Triggering the Instrument Using Analog Signals

The section explains how to set the analog triggers and types of the analog triggers. You can configure these settings on the trigger settings window ([Analog Trig] sheet).

#### Procedure

#### To display the screen

Press the **DISP** key to display the waveform screen, and then press the **TRIG.SET** key to open the trigger settings window ([Analog Trig] sheet).



- **1** Move the cursor to the [Type] box of the channel to be changed.
- **2** Select the trigger type with the F keys.
- **3** Move the cursor to the parameter to be changed with the CURSOR keys.
- **4** Select the parameter value with the **F** keys.

#### To copy the setting to another channel

You can copy the settings on the trigger settings window (**[Analog Trig]** sheet). Refer to "8.9 Copying Settings to Other Channels (Copy Function)" (p. 183).

When the FFT function is used, setting **[Reference]** to **[From Memory]** disables the analog triggers setting.

#### 1. Level trigger

When the input signal crosses the specified trigger level (voltage value) in the positive or negative direction, the instrument triggers.



In this manual, the mark **T** represents the "trigger point," the time at which a trigger is applied.

Туре	Parameter	
[Level]	[L] (Level)	Sets the trigger level (voltage value). (You can set the level in increments of 1/50 of the vertical axis [voltage axis] range.)
	[S] (Slope)	Selects which event the instrument triggers when the input voltage crosses the trigger level in the positive or negative direction. Selecting the icon $\uparrow$ enables the instrument to be triggered on both slopes. ( $\uparrow$ , $\downarrow$ , $\updownarrow$ )
	[Event]	Sets the number of times the signal crosses the trigger level in the positive or negative direction. The instrument triggers when the counted number reaches the specified number. (1 to 4000)
	[F] (Filter)	The instrument triggers when the input signals meet the trigger conditions during the specified filter width period. This is useful to prevent the instrument from triggering unintentionally due to noise. ( $M \in M$ and $FFT$ : OFF, 0.1 to10 div, $R \in C$ : OFF, ON*) *: The filter width period is 10 ms.

#### 2. In-window trigger, Out-of-window trigger

Sets the range by specifying the upper and lower limit values. The instrument triggers when the input signal falls into the range (In) or outside the range (Out).



Туре	Parameter		
[in]	[Lower]	Sets the lower limit value. (You can set the level in increments of 1/50 of the vertical axis [voltage axis] range.)	
	[Upper]	Sets the upper limit value. (You can set the level in increments of 1/50 of the vertical axis [voltage axis] range.)	
or [Out]	[F] (Filter)	The instrument triggers when the input signals meet the trigger conditions during the specified filter width period. This is useful to prevent the instrument from triggering unintentionally due to noise. ( $M \in M$ and $FFT$ : OFF, 0.1 div to 10 div, $R \in C$ : OFF, ON*) *: The filter width period is 10 ms.	

9

#### 3. Voltage drop trigger (MEM and FFT only)

When the voltage peak drops below a preset level for the period of half a cycle or more, the instrument triggers. The available timebase range is between 20  $\mu$ s and 50 ms/div.



Туре	Parameter	
[L] (Level)		Sets the trigger level (voltage value). (You can set the level in increments of 1/50 of the vertical axis [voltage axis] range.)
[VDrop] [f=] (Frequency) Select		Selects between 50 Hz and 60 Hz.
	RMS: (Root- mean-squire value)	The indication of the RMS value Changes with the level setting.

#### 4. In-period trigger, out-of-period trigger

The instrument measures the input voltage period, which is the time lag between consecutive two points at which the input voltage crosses the reference voltage in the positive or negative. The instrument triggers when the period falls within the specified range (In) or outside the range (Out). Refer to "Setting the period range" and "Trigger position of the out-of-period trigger" (p. 219).



About the trigger point The trigger point appears one sampling round late.

Туре	Parameter	
[Per.l] or [Per.O]	[L] (Level)	Sets the trigger level (voltage value). (You can set the level in increments of 1/50 of the vertical axis [voltage axis] range.)
	[S] (Slope)	Selects which event triggers the instrument, occurring when the input voltage crosses the trigger level in the positive or negative direction $(\uparrow, \downarrow)$
	[P↓] (Period lower limit) <sup>*1</sup>	Sets the lower limit, which can be set to zero and five times the sampling frequency or higher. The lower limit cannot be set to a value higher than the period upper limit. (When the lower limit is set to zero, the instrument ignores the lower limit and triggers using the higher limit only.)
	[↑] (Period upper limit) <sup>*1</sup>	Sets the upper limit, which can be set to 20,000 times the sampling frequency or lower. The upper limit cannot be set to a value lower than the period lower limit.
	[F] (Filter)	The instrument triggers when the input signals meet the trigger conditions during the specified filter width period. This is useful to prevent the instrument from triggering unintentionally due to noise. ( $M \in M$ and $FFT$ : OFF, 0.1 div to 10 div, $R \in C$ : OFF, ON*) *: The filter width period is 10 ms.

\*1 Changes with the timebase setting.

#### 5. Glitch trigger (<u>M E M</u> and **FFT** only)

The instrument triggers when the pulse width of the input signal that has crossed the trigger level (threshold voltage) is shorter than the specified width.



9

#### When triggering using noisy signals

#### Method 1: Setting the trigger filter

Setting the filter width prevents the instrument from triggering mistakenly due to noise, allowing it to trigger when the input meets the trigger conditions during the specified width (interval) or longer period.



Noise does not cause triggering.

#### Method 2: Setting the number of events

Setting the number of events prevents the instrument from triggering mistakenly due to noise, allowing it to trigger when the counted number reaches the specified number.



#### To prevent the effects of noise

Noise at close to the trigger level can erroneously increment the event count. The trigger filter is useful to avoid this problem.



#### Setting the period range

The period range setting of the period triggering varies depending on the sampling period (sampling rate). (The setting value of the period range also changes with the timebase setting.)

Check the [Sampling Rate] setting on the [Status] sheet of the status screen.

The upper limit value of the period range cannot be set to the value lower than the lower limit value; the lower limit value cannot be set to the value higher than the upper limit value;

Lower threshold: can be set to zero or five times the sampling period or higher.

Upper threshold: can be set to 20,000 times the sampling period or lower.

## To trigger the instrument when the input frequency exceeds the upper limit value (when the period becomes shorter)

Set the period trigger to **[Per.I]** and the lower limit to **[0]**. The instrument ignores the lower limit and triggers when the input frequency exceeds the upper limit.

## To trigger the instrument when the input frequency falls below the upper limit value (when the period becomes longer)

Set the period trigger to **[Peri.O]** and the lower limit to **[0]**. The instrument ignores the lower limit and triggers when the input frequency falls below the upper limit.

#### Trigger position of the out-of-period trigger

The instrument calculates periods by monitoring times when the input crosses the reference voltage value in the positive or negative direction and triggers when the period falls out of the specified period range. The trigger points vary depending on the specified period range and the period of the measuring object.

## When the input signal period is shorter than the specified lower threshold (with the trigger slope set to positive [↑])



The instrument triggers when the rising edge (↑ trigger slope) of the input signal crosses the reference voltage level before the lower period threshold elapses.

## When the input signal period is longer than the specified upper threshold (with the trigger slope set to positive [↑])



The instrument triggers when the upper threshold period elapses before the rising edge (↑ trigger slope) of the input signal crosses the reference voltage level.

Thus, the trigger point varies depending on the upper threshold of the period range.

# 9.4 Triggering the Instrument Using Logic Signals (Logic Trigger)

The section explains how to set the logic triggers and types of the logic triggers. Press the **[DISP]** key to display the waveform screen, and then press the **[TRIG.SET]** key to open the trigger settings window (**[Logic Trig]** sheet).

- Input signals obtained through the logic channels serve as the trigger source. You can specify trigger patterns and logic trigger (AND and OR). When these conditions are met, the
- instrument triggers.
  You can choose whether the instrument triggers or not when the logic trigger conditions have been already met at the start of measurement.
- Using the trigger filter allows the instrument to trigger only when the logic trigger conditions are met during the specified filter width period.

#### Procedure

#### To display the screen

Press the **DISP** key to display the waveform screen, and then press the **TRIG.SET** key to open the trigger setting window (**[Logic Trig]** sheet).

**1** Move the cursor to the channel for which you want to change the settings.

Use the F keys to configure the settings.

3. Logic channels 1. 2. A Or X х х Х B And X х |X|Х С \_ D \_ A \_ В С D

1. Trigger

2

Sets the logic trigger connective (AND or OR).

OFF	Disables the logic trigger. (Default setting)
OR	Trigger the instrument when one of the logic input signals meets the trigger pattern.
AND	Triggers the instrument when all of the logic input signals meet the trigger pattern.

**2. Filter** Sets the trigger filter width. (If necessary) The trigger filter eliminates incorrect triggers caused by noise. (p. 218)

MEM	OFF	Disables the trigger filter. (Default setting)
	0.1 to 10	Enables the trigger filtering. The filter width can be set in terms of divisions.
	055	
REC	OFF	Disables the trigger filter. (Default setting)
	ON	Enables the trigger filtering. The filter width is set to 10 ms (5 ms with the sampling rate setting of 100 ns/S)

#### 3. Trigger pattern Sets the logic trigger pattern.

Х	Ignores signals. (Default setting)
0	Triggers the instrument to trigger when the signal is at a low level.
1	Triggers the instrument when the signal is at a high level.

#### To copy the setting to another channel

You can copy the settings on the trigger settings window (**[Logic Trig]** sheet). Refer to "8.8 Inverting the Waveform (Invert Function)" (p. 182).

## Setting Example 1: To allow the instrument to trigger when one of the input signals meets each of the following patterns

LA1: High level LA2: Low level Logic trigger connective: OR LA[1, 2, 3, 4]: [1 0 X X]

The instrument triggers when LA1 or LA2 is met each of the logical trigger patterns.



## Example 2: To allow the instrument to trigger when both of the input signals meet each of the following patterns

LA1: High level	Trigger	pattern 💢	<b>P</b>
LA2: LOW level	LA1	1	
LA[1, 2, 3, 4]: [1 0 X X]	LA2	0	
	LA3	х 🗌	
	LA4	х	บ†บ

- When the trigger conditions have been already met, pressing the **START** key does not allow the instrument to trigger. After all of the trigger sources have ceased to meet the trigger conditions, when they meet the trigger condition again, the instrument triggers.
- The triggers of the standard logic channels (LA, LB, LC, and LD) are available regardless of the logic waveform display and the module type.

## 9.5 Triggering the Instrument at the Specified Time or at Regular Intervals (Timer Trigger)

The timer trigger allows you to trigger the instrument at the specified time.

- You can trigger the instrument at regular intervals during the period from the specified start time until the specified stop time.
- Check that the clock is set correctly before setting the timer trigger. If not, set the clock on [Init] sheet accessible from the system screen. (p. 53)

#### Procedure

#### To display the screen

Press the **DISP** key to display the waveform screen, and then press the **TRIG.SET** key to display the trigger settings window.

#### **1** Enable or disable the timer trigger.

Move the cursor to the [Timer Trig] box.

Off	Disables the timer trigger.
On	Enables the timer trigger.

<b>1</b> Timer Tr	ig	On
	M D	h m s
<b>2</b> Start	5-8	13:17.00
Stop	5-8	13:17.00
<b>3</b> Interval	0	0:0.0

2 (When setting the timer trigger to [On]) Set the start and stop times.

Move the cursor to the [M], [D], [h], and [m] boxes in turn. Set the start date and time as well as the stop date and time.

To set the start or stop times to the present date and time Select **[Present Time]**.

Records for the specified recording length



(To trigger the instrument at regular intervals during the period between the start and the stop times)
 Set the interval.

Move the cursor to the **[D]**, **[h]**, **[m]**, and **[s]** boxes under **[Interval]** in turn. Set the recording interval.

#### **4** Press the START key.

Measurement starts, and the recording will start at the specified start time.

To stop the recording in progress immediately Press the **STOP** key.

When the interval is shorter than the recording length



When the recording length exceeds the recording interval The instrument does not triager

I he instrument does not trigger until having acquired the specified recording length of the data.

#### When the end of the recording length is set so as to be behind the stop time

The recording length varies depending on the operating function. (p. 223)

When the interval is set to zero With the trigger mode set to [Repeat], the recording is repeated from the start time to the stop time.

The set time of the timer trigger and the time at which the instrument actually triggers may differ by up to three sampling rounds.

#### Start and stop times

- Set the start and stop times so as to be the later times than the time the **START** key was pressed.
- When the trigger mode is set to [Single] and the timer trigger is set to [On], the instrument triggers at only the specified start time. The interval and stop time setting are ignored.

#### To perform recording at regular intervals during the period between the start and the stop times

Set the trigger mode to [Repeat] all other trigger sources to [Off].

However, since the instrument does not start waiting for a trigger while processing data (auto-save, auto-print, waveform display processing, calculation), which starts at the end of the previous round of recording, recordings may not start at the specified regular intervals depending on the measurement settings.

#### Stop time and recording length

The stop time varies depending on the functions.

Memory function: After acquiring the specified length of measurement data, the instrument stops the recording.

Recorder function: The instrument stops the recording at the specified stop time.

Relationship between the last recording length and the stop time



#### To trigger the instrument using trigger sources in addition to the timer trigger

The trigger sources set to **[On]** are all enabled.

However, the trigger timing varies depending on the trigger source settings.

When the trigger logical connective among the trigger sources is set to logical disjunction (Trigger source: OR)

Depending on the other trigger source settings, the instrument can trigger before the specified trigger start time, after the specified stop time, or outside of the specified interval.

• When the trigger logical connective among the trigger sources is set to the logical conjunction (Trigger source: AND)

The instrument triggers when all the trigger sources meet the trigger conditions during the specified intervals within the period between the specified start and stop times.

When the interval is set to zero, the instrument triggers when all the trigger sources meet the trigger conditions within the period between the specified start and stop times.

## Example: When performing measurement with both the timer trigger and the level trigger (with the slope setting set to positive $[\uparrow]$ ) are enabled.



#### When trigger criteria are combined with OR (Trigger Source: OR)



#### When trigger criteria are combined with AND (Trigger Source: AND)

Ignored because they occurred while recording

## 9.6 Triggering the Instrument Externally (External Trigger)

External signals applied to the external control terminals can serve as the trigger sources. The external signals can also be used to operate multiple instruments in synchronization with each other.

#### Procedure

#### To display the screen

Press the **DISP** key to display the waveform screen, and then press the **TRIG.SET** key to display the trigger settings window

window.

Enable the external trigger. Move the cursor to the [Ext Trig] box.		
Off	Disables the external trigger. (Default setting)	
On	Enables the external trigger.	

- OR	limer
On	Start Stop Inter
	OR

## 2 Configure the external control terminals (EXT.TRIG) setting, and input the signals.

Refer to "17.2.5 External Trigger Terminal (EXT.TRIG)" (p. 378).

## 9.7 Triggering the Instrument Manually (Manual Trigger)



Pressing the **Manual Trigger** key can trigger the instrument forcibly. The manual trigger takes priority over all other trigger sources regardless of the settings.

To stop the recording Press the **STOP** key.

Press the key once	Stops the recording after acquiring the recording length of waveforms.
Press the key twice	Stops the recording immediately.

The same as other trigger types, the instrument does not trigger while filling the pre-trigger memory. Set the trigger priority function to **[On]**.

Refer to "9.8.2 Setting the Trigger Acceptance (Trigger Priority)" (p. 229).

## 9.8 Setting the Pre-trigger

This function can be used in the memory and FFT functions only.

Setting the pre-trigger recording length (number of divisions or percentage of the recording length) enables the instrument to record not only waveforms appearing after the trigger point but also those appearing before the trigger point.

You can also record waveforms appearing after the pre-trigger recording length elapses since the trigger point.



• Setting all the trigger sources (analog, timer trigger, etc.) to off disables the pre-trigger settings.

• In the FFT function, the pre-triggers cannot be set in terms of divisions.

### 9.8.1 Setting the Trigger Start Point (Pre-trigger)

Set the position of the trigger point relative to the specified recording length. Two setting methods are available. (Setting the start point in terms of percent and divisions [div])

#### Procedure

#### To display the screen

Press the **DISP** key to display the waveform screen.

9

#### **1** Select the unit used for setting the pre-trigger.

Move the cursor to the [Pre-trigger] box.

%	Sets the pre-trigger in terms of percent (%). (Default setting)
div	Sets the pre-trigger in terms of divisions (div). For the external sampling, set in terms of the number of samples.

Trigger∶

[[imebase:

╟╦┝

Single

10ms/div

10%

#### **2** Enter the numerical value.

#### (When [%] is selected)

With the recording start point set at 0%; the recording stop point set at 100%, set the percentage of the trigger point.

-95%, 100%, 95%, 90%, 80%, 70%, 60%, 50%, 40%, 30%, 20%, 10%, 5%, 2%, 0%

#### (When [div] is selected)

With the recording start point set at 0 div; the recording stop point at the time the set recording length has elapsed, set the number of divisions for the trigger point.

Negative recording length (divisions) to positive recording length (division)

#### Pre-trigger and the recording period (recording length)



-95% Records the recording length of the waveforms that appear after 95% of the recording length has elapsed since the trigger point.

The instrument ignores trigger events while filling the pre-trigger memory. To trigger the instrument while it is filling the pre-trigger memory, set the trigger priority to **[On]**. Refer to "9.8.2 Setting the Trigger Acceptance (Trigger Priority)" (p. 229).

#### Difference between [Pre-Trigger wait] and [Trigger wait]

When starting the measurement, the instrument starts filling the pre-trigger memory. During this period, the instrument displays the message [Pre-Trigger wait].

After having filled the pre-trigger memory, the instrument displays the message [Trigger wait], starting waiting for a trigger.

Refer to "Measurement and internal operations" (p. 80).

#### Setting the Trigger Acceptance (Trigger Priority) 9.8.2 $[M \in M]$

This function can be used in the memory function only.

You can choose whether the instrument triggers or not when the trigger conditions are met while the instrument is filling the pre-trigger memory.

- When the pre-trigger is enabled, the instrument does not trigger once the measurement starts until the certain period has elapsed (while the instrument is filling the pre-trigger memory).
- The message [Pre-Trigger wait] is displayed on the screen.

#### Procedure

#### To display the screen

Press the **DISP** key to display the waveform screen, and then press the **TRIG.SET** key to display the trigger settings window.

Move the cursor to the	[Trig	Prio]	box.
------------------------	-------	-------	------

OFF	Does not trigger while being filling the pre-trigger		Trig Src	OR	Ther
	memory. (Default setting)		Ext Trig	On	Start Stop
ON	Triggers while being filling the pre-trigger memory.	] (			Inter

#### When the trigger conditions are met during [Pre-Trigger wait]

Example: When the pre-trigger period is set to 50%



## 9.9 Setting the Trigger Timing

This function can be used in the recorder function only.

Follow the procedure described below to configure the operation settings when the instrument triggers.

#### Procedure

#### To display the screen

Press the **DISP** key to display the waveform screen, and then press the **TRIG.SET** key to display the trigger settings window.

Move the cursor to the [Timing] box.		
Start	Starts the recording when the instrument triggers, and stops the recording when having acquired the specified recording length of the waveforms. (Default setting)	
Stop	Starts the recording when the <b>START</b> key is pressed, and stops the recording when the instrument triggers.	
Start & Stop	Starts the recordings when the instrument triggers, and stops the recording when the instrument triggers again.	

14 - 15 - 16 -		
Timing Irig Src	Start UK	Timer Trig
Ext Trig	-	

#### **Trigger timing**

The stopping behavior varies depending on the trigger modes.

	Recording S [Start]	TART key Recording	[Start & Stop]
Starts the recording	Starts the recording when the instrument triggers.	Starts the recording when you press the <b>START</b> key.	Starts the recording when the instrument triggers while the instrument is not performing recording.
Stops the recording	+	*	+
Trigger mode: [Single]	Stops the recording after acquiring the specified recording length of data.	Stops the recording when the instrument triggers.	Stops the recording when the instrument triggers while the instrument is performing the recording.
	When the instrument does no elapsed [Stop] or [Start & Stop]: Stops length of the data.	t trigger even after the specifie the recording after having acquir	d recording length has ed the specified recording
Trigger mode: [Repeat]	Starts the recording, stops the recording after having acquired the specified recording length of the data, and then waits for a trigger. When triggers again, starts the recording, stops the recording after having acquired the specified recording length of the data, and then waits for a trigger. (Repeats the sequence)	When triggers again, stops the recording, and then starts another recording. (Repeats the sequence)	When triggers, stops the recording, and then waits for a trigger. When triggers again, starts another recording until triggers one more time. (Repeats the sequence)

## When the instrument does not trigger even after the specified recording length has elapsed

**[Stop]**: After having acquired the specified recording length of the data, the instrument starts another recording. The instrument repeats this sequence until it triggers.

[Start & Stop]: After having acquired the specified recording length of the data, the instrument starts waiting for a trigger. (Start trigger)

## **Example: When the trigger type is set to Level Trigger; Level to 0.000 V, and Slope to positive (**() Setting of [Timing]



The above sequences repeat when the trigger mode is [Repeat].

### 9.10 Setting the Trigger Logical Connective (AND/OR) Among the Trigger Sources

Set the trigger logical connective by choosing between AND and OR among the analog, logic, external, timer triggers.

#### Procedure

#### To display the screen

Press the **DISP** key to display the waveform screen, and then press the **TRIG.SET** key to display the trigger settings window.

Move the cursor to the [Trig Src] box.

OR	Triggers when any one of the specified trigger source conditions is met. (Default setting)
AND	Triggers only when all of the specified trigger source conditions are met.

Trig Prio	_	Timer
Trig Src	OR	
Ext Trig	On	Star1 Stop
		Inter

(When using the memory function)

#### When the trigger logical connective is set to [AND]

When the trigger conditions have been already met, pressing the **START** key does not allow the instrument to trigger. After all of the trigger sources have ceased to meet the trigger conditions, when they meet the trigger condition again, the instrument triggers.

#### Setting example:

#### To trigger the instrument when the waveform exceeds the zero volts

The instrument with the trigger logical connective set to each of AND and OR triggers as follows:

Channel	Trigger	Trigger level	Slope	Filter
CH1, CH2	Level	0.00 V	Positive (↑)	OFF



sources are combined with a logical AND.

## 9.11 Searching the Measured Data Using the MEM Trigger Settings

The trigger settings can be used to search the measured data.

The instrument searches the trigger points, at which the measured data meet the trigger conditions, in the measured data in order and displays them.

You can set the search settings in the same way as the trigger settings, and search the trigger points under the different condition from the trigger settings.

Example 1: After performing measurement with the trigger level set to 0 V, to search the points at which the waveform exceeds 100 V in the measured data

Example 2: After performing measurement without the trigger setting, to search the points at which the waveform exceeds 100 V in the measured data

#### Procedure

#### To display the screen

Press the DISP key to display the waveform screen, and then press the TRIG.SET key to display the trigger settings

window. ([Analog Trig] or [Logic Trig] sheet)

## **1** After performing the measurement, set the searching condition.

The setting method is the same as described in "9.3 Triggering the Instrument Using Analog Signals" (p. 214) and "9.4 Triggering the Instrument Using Logic Signals (Logic Trigger)" (p. 220).



#### **2** Specify the searching scope.

Move the cursor to the [Area] field.

Whole Wave	Searches all the measured data. (Default setting)
A-B Wave	Searches the range between Cursor A and Cursor B.

#### (When using the memory division)

All Display Blocks	Searches all the data in all the displayed blocks. (Default setting)
A-B Display Blocks	Searches the range between Cursor A and Cursor B in the displayed blocks.
All Blocks	Searches all the data in all the blocks.
A-B All Blocks	Searches the range between Cursor A and Cursor B cursors in all the blocks.

• When the range between Cursor A and Cursor B is selected with only Cursor A displayed on the screen, the instrument searches the time range after Cursor A.

• The searching scope for the [All Blocks] setting will be defined by the start block and the number of blocks to be measured.

#### **3** Execute the search.

Move the cursor to the [Trig search] field.

Execute the searching.	Starts the search in the measurement data from the beginning.	
Search next	Searches the subsequent point that meets the searching condition.	
Move A cursor	Moves Cursor A to the searched point.	
Move B cursor	Moves Cursor B to the searched point.	ex
Clear	Clears the searched points.	Tri

[Search] and [Search next] can be executed by pressing the Manual Trigger key as well.

#### Search results

The point that meets the searching condition is displayed in the center of the screen and marked with an S.



When no points that meet the searching condition are found, the message **[No Matches Were Found]** is displayed.

• Pre-triggers, trigger priorities, external triggers, and timer triggers cannot be used as the searching conditions.

• The search results may not coincide with the trigger points.

## **Numerical Calculation** 10 **Functions**

 $M \in M$ 

unction:

1

The numerical calculations can be used only with the memory function.

Results calculated from the acquired waveform are displayed as numerical values on the waveform screen. These calculation results can be judged for evaluation. The numerical calculation settings can be configured on the [Num Calc] sheet accessible from the status screen.

#### To display the [Num Calc] sheet



Operations available on the [Num Calc] sheet

#### [Num Calc]

- Average
- · RMS value
- P-P Value
- Maximum value
- Time to Maximum Value
- · Minimum value
- Time to Minimum Value
- Period
- Frequency
- Rise Time
- Fall Time
- Standard Deviation
- Area

- X-Y Area · Time to Level
- Level at Time
- Pulse Width
- Duty Ratio
- Pulses
- Four arithmetic operations of the numerical calculation results
- Time difference calculation (Time Diff)
- Phase difference calculation
- (Phase Diff)
- High Level

- Low Level
- (24 types in total)
- Range-specified calculation between Cursors A and B Calculations can be performed for the data the range of which is specified with Cursors A and B. Calculation operator details: "10.6 Numerical Calculation Types and Descriptions" (p. 249)

#### Judging the numerical calculation results (p. 243)

You can judge the results of numerical calculations by comparing them with specified reference ranges, giving GO or NG (pass or fail) judgments.

There are 24 types of numerical calculations in total, 16 of which can be performed simultaneously. When the scaling function is enabled, scaled values are calculated.

#### Saving/Printing numerical calculation results

- · Automatically saving numerical calculation results
- Saving existing numerical calculation results specified freely

Refer to "10.4 Saving the Numerical Calculation Results" (p. 246).

- Automatically printing numerical calculation results
- · Printing numerical calculation results freely specified

Refer to "10.5 Printing the Numerical Calculation Results" (p. 248).

### **10.1 Numerical Calculation Procedure**

There are two ways to perform the calculation.

• Performing calculation during measurement: Settings for numerical calculation must be

• Calculating the existing data:

chosen before starting measurement. The calculation can be performed for the waveform data after the measurement is complete and the data saved on storage devices.

Performing calculation during measurement



#### Calculating the existing data



#### To specify a waveform range for calculation

Before performing the calculation, specify the calculation range using Cursors A and B (the Div or Trace setting) on the waveform screen.

- Set the calculation range on the [Num Calc] sheet to [A-B Wave].
- The range setting cannot be used to specify the range.
- When one cursor is used, the calculation is performed for the range from the cursor point through the end of the data.

Refer to "7.2 Specifying the Waveform Range (Cursors A and B)" (p. 145) and "10.2 Setting the Numerical Value Calculation" (p. 238).

## **10.2 Setting the Numerical Value Calculation**

#### Procedure

#### To display the screen

Press the STATUS key to display the status screen, and then select the [Num Calc] sheet.

#### **1** Enable the numerical calculation function.

Move the cursor to the [Numerical Calc] box and select [On].

#### **2** Specify the waveform calculation range.

Move the cursor to the [Calc Area] box.

Whole Wave	Calculates the whole waveform. (Default setting)
A-B Wave	Calculates the data between Cursors A and B.
After Trigger	Calculates the waveform obtained after the trigger.

Refer to "7.2 Specifying the Waveform Range (Cursors A and B)" (p. 145).

#### **3** Choose calculation settings.

Calculation No. (5) Phenomenon



#### (1) Select the calculation type.

Move the cursor to the number of the calculation type for which you want to choose settings. Select the calculation type.

(When **[List]** is selected, a list of calculation types appears. To clear the display, press the **TRIG.SET** key.)

\* Settings vary depending on the calculation type.

Select **[Judge]** to judge the calculation results. (p. 243)



When selecting **[A-B Wave]**, specify the calculation range using the Cursors A and B on the waveform screen.

When no measured data has been acquired by the instrument, perform measurement once. Doing so allows you to calculate the data obtained within the specified range.

OFF	No calculations are performed. (Default setting)	Area	Area enclosed by the zero-level line and the signal waveform	
Average	Average value of the waveform data	X-Y Area	Area enclosed by the X-Y composite curve	
RMS	RMS value of the waveform data	Time to Lev*	Time required from the trigger point to the time when the waveform data reached the specified level	
P-P	Peak-to-peak value of the waveform data	Lev-time	Measures value when the specified time has elapsed from the trigger point	
Maximum value	Maximum value of the waveform data			
Max-Time	Time required from the trigger point to the time of the maximum value	Pulse Width*	Pulse width of the waveform data	
Minimum value	Minimum value of the waveform data	Duty Ratio*	Duty ratio of the waveform data	
Min-Time	Time Time required from the Pulses* Pulses* Pulses*		Pulse count of the waveform data	
Period*	Period of the signal waveform	Calculation	Four arithmetic operations of the numerical calculation results	
Frequency*	Frequency of the signal waveform	Time Diff*	Time lag between Phenomena A and B.	
Rise Time	Rise time of the waveform data	Phase Diff*	Time lag between Phenomena A and B represented as the phase difference.	
Fall Time	Fall time of the waveform data	High Level	High-level value of the waveform data	
Std Dev         Standard deviation of the waveform data		Low Level	Low-level value of the waveform data	

\*: The settings can also be configured for the logic channels.

10

## Move the cursor to the channel column and select the channel to be calculated. (The logic channels can also be selected for Time to Level, Pulse Width, Duty Cycle, and Pulse Count.) (3) Set the parameters. Settings may not be necessary for some types of calculation.

When calculating time lag and phase difference, choose settings for both Channels A and B. Move the cursor to the parameter column and set the parameter settings. Refer to "Parameter table" (p. 241) and "8.1.3 Entering Alphanumeric Characters" (p. 163).

#### (4) Set the statistical calculation.

Move the cursor to the [Stat] column.

(2) Select the channel to be calculated.

First	Calculates the measurement data in the initial condition.
Average	Calculates the average value of the calculation results in the measured data.
Max	Finds the maximum value of the calculation results in the measured data.
Min	Finds the minimum value of the calculation results in the measured data.

### To print or save calculation results during measurement

Configuring the settings is required before the measurement. Refer to "10.4 Saving the Numerical Calculation Results" (p. 246) and "10.5 Printing the Numerical Calculation Results" (p. 248).

#### To print or save the existing data Press the PRINT key to print the data. Press the SAVE key to save the data.

Refer to "5.2.3 Saving Data Selectively (SAVE Key)" (p. 103) and "6.3 Manually Printing Data by Pressing the PRINT Key (Selection Print)" (p. 130).

## (5) When you select "Time difference calculation" or "Phase difference calculation," set the channels (Ch) and the parameters with respect to each A and B

**4** Perform the calculations (To judge the calculation results, refer to (p. 243)).

To calculate the existing data Select [Exec].

To perform calculations automatically after measurement Press the **START** key to start measurement.

To copy the calculation settings to another calculation

Use the [Num Calc] sheet.

Refer to "8.9 Copying Settings to Other Channels (Copy Function)" (p. 183).

#### Parameter table

Calculation type	Parameter	Description of parameter	
Period	L (Level)	The calculation is performed based on the interval (time) when the waveform crossed the level specified here.	
Frequency Pulse Width Pulses Duty Ratio* Time Diff	F (Filter)	Only when the measured signal has crossed the level and has never crossed the level again within the specified filter width, the waveform is considered to have crossed the level. This is useful to exclude level crossing events caused by noise.	
Phase Diff * Level and Filter only	S (Slope [↑, ↓])	The calculation is performed based on the interval (time) when the waveform crossed the specified level. Choose between using the time when the waveform crosses the level in the positive direction ( $\uparrow$ ) and using that in the negative direction ( $\downarrow$ ) to calculate the time.	
Rise Time Fall Time	P (%)	Determines which portion of the waveform between the up and lower limits is used for calculating the rise time (or fall time). The range is narrowed from the range between the upper lower limit values by the percentage set here.	
	L (Level)	Finds the time when the measured signal crossed the specified level.	
Time to Lev	F (Filter)	Only when the measured signal has crossed the level and has never crossed the level again within the specified filter width, the waveform is considered to have crossed the level. This is useful to exclude level crossing events caused by noise.	
	S (Slope [↑, ↓])	Choose between the time until the signal crosses the specified level in the positive and that in the negative direction.	
Lev-time	Time or Measure (Calculation results)	Specifies the time for calculating the measurement value, using the trigger position as the zero position. To use the numerical calculation results, specify the numerical calculation number. Specifying range with Cursors A and B is not available.	
Calculation	Numerical Calculation No.	Sets the numerical calculation number.	
	+, -, ×, ÷	Sets operators for the four basic arithmetic operations.	

• Depending on signal waveforms, the period, frequency, rise time, and fall time may not be displayed.

 When the scaling is enabled, the waveform data is scaled before the numerical calculation is performed. The units for parameter values are those set in the scaling function.
 For more information about the scaling, refer to "8.5 Converting Input Values (Scaling Function)" (p. 171) Numerical Calculation Functions

10

## **10.2.1 Displaying the Numerical Calculation Results**

Numerical calculation results are displayed on the waveform screen.



#### To save the calculation results after the measurement

Pressing the **SAVE** key after measurement allows you to select the contents to be saved. (Select [Calc Result].)

Refer to "5.2.3 Saving Data Selectively (SAVE Key)" (p. 103).

## **10.3 Judging the Calculation Results**

Set the judgment criteria (upper and lower threshold values) to judge the numerical calculation results. The judgment criteria can be set with respect to each of the numerical calculation.

The waveform acquisition processing varies depending on the trigger mode setting (Single or Repeat) and the criteria specified to stop measuring upon judgment ([GO], [NG], or [GO&NG]).



Automatic saving and automatic printing will not be carried out before the stopping criteria are met at the end of calculation evaluation.

#### Procedure

#### To display the screen

Press the STATUS key to display the status screen, and then select the [Num Calc] sheet.

#### **1** Configure the calculation settings. (p. 238)

#### **2** Enable the judgment function.

Move the cursor to the **[Judge]** column of the row to be judged, and select **[On]**.

Off	Does not perform the judgment.
On	The fail judgment (NG) is given if the result exceeds the range. Any channel for which the fail judgment (NG) is given is shown in red.

#### **3** Specify the judgment thresholds.

Move the cursor to the **[Lower]** and **[Upper]** columns in order.

Select an entry method and enter threshold values. Valid range: -9.9999E+29 to +9.9999E+29 Refer to "8.1.3 Entering Alphanumeric Characters" (p. 163).

#### **4** Select the stop mode for the judgment.

Move the cursor to the [Stop Mode] box.

GO	Performs the next process when the calculation result falls within the threshold range (Pass judgment).
NG	Performs the next process when the calculation result exceeds the threshold range (Fail judgment).
GO&NG	Performs the next process regardless of the judgment result.



#### Execute the calculation.

To judge the existing data Select [Exec].

To perform judgment automatically after the measurement Press the **START** key to start the measurement.

#### About upper and lower limit values

The upper limit value cannot be set to below the lower limit value, and vice-versa.

#### About performing the calculation

Processing varies depending on the trigger mode setting. If calculating the data while acquiring waveforms, the instrument repeats measurements until the stopping criteria are met. (p. 243)

#### To record all of the calculation results

Set the Stop mode setting to [GO&NG].

	Stat	Judge	Lower	Upper
	2	Nff		
		On	-1.0000	1.0000
		011		
		Off	3 Lower	Upper
S :	l First	Off	limit value	limit value
	First	Off		
S	🕇 First	Off		

HIOKI Status	Num Calc	Memory
+【Numeric Calc	Settings】——	
Numerical Calc	On	Print
Calc Area	Whole Wave	Save
∉Stop Mode	GO&NG	
# 10.3.1 Displaying the Judgment Results and Outputting the Signals

The numerical calculation judgment results are displayed on the waveform screen.

The result falling within the judgment threshold range: The result exceeding the judgment threshold range: GO (pass) judgment NG (Fail) judgment (highlighted in red)



The judgment results for each parameter will also be printed.

#### When the GO (pass) judgment is given

• The Go signal is output through the (GO/EXT.OUT.1) terminal of the external I/O.

#### When the NG (fail) judgment is given

- The NG signal is output through the (NG/EXT.OUT.2) terminal of the external I/O. The NG (fail) judgment is given when any one of the channels is judged to be NG (fail).
- When the beeper is enabled, the instrument beeps when a result exceeds the threshold range.

10

### **10.4 Saving the Numerical Calculation Results**

The instrument can perform the calculation while acquiring the data and automatically save the results. Configuring the calculation settings is required before the measurement.





When using the auto-save during measurement, do not remove the storage device specified as the save destination until the measurement operation is completely finished. Doing so may damage data on the storage device.

#### Procedure

#### To display the screen

Press the STATUS key to display the status screen, and then select the [Num Calc] sheet.

#### **1** Enable the saving of numerical calculation results.

Move the cursor to the **[Save Calc Result]** box. Select **[On]**. (Default setting: Off)

Print Calc Result	Off
e <b>1</b> Save Calc Result	On
<b>2</b> Folder to save	New File
<b>3</b> Save to	
<b>4</b> Save Name	

To select a storage media: Up/down

To open the next lower-level folder : Right

2 Select the file creation method. Move the cursor to [Folder to save].

New File	Creates a new file for each measurement.
Existing File	Appends the calculation results to a single file.

HDD:¥ �� HDD:¥

💊 USB1:¥

🗇 CF:¥

👒 LAN : ¥

CURSOR

CURSOR

#### **3** Set the save destination.

Move the cursor to the **[Save to]** box. Select **[Edit]**. The folder browsing dialog box appears.

(Refer to the right figure.)

Move the cursor to the save target media. Select **[Confirm]** to confirm the selection.

To create a new folder to be used as the save target, select **[New Folder]**. When the save destination is set to **[LAN]**, the setting **[New Folder]** is ignored, and a folder named with the current date is created.

HDD	Automatically saves the waveform data on the built-in drive. (When Model U8331 SSD Unit is installed)
CF	Automatically saves the waveform data on a CF card.
USB	Automatically saves the waveform data on a USB flash drive.
LAN	Automatically saves the waveform data on the computer connected via LAN. Model 9333 LAN Communicator is required.

#### **4** Enter a file name.

#### (when you want to use a different name)

Move the cursor to the **[Save Name]** box. Enter a file name. (Default setting: MEAS) Refer to "8.1 Adding Comments" (p. 160). When **[LAN]** is set as the save destination, the name entered in the **[Save Name]** box is ignored and the file is named in the previously-determined format. Refer to "Save operations (When the save destination is set to [LAN])" (p. 102).

#### Save Name

- The number of characters in the [Save Name] box is limited to 123. The number of characters of a path including a file name is limited to 255.
- A sequential number starting from 0001 is automatically appended to the save name. (When [New File] is selected)

# **5** Confirm the measurement configuration and numerical calculation result settings, then start measurement.

#### (Press the START key.)

After the data is acquired and the numerical calculation process is complete, the numerical calculation results (text) are automatically saved to the specified storage media.

#### Example of saving numerical calculation results

Saving the numerical calculation results converts characters or display items used on the instrument as shown below.

Characters used on the instrument	Saved characters	
2	^2	
3	^3	
μ	~u	
Ω	~o	
3	~e	
o	~c	
±	~+	

<When calculation settings are as follows> Calculation No. 1: Maximum value of analog channel 1 Calculation No. 2: Minimum value of analog channel 1 Calculation No. 3: Maximum value of analog channel 2

Calculation No. 4: Minimum value of analog channel 2



If trigger time is not properly displayed when you open a file with Microsoft Excel<sup>®</sup>, follow the procedure described below.

(1) On the [Format Cells] dialog box, in the [Format] list, select [Custom].

(2) In the **[Type]** box, enter "yy-mm-dd hh:mm:ss.000".

# **10.5 Printing the Numerical Calculation Results**

You can print the results of calculations.

When the auto-print is enabled, the instrument prints the result data after printing the waveforms.

#### Procedure

#### To display the screen

Press the **STATUS** key to display the status screen, and then select the **[Num Calc]** sheet.

[On].

ſ	Print Calc Result	Off	)
е	Save Calc Result	Uff	)

• The printing will also be carried out when the only calculation is performed without performing the measurement.

• The calculation results are output to the output destination specified for automatic printing. Refer to "6.2 Setting Auto-printing" (p. 127).

# **10.6 Numerical Calculation Types and Descriptions**

Numerical calculation type	Description		
	Calculates the average value of the waveform data.		
Average	$AVE = \frac{1}{n} \sum_{i=1}^{n} di$ $AVE:$ Average n: Number of pieces of data di: i-th piece of data acquired through the channel		
	Calculates the RMS value of the waveform data. If the scaling is enabled, calculations are performed after scaling the waveform.		
Root-Mean-Square value (RMS)	$RMS = \sqrt{\frac{1}{n} \sum_{i=1}^{n} di^{2}} \qquad \begin{array}{l} RMS: \text{ RMS value} \\ n: \text{ Number of pieces of data} \\ di: \text{ i-th piece of data acquired through the channel} \end{array}$		
Peak-to-Peak value (Peak-Peak)	Calculates the value of the difference (peak- to-peak value) between the maximum and minimum values of the waveform data.		
Maximum Value (Maximum)	Finds the maximum value of the waveform data.		
Time to Maximum Value (Max-Time)	Calculates the time required from the last trigger point to the maximum value (unit: s). When there are two or more points of the maximum value, the first point of the waveform to be calculated is used as the maximum value.		
Minimum Value (Minimum)	Finds the minimum value of the waveform data.		
Time to Minimum Value (Min-Time)	Calculates the time required from the trigger point to the minimum value (unit: s). When there are two or more points of the minimum value, the first point of the waveform to be calculated is used as the minimum value.		
Period/Frequency	Displays the waveform's period (unit: s) and frequency (unit: Hz). Calculates the period and frequency based on the time lag between when the waveform crossed the specified level in the positive (or negative) direction first time and when it crossed the level in the positive (or negative) direction next time.		

Numerical Calculation Functions

10

249

Numerical calculation type	Description	
Rise Time Fall Time	Calculates the A%-to-B% rise time (or the B%- to-A% fall time) based on the 0% and 100% levels of the acquired waveform calculated using the histogram (frequency distribution). Calculates the rise time (or fall time) of the first rising (or falling) edge in the acquired waveform data. When the range is specified with Cursors A and B, calculates the rise time (or fall time) of the first rising (or falling) edge appearing between the cursors. The value A can be specified in terms of percent. The value B is automatically determined based on the value A. When the value A is 5%, the value B is set to 95%; when the value A is 70%, the value is set to 30%.	B% A% Rise time A: 5% to 30% B: 95% to 70%
	Calculates the standard deviation of the wavefo	arm data
Standard Deviation (Std Dev)	$\sigma = \sqrt{\frac{1}{n} \sum_{i=1}^{n} (di - AVE)^2} $ $\sigma: \text{ Standard Deviation } $ $\sigma: \text{ Standard Deviation} $ $AVE: \text{ Average} $ $n: \text{ Number of pieces of data} $ $di: \text{ i-th piece of data acquired through the channel} $	
Area	Calculates the area value (V•s) enclosed by the zero-level (zero-potential) line and the signal waveform. When the range is specified with Cursors A and B, calculates the area enclosed by the zero-level line, waveform, Cursor A, and Cursor B. $S = \sum_{i=1}^{n}  di  \bullet h \qquad \begin{array}{l} S: \text{ Area} \\ n: \text{ Number of pieces of data} \\ di: \text{ i-th piece of data acquired} \\ through the channel \\ h=\Delta t: \text{ Sampling rate} \end{array}$	el Cursor A Cursor B
	Calculates the area $(V^2)$ of the figure enclosed by the areas of the enclosed by the lines as illustration performed even when the X-Y composite curve You can specify the range with Cursors A and E domain plot of each channel, and then calculate composite curve plotted using the waveform ap specify the range on the X-Y composite curve of For details about Cursor A and B, Refer to "7.1 Cursors A and B)" (p. 140). When multiple loops are plotted $S = n \times S_0$ $S = n \times S_0$	by the X-Y composite curve. Calculates atted below. The calculation can be is not displayed. 8 (voltage axis or trace) on the time- e the area enclosed by the X-Y pearing in the range. (You cannot lirectly with Cursors A and B.) Reading Measured Values (Using an an open curve is plotted $S = S_0$ S: Area
X-Y Area	S: Area n: Number of loops Start point, end point	S: Area (Closed area is created by connecting the start and end points with a straight line)
	When a figure of eight is plotted When a spiral loop is plotted	
	$S_{1} =  S_{0} - S_{1} $ $S_{2} =  S_{0} - S_{1} $ $S_{2} =  S_{0} - S_{1} $ $S_{3} =  S_{0} - S_{1} $ $S_{4} = S_{1}$ $S_{5} =  S_{0} - S_{1} $ $S_{5} =  S_{1} - S_{2} $	$S = S_0 \times 2 + S_1$ S: Area (The number of overlapping segments increases with a loop count)
	Set contents: Assign the channels to X- and Y-axis.	

Numerical calculation	Description	
type		
Time to Level (Time- Lev)	Calculates the time required from the trigger point to the time when the signal crosses the specified level first time within the calculation range.	Level O V
Specified Time Level (Lev-Time)	Finds the level when the specified time has elapsed from the trigger point. The time can also be specified for the previously calculated results.	Level 0 V T (Time)
Pulse Width	Calculates the pulse width based on the time lag between when the waveform crossed the specified level in the positive (or negative) direction and when it crossed the level in the negative (or positive) direction.	
Duty Ratio (%)	Calculates the duty ratio based on two of the time lags: one between when the waveform crossed the specified level in the positive direction and when it crossed the level in the negative direction next time and the other between when it crossed the level in the negative direction and when it crossed the level in the negative direction. Duty ratio (%) = $\frac{Tu-d}{Tu-d + Td-u} \times 100(\%)$ $T_{u-d}$ : The time lag between when the waveform crossed the level in the negative direction and when it crossed the level in the negative direction and when it crossed the level in the negative direction and when it crossed the level in the negative direction (unit: s).	Level $\xrightarrow{T_u-d}$ $$
Pulses	Counts the number of the pulses that crossed the specified level in the positive (or negative) direction. When the signal crossed the specified level in the positive (or negative) direction and then it crossed the level in the negative (or positive) direction, the pulse is determined to have crossed the level once.	
Four Arithmetic Operations (Calculation)	Performs arithmetic operations $(+, -, \times, \div)$ using the freely selected.	ne numerical calculations results
Time difference calculation (Time Diff)	Calculates T[s], the time difference that passes between rising above or dropping below the level specified for A and B waveforms. Time lag T = (Time when Waveform B crosses the level) – (Time when Waveform A crosses the level).	Level A B

Numerical calculation type	Description	
Phase difference calculation (Phase Diff)	Calculates the time lag between each of Waveforms A and B crosses the specified level in the positive (or negative) direction, calculating the phase difference (unit: degree [°]) with reference to Waveform A.	
	Phase contrast = Cycle of A waveform Cycle of A waveform	[1] × 360 [°]
High Level Low Level	After obtaining the histogram (frequency distribution) with 0% and 100% levels of the acquired waveform data as the Low and the High levels, respectively, calculates the Low and High levels using the histogram.	Data number 100% 0% 100%

# 11 Waveform Calculation Function

Waveform calculations can only be used with the Memory function.

A pre-specified calculation equation is applied to acquired waveform data and the calculated results are displayed as a waveform on the Waveform screen.

Waveform calculation settings are made in the [Wave Calc] sheet.

#### To Open the [Wave Calc] Sheet



#### **Operations Available From the [Wave Calc] Sheet**



In addition to the four arithmetic operators, 11 types of functions can be used. It is possible to set up to 16 calculation formulas.

When Scaling is enabled, numerical calculations are performed on scaled values.

MEM

### **11.1 Waveform Calculation Workflow**

There are two different ways of performing calculation.

Calculate While Measurement:
 Apply Calculations to Existing Data:
 Calculation can be performed on waveform data after measurement is completed, and for data saved on storage media.



- Waveform calculation is not available when using Roll Mode or Memory Division.
- If waveform calculation is performed during measurement and you force the instrument to stop during calculation, the result of calculations already performed when calculation is canceled will be displayed. To re-calculate, select the **[Exec]** button in the **[Wave Calc]** sheet.

#### Apply Calculations to Existing Data



- The maximum recording length that can be calculated is given below. Model MR8847-51: 10,000 div (if using the U8975, U8977, or U8978: 5,000 div) Model MR8847-52: 40,000 div (if using the U8975, U8977, or U8978: 20,000 div) Model MR8847-53: 80,000 div (if using the U8975, U8977, or U8978: 40,000 div)
- To perform calculation on waveforms that are longer than the maximum recording length, save the files in sections with ranges shorter than the maximum recording length, then reload the files into the instrument, and perform the calculation.
- Up to 16 previously measured waveforms can be referenced when memory division is **[OFF]**. If waveform calculations have been conducted for these waveforms, waveform data will be deleted except for the currently referenced block (the block that includes calculation data).

#### To specify a waveform range for calculation

Before executing a calculation, specify the calculation range using the AB cursors (div or Trace cursors) on the Waveform screen. Set the calculation range on the [Wave Calc] sheet to [A-B Cursor].

• Range cursors cannot be used to specify the range.

• When one cursor is used, the calculation range is from the cursor to the end of the data.

Post-measurement waveform calculation cannot be performed for waveforms measured in excess of the maximum recording length, even if a range is specified with the A and B cursors. To perform calculation on waveforms measured at long recording lengths, save the files in sections with ranges shorter than the maximum recording length, reload to the instrument then calculate. Refer to "7.2 Specifying the Waveform Range (Cursors A and B)" (p. 145) and "11.2 Waveform Calculation Settings" (p. 256).

#### To change calculation settings and recalculate

Make changes to calculation contents on the **[Wave Calc]** sheet, and execute the calculation. Refer to "11.2 Waveform Calculation Settings" (p. 256).

# When calculation waveform is not displayed or when you want to display only a desired waveform

The displayed sheet and calculated waveform to be displayed can be selected on the **[Wave Calc]** sheet.

Refer to "11.2.3 Change the Display Method for Calculated Waveforms" (p. 261).

## **11.2 Waveform Calculation Settings**

#### Procedure

#### To display the screen

Press the STATUS key to open the Status screen, and then select the [Wave Calc] sheet.

#### **1** Enable the Waveform Calculation function.

Move the cursor to [Wave Calculation], and select [On].

+ 【Wave Cacl Settin	ng 🕽	
Wave Calculation	On	) 1

#### 2 Specify the waveform calculation range. Move the cursor to [Calc Area].

Whole Wave	Applies calculations to the whole waveform. (Default setting)
A-B Wave	Applies calculations to the data between AB cursors.

Refer to "7.2 Specifying the Waveform Range (Cursors A and B)" (p. 145).

#### **3** Set a calculation equation.

Move the cursor to the **[Equation]** column of the calculation to be set and select **[Enter EQN]**. A dialog is displayed for entering a calculation equation.

Calc Area	Whole Wave	2

When selecting **[A-B Wave]**, specify the calculation range using the AB cursors on the Waveform screen. If no measurement data has been acquired by the instrument, first measure once so that the range can be specified for calculations to be applied to subsequent measurements. The calculation result will be 0 for the part outside of the range of the AB cursor.



#### **4** Set a calculation equation.

Refer to Waveform Equation Example: (p. 262).

#### **5** Select [Confirm] when entry is finished.

The entered equation is displayed in the **[Equation]** column.

The scale (maximum and minimum values) of the calculation results has a default setting of **[Auto]**. If you want to change the scale, set the maximum and minimum values under **[Manual]**.

Refer to "Change the Display Method for Calculated Waveforms" (p. 261).

#### 6 (As needed)

Set auto-save (p. 96) and auto-print (p. 127).

#### 7 Execute the calculation.

#### Apply Calculations to Existing Data

In the [Wave Calc] sheet, select [Exec].

# No Equation Z1 = ABS(CH1) + CH2 + CH3 - (CH4 + CH5) Z2 ? Z3 ? Z4 ? Z5 ? Z6 ?

#### To calculate while measuring

Press the **START** key to start measurement. Calculation waveforms are displayed after loading waveforms.

#### If "=" is displayed

The entered calculation equation is syntactically correct. If "?" is displayed

The equation has a syntax error. The cursor is placed at the location of the error to facilitate correction.

Are parentheses correctly matched?
Has a multiplication operator "\*" been omitted?

# 11.2.1 Displaying the Waveform Calculation Results

The results of waveform calculation are displayed on the Waveform screen.



#### To copy settings from one calculation to another

Settings can be copied in the **[Wave Calc]** sheet. Refer to "8.9 Copying Settings to Other Channels (Copy Function)" (p. 183).

#### **About Calculation Equations**

#### Operators

Operators	Name	Operators	Name
ABS	Absolute Value	DIF2	2nd Derivative
EXP	SCI	INT2	2nd Integral
LOG	Common Logarithm	SIN	Sine
SQR	Square Root	COS	Cosine
MOV	Moving Average	TAN	Tangent
SLI	Parallel displacement along the time axis	ASIN	Inverse Sine
DIF	1st Derivative	ACOS	Inverse Cosine
INT	1st Integral	ATAN	Inverse Tangent
		PLCS	PLC delay shift

Refer to "11.3 Waveform Calculation Operators and Results" (p. 264).

#### **To Enter Calculation Equations**

- Each calculation equation may contain up to 80 characters.
- Each constant in a calculation equation may contain up to 30 digits.
- For multiplication, use [\*]. For division, use [/].
- Entering a long, complex formula such as that shown below will cause [?] to be displayed. Separate the formula into two shorter formulas.

- If a formula tries to divide by 0, an overflow value will be output. (For positive values, +9.9999E+29. For negative values, -9.9999E+29.)
- The result of calculation Z<sub>i</sub> can be used in other calculation equations. However, the Z<sub>n</sub>th equation can only refer to the results of equations up to Z<sub>n-1</sub>.
   (Example: Equation Z can include the results of equations Z through Z )
  - (Example: Equation  $Z_4$  can include the results of equations  $Z_1$  through  $Z_3$ .)

#### Using the MOV, SLI, DIF and DIF2 operators in an equation (The second parameter)

Set a number <u>after the comma</u> within the parenthesis (\_\_,#) for each of these calculation operators.

Operators	Settings	Setting Examples
MOV (Moving Average) SLI (Horizontal Movement)	Set the number of moving points to average over. Setting Range MOV (Moving Average): 1 to 5000 SLI: -5000 to 5000	Calculate the 10-point moving average of CH1: MOV(CH1,10)
DIF (Derivative) DIF2 (2nd Derivative)	Specify the sampling interval over which to calculate the derivative. "1" is normally acceptable, but this should be set larger to capture fluctuation values of slowly changing waveforms. DIF and DIF2 Setting Range: 1 to 5000	Calculate the derivative of CH2 using a 20-point sampling interval: DIF(CH2, 20)

#### When calculation results overflow (OVER)

- The value at the AB cursor is not a correct value.
- When [Scale] is set to [Auto], waveforms appear at the top or bottom edge of the screen. This makes calculation result overflow obvious.

## 11.2.2 Setting Constants

#### Procedure

#### To display the screen

Press the STATUS key to open the Status screen, and then select the [Wave Calc] sheet.

- **1** Move the cursor to the No. that you want to set in the [CONST.] section.
- **2** Select an entry method, and enter the constant.

Setting Range: -9.9999E+29 to +9.9999E+29 Refer to "8.1.3 Entering Alphanumeric Characters" (p. 163).

Defined constants are shown in the constant display of the calculation equation setting dialog.

	CONST.					
1 (	a	0.0000	])i	0.0000		
Ì	b	0.0000	j	0.0000		
	С	0.0000	k	0.0000		
	d	0.0000	1	0.0000		
	е	0.0000	m	0.0000		
	f	0.0000	n	0.0000		
	g	0.0000	0	0.0000		
	h	0.0000	р	0.0000		

. . . . . . . . . . .

# 11.2.3 Change the Display Method for Calculated Waveforms

#### Procedure

#### To display the screen

Press the STATUS key to open the Status screen, and then select the [Wave Calc] sheet.



#### 1 Enable waveform display and display color.

Move the cursor to the [Wave] column.

ON-OFF	Selects show (ON [default setting]) or hide (OFF) for the waveform in the flash cursor column.				
$\uparrow\downarrow$	Selects the waveform color.				
ALL ON-OFF	Selects On to display all waveforms. Select Off to hide all waveforms.				

#### **2** Select a method to set scaling.

Move the cursor to the **[Scale]** column of the Calculation No. you want to set.

Auto	Automatically sets the display range of the vertical axis. (After calculation, the upper and lower limits are obtained from the results, and set automatically.)
Manual	Upper and lower limits of the vertical axis display range are entered manually.

# **3** Set the upper and lower limits of the display range. (When [Manual] is selected)

#### Select [Lower] and [Upper].

Select an entry method and enter the limit values. Entry range: -9.9999E+29 to +9.9999E+29 Refer to "8.1.3 Entering Alphanumeric Characters" (p. 163).

#### **4** Specify the physical units.

Move the cursor to the **[Unit]** column. Select an entry method and enter the physical units. Refer to "8.1.3 Entering Alphanumeric Characters" (p. 163).

#### **5** Select the graph to be displayed.

(When the split screen [Format] item on the [Status] sheet is **[Dual]** or higher) Move the cursor to the **[Graph]** column and select the graph number. Depending on calculation results, automatic scaling settings may be unsatisfactory, in which case the limits must be entered manually.

# Waveform Calculation Example: Calculate the RMS Waveform from the Instantaneous Waveform

This example shows how the RMS values of the waveform input on Channel 1 can be calculated and displayed.

The process below shows calculation on waveform data measured for one cycle over two divisions.

#### **1** Enable the Waveform Calculation function.

Move the cursor to [Wave Calculation], and select [On].

**2** Specify the waveform calculation range.

Move the cursor to the items in [Calc Area], and select [Whole Wave].

#### **3** Set a calculation equation.

Move the cursor to the **[Equation]** column of No. Z1 and then select **[Enter EQN]**.

A dialog is displayed for entering a calculation equation.

Characters are entered before the black cursor. Errors are indicated by red cursors.

After selecting the channel number, select [Enter Char].

Enter the calculation equation		/ CU1 - <b>ETT</b>	2001)							
SQR(MOV(CH1*CH1,200))	JUKIMUV		,20077							
The number of samples per cycle (1 division =	()	,	Channe		1 - 16	C00			Undo	Clear
100 samples).	4 5	5 <del>-</del> 6 +	MOV	SLI	DIF	INT	СН.	CH1 CH2	Home	End
Here, one cycle is two divisions (200 samples).	7 8	9 *	DIF2	INT2	SIN	COS		CH3 CH4	<<	$\rightarrow$
Enter numerical values	0.	E /	TAN	ASIN	ACOS	ATAN	PLCS	CH5	Enter	ESC
and symbols.	CUNST.				IIn	it :H	IGH RES	CH5		
	a=	0.0000	1=	0.0000	Mo	de :V	oltage	CH8		
	b=	0.0000	]=	0.0000	Ra	nge :5	mV	CH10		
It is convenient to set the	C=	0.0000	k=	0.0000				CH11 CH12		
constants beforehand on	u=	0.0000	1=	0.0000				CH13		
	6- f-	0.0000	m-	0.0000				CH14		
the [CONSI.] section.	d=	0.0000 0 0000	0=	0.0000						
(p. 260)	6- h=	0.0000 0.0000	n=	0.0000					J	
			P							

**4** Select [Confirm] when entry is finished.

The entered equation is displayed in the [Equation] column.

ĺ	No		
l	Z1	=	SQR(MOV(CH1*CH1,200))
l	Z2	?	
l	Ζ3	?	
l	Ζ4	?	
1	75	0	

	No			
	Z1,	3	$\square$	
	Z2	?		
	Z3	?	TE a	
74 and	Z4	?	l⊏d	uation] liei
Zi and	Z5	?		
	Z6	?		
n	Z7	?		
. (	78	2		
are indicated b	y rec	d c	ursor	S.
orl				

нокі

Status

【Wave Cacl Setting】

1Wave Calculation

Num Calc

On

Memo

#### **5** Execute the calculation.

Press the **START** key to start measurement. The calculation waveform is displayed after acquiring the input waveform.



To view the calculated waveforms of loaded data, navigate to the **[Wave Calc]** sheet and select **[Exec]**.

# 11.3 Waveform Calculation Operators and Results

Waveform calculation type	Description			
Four Arithmetic Operators ( +, −, *, / )	Executes the corresponding arithmetic operation.			
Absolute Value (ABS)	$b_i =  d_i $ (i = 1, 2, n)			
Exponent (EXP)	$b_i = \exp(d_i)$ (i = 1, 2, n)			
Common Logarithm (LOG)	When $d_i > 0$ $b_i = \log_{10} d_i$ When $d_i = 0$ $b_i = -\infty$ (overflow value output)When $d_i < 0$ $b_i = \log_{10}   d_i   (i = 1, 2,n)$ Note: Use the following equation to convert to natural logarithm calculations. $LnX = \log_e X = \log_{10} X / \log_{10} e$ 1 / $\log_{10} e = 2.30$			
Square Root (SQR)	$\begin{array}{l} d_i \geq 0 \ \mathcal{O} \ \mathcal{E} \ \mathcal{E} \ b_i = \sqrt{d_i} \\ d_i < 0 \ \mathcal{O} \ \mathcal{E} \ \mathcal{E} \ b_i = -\sqrt{ d_i } \ (i = 1, 2, \cdots n) \end{array}$			
Moving Average (MOV)	When k is an odd numberWhen k is an even number $bi = \frac{1}{k} \sum_{t=i-\frac{k}{2}}^{i+\frac{k}{2}} (i=1,2,n)$ $bi = \frac{1}{k} \sum_{t=i-\frac{k}{2}+1}^{i+\frac{k}{2}} (i=1,2,n)$ $dt:$ t-th data of the source channel k: number of points to move (1 to 5000) 1 div = 100 points.k is specified after a comma. (Ex.) To make Z1 the moving average of 100 points: MOV(Z1_100) For k/2 data at the beginning and end of the calculation section, the places that lack			
Parallel displacement along the time axis (SLI)	<ul> <li>Moves waveforms along the time axis by the specified distance.</li> <li>b<sub>i</sub> = d<sub>i-k</sub> (i = 1, 2, n)</li> <li>k: number of points to move (-5000 to 5000)</li> <li>k is specified after a comma. (Ex.) To slide Z1 by 100 points along the time axis: SLI(Z1<u>100</u>)</li> <li>Note: When sliding a waveform, if there is no data at the beginning or end of the calculation result, the voltage value becomes zero. 1 div = 100 points.</li> </ul>			
Sine (SIN)	$b_i = sin(d_i)$ (i = 1, 2, n) Trigonometric and inverse trigonometric functions employ radian (rad) units.			
Cosine (COS)	$b_i = \cos(d_i)$ (i = 1, 2,, n) Trigonometric and inverse trigonometric functions employ radian (rad) units.			
Tangent (TAN)	$b_i = tan(d_i)$ (i = 1, 2,, n) Where $-10 \le b_i \le 10$ Trigonometric and inverse trigonometric functions employ radian (rad) units.			
Arcsine (ASIN)	When $d_i > 1$ $b_i = \pi / 2$ When $-1 \le d_i \le 1$ $b_i = asin (d_i)$ When $d_i < 1$ $b_i = -\pi / 2$ Trigonometric and inverse trigonometric functions employ radian (rad) units.			
Arccosine (ACOS)	When $d_i > 1$ $b_i = 0$ When $-1 \le d_i \le 1$ $b_i = acos(d_i)$ When $d_i < -1$ $b_i = \pi$ (i = 1, 2, n)Trigonometric and inverse trigonometric functions employ radian (rad) units.			

 $b_i$ : i-th data of the calculation result,  $d_i$ : i-th data of the source channel

Waveform calculation type	Description
Arctangent (ATAN)	$b_i = \operatorname{atan}(d_i)$ (i = 1, 2,, n) Trigonometric and inverse trigonometric functions employ radian (rad) units.
	The first and second derivative calculations use a fifth-order Lagrange interpolation polynomial to obtain a point data value from five sequential points. $d_1$ to $d_n$ . are the derivatives calculated for sample times $t_1$ to $t_n$ .
	differentiated. If scattering is excessive, try to increase the value of the second parameter of the function.
	Refer to "Using the MOV, SLI, DIF and DIF2 operators in an equation (The second parameter)" (p. 259)
	The following equations are the cases where the value of the second parameter is 1.
	Formulas for the first derivative
	Point $t_1 b_1 = (-25d_1 + 48d_2 - 36d_3 + 16d_4 - 3d_5) / 12h$
	Point $t_2 b_2 = (-3d_1 - 10d_2 + 18d_3 - 6d_4 + d_5) / 12h$ Point $t_2 b_2 = (d_1 - 8d_2 + 8d_2 - d_5) / 12h$
First derivative (DIF) Second derivative	↓ Point $t_i b_i = (d_{i-2} - 8d_{i-1} + 8d_{i-1} - d_{i+2}) / 12h$ ↓
(DIF2)	Point $t_{n-2} b_{n-2} = (d_{n-4} - 8d_{n-3} + 8d_{n-1} - dn) / 12h$ Point $t_{n-1} b_{n-1} = (-d_{n-4} + 6d_{n-3} - 18d_{n-2} + 10d_{n-1} + 3d_n) / 12h$ Point $t_n b_n = (3d_{n-4} - 16d_{n-3} + 36d_{n-2} - 48d_{n-1} + 25d_n) / 12h$
	$b_1$ to $b_n$ : calculation results $h = \Delta t$ : Sampling period
	Formulas for the second derivative
	Point $t_1 b_1 = (35d_1 - 104d_2 + 114d_3 - 56d_4 + 11d_5) / 12h^2$ Point $t_2 b_2 = (11d_1 - 20d_2 + 6d_3 + 4d_4 - d_5) / 12h^2$ Point $t_3 b_3 = (-d_1 + 16d_2 - 30d_3 + 16d_4 - d_5) / 12h_2$
	$ \underset{i}{\downarrow} Point t_i b_i = (-d_{i-2} + 16d_{i-1} - 30d_i + 16d_{i+1} - d_{i+2}) / 12h^2 $
	$ \stackrel{\downarrow}{\text{Point } t_{n-2} b_{n-2}} = (-d_{n-4} + 16d_{n-3} - 30d_{n-2} + 16d_{n-1} - d_n) / 12h^2  \text{Point } t_{n-1} b_{n-1} = (-d_{n-4} + 4d_{n-3} + 6d_{n-2} - 20d_{n-1} + 11d_n) / 12h^2  \text{Point } tn bn = (11 - d_{n-4} - 56d_{n-3} + 114d_{n-2} - 104d_{n-1} + 35d_n) / 12h^2 $

11

Waveform calculation type	Description
	First and second integrals are calculated using the trapezoidal rule. $d_1$ to $d_n$ are the integrals calculated for sample times $t_1$ to $t_n$ .
First integral (INT) Second integral (INT2)	Formulas for the first integral Point $t_1 I_1 = 0$ Point $t_2 I_2 = (d_1 + d_2) h / 2$ Point $t_3 I_3 = (d_1 + d_2) h / 2 + (d_2 + d_3) h / 2 = I_2 + (d_2 + d_3) h / 2$ $\downarrow$ Point $t_n I_n = I_{n-1} + (d_{n-1} + d_n) h / 2$ $I_1$ to $I_n$ : calculation results $h = \Delta t$ : Sampling period Formulas for the second integral Point $t_n I_n = 0$
	Point $t_1 H_1 = 0$ Point $t_2 H_2 = (I_1 + I_2) h / 2$ Point $t_3 H_3 = (I_1 + I_2) h / 2 + (I_2 + I_3) h / 2 = H_2 + (I_2 + I_3) h / 2$ $\downarrow$ Point $t_n H_n = H_{n-1} + (I_{n-1} + I_n) h / 2$ $H_1$ to $H_n$ : calculation results Note: Integration is greatly affected by subtle deviation in the zero position. Be sure to perform zero adjustment before measurement. In some cases, you may need to correct zero point deviation further. Example: To shift the zero position by 0.124 mV $Z1 = INT (CH_1 = 000124)$
Digital Voltmeter Unit PLC delay shift (PLCS)	Shifts the time by the length the frequency (PLC) delay or NPLC delay set with the MR8990 Digital Voltmeter Unit. Since the Digital Voltmeter Unit obtains the average during the period set with the NPLC, it observes the waveform that delays half the period of the NPLC compared with the 8966 Analog Unit. The PLCS calculation shifts the time by the length of this delay to correct the deviation from the Analog Unit.
	zero.

h	· i-:	th	data	of th	- calci	Ilation	result	d.	i₋th	data	of	the	SOURCE	channel	
$\nu_{i}$		uι	uala	OI UI		lation	resuit,	$u_i$ .	i-u i	uala	UI.	uie	Source	Charmer	

# **12 Memory Division Function MEM**

The Memory division function can only be used with the Memory function. Memory division settings are made on the Status screen - [Memory Div] sheet. Blocks to be displayed can also be selected on the Waveform screen. (p. 157)

#### To display the [Memory Div] sheet





When using memory division, the trigger output (TRIG\_OUT terminal output) may output the Low level or output erratically under the following conditions.

- The timebase is 5  $\mu s/div$  to 100  $\mu s/div.$
- The record (measurement) time is 5 ms or less.
- Tracking wave display is [OFF].

12

#### **Operations Available From the [Memory Div] Sheet**

- Waveforms can be recorded into individual blocks by dividing memory space into multiple blocks.
- You can record waveforms beginning at any block (**Start Block**), choose which blocks to display (**Display Block**), or display multiple overlaid blocks (**Reference Block**).
- The maximum number of blocks for memory division depends on recording length. (The maximum is 1024 blocks [512 blocks when using Model U8975, U8977, or U8978].)
- Triggered waveform data can be acquired continuously and recorded sequentially in specified blocks (from the **Start Block**, for the specified Used Blocks). Dead time while displaying or printing (during which triggers are ignored) can be minimized.
- Even if you do not use the Memory Division function, up to 16 blocks of data (depending on the specified recording length) can be saved to each block so that previously recorded data can be selected for display on the Waveform Screen.

Refer to "7.8 Viewing Waveforms Divided Into Blocks" (p. 157).



# 12.1 Configuring the Recording Settings

#### Procedure

#### To display the screen

Press the STATUS key to open the Status screen, and then select the [Memory Div] sheet.

#### Enable the Memory Division function.

Move the cursor to [Memory Div]. and select [On].

Off	Memory Division is disabled. (Default setting)
On	Memory Division is enabled.

	–【Memory divisi	on setting】
1	Memory Di∨	On
2	Division	4
3	Shot	25d i v
	Recording Peri	od( 2.500ms
4	Start Block	1
5	Use Blocks	1

#### 2 Set the number of divisions.

Move the cursor to **[Division]**. Set the number of blocks for division. Default setting: 4

#### **3** Set the recording length.

(This is linked to the recording length setting on the [Status] sheet.)

Move the cursor to [Shot].

Set the recording length.

The maximum recording length and number of divisions are determined automatically according to memory capacity and the number of channels used.

Setting Range: "Appx. 2.4 Maximum Recording Length and Number of Divisions (Memory Division Function)" (p. Appx.11)

#### **4** Set the start block.

#### Move the cursor to [Start Block].

Set the block number at which to start recording. Default setting: 1

#### **5** Set the number of Used Blocks.

Move the cursor to **[Use Blocks]**. Set the number of blocks to be used. Default setting: 1 Memory Division, Waveform Calculation, and Roll Mode cannot be enabled at the same time.

#### About Recording

When a faster timebase is selected, display, print and save operations are not available during measurement, until recording is done for all blocks. Selecting the displayed screen for auto-saving lengthens dead time.

#### To display any block on the waveform screen when measuring is completed

Set the number of blocks to display. (p. 270) (This can also be set on the Waveform screen (p. 157))

#### To display overlaid waveforms

Set the number of blocks for reference. (p. 270)

# 12.2 Configuring the Display Settings

#### Procedure

#### To display the screen

Press the **STATUS** key to open the Status screen, and then select the **[Memory Div]** sheet.



#### **3** (When Reference Blocks are set to [ON]) Select whether to reference every block.

To overlay all waveforms, select [All Biks ON].

All Blks Off	Turns off reference to all blocks.
All Blks On	Turns on reference to all blocks.

To overlay selected waveforms, move the cursor to the number column of the reference block and select the block number.

Ref On-Off	Sets On or Off. If <b>[On]</b> is selected, the block frame of the selected block number is displayed as a green square.
$\uparrow \downarrow$	Selects a block.

# 4 When displaying waveforms for each acquired waveform in the block

#### Enable tracking waveform display.

Move the cursor to **[Wave Display]**. and select **[On]**.

Off	The waveform of the specified Display Block will be displayed after recording the specified number of Used Blocks. (Default setting)
On	Waveforms are displayed one block at a time as they are acquired at each trigger event.

# To View Memory Division waveforms on the Waveform screen

Refer to "7.8 Viewing Waveforms Divided Into Blocks" (p. 157).



Reference Block (Light Green)

The colored blocks indicate blocks where measurement data has been recorded.

Reference Block Selection

Reference Blocks can also be selected and deselected using **[Ref Block]** on the [List] display. Refer to "To get details on each block" (p. 271).

Setting the Trace Waveform display to [ON] lengthens dead time. About Dead Time:

Refer to "Difference between dead times during normal and memory division recording" (p. 272).

Even if the Roll Mode is enabled (other than **[OFF]**), it cannot be used when the Trace Waveform display is set to **[OFF]**.

#### To get details on each block

The trigger time and measurement status of each block can be viewed on the list.

# Move the cursor to the [Map/List], and select [List].

	ſ	Map/L	ist 🛛	List					
	ſ	No.	Trigger	time	Source	Timebase	Data	Use Block	Ref Block
		1	09-06-23 16:4	40:33.093	Ch1	10µs/div	2501	0	
BIOCK INO		2	09-06-23 16:4	40:34.968	Ch1	10µs/div	2501	0	
		3	09-06-23 16:4	40:36.023	Ch1	10µs/div	2501	0	
	0		00.00.00.40	40.00.000	<b>01</b> 4	ا م <b>ر</b> ا	0504	~	

Blocks can be selected with the **Up/down CURSOR** or **F** keys. You can move the cursor to the **[Ref Block]** column to set a block as a Reference Block.

#### To switch block waveforms on the Waveform screen

To select the block you want to see, press the **WAVE** key on the Waveform screen and switch Pos to Block.

Refer to "7.8 Viewing Waveforms Divided Into Blocks" (p. 157).

• When displaying memory division blocks as a list, blocks may have the same trigger times. This occurs because the minimum resolution of the clock used by this instrument is 1/128th of a second (7.8125 ms) and measurement occurs during this interval.



• If triggers occur continuously within an interval shorter than 500 µs, the displayed trigger time may indicate time slower than the actual triggers.

#### Difference between dead times during normal and memory division recording

# When both printer recording (auto-print) and auto-save are set for continuous triggering [Repeat].

Anomalous phenomena occurring during dead times are not detected.



Times during which sampling is inhibited due to internal processing, printing or saving.

#### When the trace waveform display is [Off] during memory division recording



The waveform data of each recording length is recorded in one block.

# When recording with memory division, dead time is shorter than with normal recording.

• The dead time (the period where no sampling occurs between blocks) of memory division is as follows.

5 µs/div to 20 µs/div: 1 to 8 samples

Timebase slower than 50 µs/div: 1 sample

Note: Dead time is longer when you use calculation functions or when the timebase is set between 5 and 20 µs/div and tracking waveform display is **[ON]**.

- When measuring with a Model 8970 Freq Unit, dead time is approximately 230 ms. When measuring in [Count] mode, there are cases when the last data in a previous block is carried over to the first part of the next block.
- When tracking waveform display is [Off], the roll mode function cannot be used, even when roll mode is enabled (other than [Off]).
- When triggering occurs very often, pressing the **STOP** key may not stop measurement until enough data has been acquired to fill the blocks specified for use.

#### Auto-save and auto-print for memory division recording

Measurement conditions	Auto-save and auto-print				
With Numerical calculation ON	Auto-save, auto-print and Waveform Display are performed every time one block is measured (when Tracking wave display is ON).				
When timebase is 5 µs/div to 20 µs/ div and Tracking wave display is ON	Auto-save, auto-print and Waveform Display are performed every time one block is measured.				
When timebase is 5 µs/div to 20 µs/ div and Tracking wave display is OFF	Auto-save and auto-print are performed after all blocks are measured.				
Other than above	Auto-save and auto-print and Waveform Display are performed simultaneously with measurement (when Tracking wave display is ON).				

# **FFT Function**

# **13.1 Overview and Features**

FFT analysis can only be used with the FFT function.

The FFT (Fast-Fourier Transform) functions perform frequency analysis on input signal data. Use these functions for frequency analysis of measurement targets such as rotating objects, vibrations, and sounds.

For details about FFT, refer to "Appx. 4 FFT Definitions" (p. Appx.24).

Analysis can be performed on data as it is being measured, on pre-existing analog waveform data previously acquired with the Memory function, and on data output from waveform calculations. When Model 8968 High Resolution Unit or Model U8979 Charge Unit, each of which is equipped with the anti-aliasing filter, is used, the cut-off frequency can be set automatically by linking with the frequency range setting.

#### **Major Features**

- FFT analysis frequency range: 133 mHz to 8 MHz (if using the U8975, U8977, or U8978: 4 MHz)
- FFT Analysis Modes (16 types)
  - Storage Waveform
  - Histogram
  - Linear Spectrum
  - RMS Spectrum
  - Power Spectrum
  - Power Spectrum Density\*
  - LPC Analysis (Power Spectrum Density)\*
  - Transfer Function
  - \* Not available when using external sampling.
- Cross Power Spectrum
- Impulse Response
- Coherence Function
- Phase Spectrum
- Auto-correlation Function
- Cross-correlation Function
- 1/1 Octave Analysis\*
- 1/3 Octave Analysis\*

For phase spectra, only the required phase information is highlighted and displayed. (Highlight) Refer to "13.3.8 Highlighting Analysis Results (Phase Spectra Only)" (p. 285).

When performing FFT analysis with the instrument connected to a sound level or vibration meter, scaling by dB can be set from the Channel Settings screen if you want to read values directly in calibrated units of measurement. Refer to "Scaling" (p. 292).

To suppress the effects of aliasing distortion caused by sampling

We recommend using Model 8968 High Resolution Units that are equipped with anti-aliasing filtering to suppress the effects of aliasing distortion when sampling.

About aliasing distortion and anti-aliasing filters, refer to "Appx. 4 FFT Definitions" (p. Appx.24).

Refer to "18.3.4 FFT Function" (p. 387) for FFT function specifications.





### **13.2 Operation Workflow (Reference Data)**

#### Installation and Connection

Turn on the instrument

"2 Preparing for Measurement" (p. 27)



\*1: Settings are the same as for the Memory function.

\*2: Even after analysis, save and print settings can be set manually.

## **13.3 Setting the FFT Analysis Conditions**

You can choose basic measurement configuration settings on the Status screen - [Status] sheet. Measurement can also be configured from the Waveform screen. (p. 291)

#### To display the [Status] Sheet





### 13.3.1 Selecting the FFT Function

The FFT function can be selected at screens other than the file screen.

#### Procedure

- **1** Move the cursor to the function item (the upper most column of the Settings window).
- 2 Select [FFT].

24-Jul	11:17:05
Funct	ion:
 FFT	•

# 13.3.2 Setting the Data Source for Analysis (Reference Data)

Select the data to be used for FFT analysis.

There are two analysis methods: analysis using new measurements and analysis of data measured using the memory function.

#### Procedure

#### To display the screen

Press the **STATUS** key to open the Status screen, and then select the **[Status]** sheet. See "13.3.11 Setting and Changing Analysis Conditions on the Waveform Screen" (page 291)

#### **1** Select the reference data.

Move the cursor to [Reference].

New Data	Acquires a new waveform for analysis.
From Memory	Calculates data measured using the memory function.

# 2 When you have finished choosing settings, press the START key.

#### When using [New Data]

Measurement starts to acquire data for the number of analysis points specified as the [Sampling Point], and FFT analysis is performed.

#### When using [From Memory]

Analysis is performed on the number of specified points from data previously recorded in memory (Memory function data).

The analysis starting point can also be specified. Refer to "13.8.1 Calculating After Specifying the Calculation Starting Point" (p. 300).

The frequency range is selected automatically. Refer to "Relationship between frequency range, resolution and number of analysis points" (p. 278).

	【FFT】	
1	Reference	New Data
2	Sampling Point -Frequency Range	1000 8MHz

### When the input data [Reference] is [From Memory]

Analysis is performed until the specified number of FFT analysis points have been processed, then the data is shifted by that amount and analysis repeats until all of the previously acquired data has been processed. (If the amount of data is less than the specified number of FFT analysis points, no analysis occurs.)

# When no trace is displayed after pressing the **START** key.

Analysis is not possible if **[From Memory]** is selected as the input data source and no recorded data exists in the instrument's memory. Either select **[New Data]** as the input data source, or load the data to be analyzed before pressing the **START** key again.

When **[Reference]** is set to **[From Memory]**, the frequency is automatically set. The setting cannot be changed.

### 13.3.3 Setting the Frequency Range and Number of Analysis Points.

#### About the frequency range and number of analysis points

- The settings for the frequency range and number of analysis points determine the input signal acquisition time and frequency resolution.
- **The frequency range** setting for the FFT function corresponds to the timebase setting of the Memory function.

Changing the frequency range also changes the data sampling period. Refer to "Relationship between frequency range, resolution and number of analysis points" (p. 278).

- The cut-off frequency of the anti-aliasing filter is the same as the frequency range setting. Refer to "Relationship between frequency range, resolution and number of analysis points" (p. 278).
- The set number of analysis points specifies the amount of data to be analyzed with each measurement.

Increasing the number of analysis points increases the frequency resolution, but also increases the time required for calculations.

Refer to "Number of Analysis Points" (p. Appx.26).

#### To perform calculations on external sampling

Set the Sampling Clock to **[External]**. (External sampling). In this case, octave analysis, power spectrum density and LPC Analysis (power spectrum density) are not available.

#### <u>When [Reference] is set to [From Memory], the frequency is automatically set.</u> <u>The setting cannot be changed.</u>

#### Frequency range and number of analysis points setting: Use the operating keys

#### To display the screen

Press the **STATUS** key to open the Status screen, and then select the **[Status]** sheet. Refer to "13.3.11 Setting and Changing Analysis Conditions on the Waveform Screen" (p. 291).

1	Set the number of FFT analysis points. Move the cursor to [Sampling Point].		【FFT】 Reference	New Data		
	1000 (Default setting), 2000, 5000, 10000	12	Sampling Point	1000 8MHz •		
2	Refer to "Number of Analysis Points" (p. Appx.26). Select the frequency range. Move the cursor to [Frequency Range].	-	Res(Recording time) 20kHz(50µs) Frequency Resolution (during acquisition)			
	8 MHz (Default setting), 4 MHz, 2 MHz, 800 kHz, 400 kHz, 200 kHz, 80 kHz, 40 kHz, 20 kHz, 8 kHz, 4 kHz, 2 kHz, 800 Hz, 400 Hz, 200 Hz, 80 Hz, 40 Hz, 20 Hz, 8 Hz, 4 Hz, 1.33 Hz, 800 mHz, 667 mHz, 400 mHz, 333 mHz, 133 mHz, External		The resolution is affected by of the selected frequency range and number of analysis points. Not displayed for external sampling.			
	If using Model U8975, U8977, or U8978, the 8 MHz range will not be available (the default setting will be 4 MHz). Refer to "Relationship between frequency range, resolution and number of analysis points" (p. 278).	To si M [F T au	o control sampling b gnal, select <b>[Extern</b> <b>/hen the input data</b> <b>From Memory]</b> he frequency range utomatically when a	y an external nal]. a [Reference] is is set nalysis is started	ł.	

	Sampling frequency [Hz]	Timebase [/div] (MEM)	Sampling period	Number of FFT analysis points							
Range [Hz]				1,000		2,000		5,000		10,000	
				Resolution	Acquisition	Resolution	Acquisition	Resolution	Acquisition	Resolution	Acquisition
				[Hz]	interval	[Hz]	interval	[Hz]	interval	[Hz]	interval
8 M <sup>*1*2</sup>	20 M	5 µs	50 ns	20 k	50 µs	10 k	100 µs	4 k	250 µs	2 k	500 µs
4 M <sup>*2</sup>	10 M	10 µs	100 ns	10 k	100 µs	5 k	200 µs	2 k	500 µs	1 k	1 ms
2 M <sup>*2</sup>	5 M	20 µs	200 ns	5 k	200 µs	2.5 k	400 µs	1 k	1 ms	500	2 ms
800 k <sup>*2</sup>	2 M	50 µs	500 ns	2 k	500 µs	1 k	1 ms	400	2.5 ms	200	5 ms
400 k <sup>*2</sup>	1 M	100 µs	1 µs	1 k	1 ms	500	2 ms	200	5 ms	100	10 ms
200 k <sup>*2</sup>	500 k	200 µs	2 µs	500	2 ms	250	4 ms	100	10 ms	50	20 ms
80 k <sup>*2</sup>	200 k	500 µs	5 µs	200	5 ms	100	10 ms	40	25 ms	20	50 ms
40 k	100 k	1 ms	10 µs	100	10 ms	50	20 ms	20	50 ms	10	100 ms
20 k	50 k	2 ms	20 µs	50	20 ms	25	50 ms	10	100 ms	5	200 ms
8 k	20 k	5 ms	50 µs	20	50 ms	10	100 ms	4	250 ms	2	500 ms
4 k	10 k	10 ms	100 µs	10	100 ms	5	200 ms	2	500 ms	1	1 s
2 k	5 k	20 ms	200 µs	5	200 ms	2.5	400 ms	1	250 ms	500 m	2 s
800	2 k	50 ms	500 µs	2	500 ms	1	1 s	400 m	2.5 s	200 m	5 s
400	1 k	100 ms	1 ms	1	1 s	500 m	2 s	200 m	5 s	100 m	10 s
200	500	200 ms	2 ms	500 m	2 s	250 m	4 s	100 m	10 s	50 m	20 s
80	200	500 ms	5 ms	200 m	5 s	100 m	10 s	40 m	25 s	20 m	50 s
40	100	1 s	10 ms	100 m	10 s	50 m	20 s	20 m	50 s	10 m	100 s
20	50	2 s	20 ms	50 m	20 s	25 m	40 s	10 m	100 s	5 m	200 s
8 <sup>*3</sup>	20	5 s	50 ms	20 m	50 s	10 m	100 s	4 m	250 s	2 m	500 s
<b>4</b> <sup>*3</sup>	10	10 s	100 ms	10 m	100 s	5 m	200 s	2 m	500 s	1 m	1 ks
1.33 <sup>*3</sup>	3.33	30 s	300 ms	3.33 m	300 s	1.66 m	600 s	666 µ	1.5 ks	333 µ	3 ks
800 m <sup>*3</sup>	2	50 s	500 ms	2 m	500 s	1 m	1 ks	400 µ	2.5 ks	200 µ	5 ks
667 m <sup>*3</sup>	1.67	60 s	600 ms	1.66 m	600 s	833 µ	1.2 ks	333 µ	3 ks	166 µ	6 ks
400 m <sup>*3</sup>	1	100 s	1 s	1 m	1 ks	500 µ	2 ks	200 µ	5 ks	100 µ	10 ks
333 m <sup>*3</sup>	833 m	120 s	1.2 s	833 µ	1.2 ks	416 µ	2.4 ks	166 µ	6 ks	83.3 µ	12 ks
133 m <sup>*3</sup>	333 m	300 s	3 s	333 µ	3 ks	166 µ	6 ks	66.6 µ	15 ks	33.3 µ	30 ks

#### Relationship between frequency range, resolution and number of analysis points

The cut-off frequency of the anti-aliasing filter is the same as the frequency range.

\*1 If using Model U8975, U8977, or U8978, the 8 MHz range will not be available.
\*2 The anti-aliasing filter is Off.
\*3 Cut-off frequency is 20 Hz.

### 13.3.4 Decimating and Calculating Data

When performing FFT analysis of data measured using the memory function, the measurement data can be decimated before calculation.

If the sampling frequency is too high and you get unexpected results, decimate the data before calculation to increase the frequency resolution.



#### Procedure

#### To display the screen

Press the STATUS key to open the Status screen, and then select the [Status] sheet.

#### **1** Select the reference data.

Move the cursor to **[Reference]**, and select **[From Memory]**.

#### **2** Select the decimating rate.

Move the cursor to [Save Thin].

OFF	Does not decimate data. (Default setting)
1/10	Decimates points every 10 data points.
1/100	Decimates points every 100 data points.
1/1000	Decimates points every 1000 data points.

1	Reference	From Memory			
2	Save Thin	OFF			
_	Sampling Point	1000			
	Frequency Range	4MHz			
	Res(Recording ti	me) 10kHz(100µs)			

13

**FFT** Function

- The [Save Thin] setting can only be set when [Reference] is set to [From Memory].
- The range that can be set for thinning changes depending on the timebase measured by the memory function.
- The frequency is selected automatically. The setting cannot be changed.
- When thinning, aliasing occurs and waveforms that did not originally exist may be observed. Make settings after sufficient consideration of the frequencies included in waveforms.

### 13.3.5 Setting the Window Function

The window function defines the segment of the input signal to be analyzed. Use the window function to minimize leakage errors (p. Appx.31). There are three general types of window functions:









· Exponential window

Hamming window

Hann window

- Blackman window
- Blackman-Harris window
- Flat top window

The non-rectangular window functions generally produce lower-level analysis results. The attenuation introduced by the non-rectangular window functions can be corrected by applying attenuation correction to bring analysis results back levels similar to those of a rectangular window.

#### Procedure

#### To display the screen

Press the **STATUS** key to open the Status screen, and then select the **[Status]** sheet. See "13.3.11 Setting and Changing Analysis Conditions on the Waveform Screen" (page 291)

#### **1** Select the window function.

Move the cursor to [Window].

Rectangular (Default setting), Hanning, Exponential, Hamming, Blackman, Blackman Harris, Flat-top.

Refer to "Window Function" (p. Appx.31).

#### 2 When [Exponential] is selected

#### Set the attenuation coefficient (percentage).

Move the cursor to **[Attenuation rate]**. Set the attenuation coefficient as a percentage.

1	-Window	Exponentioal			
	<b>2</b> Attenuation rate	1%			
	<b>3</b> Compensation	None			
	(Compensation ra	te) x1.000	(0.00dB)		
	Analyze 】				

#### Correction value

Noise is suppressed in the attenuated waveform.



When the attenuation rate is 10%

#### **3** Set attenuation correction.

Move the cursor to [Compensation].

None	Attenuated window function values are not corrected. (Default setting)
Power	The window function multiplies the power levels of the time-domain waveform so that output levels are comparable to those of a rectangular window.
Average	The window function multiplies the average value of the time-domain waveform so that output levels are comparable to those of a rectangular window.

When a window function is rectangular The correction value is always 1 (0 dB).
### 13.3.6 Configuring the Analysis Result Peak Value Setting

You can display local or global maxima ([maximal]/ [maximum]) of the input signal and analysis results on the Waveform screen. However, if Nyquist display is selected on the Status screen - [Status] sheet, no peak values are displayed.

#### Procedure

#### To display the screen

Press the STATUS key to open the Status screen, and then select the [Status] sheet.

#### To select peak value display.

Move the cursor to [Peak].

Off	Not displayed. (Default setting)	
Maximal	(local maxima) When the value of data at a point is greater than that of the adjacent points, that point is considered a local maximum. The ten largest local maxima are displayed.	
Maximum value	(global maxima) Among all data values, the ten points with the greatest values are displayed.	



- No maxima will be displayed if peak values cannot be detected.
- Peak values on the Waveform screen can be displayed and printed, but cannot be saved as peak values in text files.
- Depending on the split screen status, it may not be possible to display ten peak values. In such cases, as many items as possible will be displayed, starting from the largest item.



Example: When the reference data setting is [From Memory].

### 13.3.7 Averaging Analysis Results (Waveform Averaging)

The averaging function calculates the average of the values obtained from multiple measurements of a periodic waveform.

This can reduce noise and other non-periodic signal components. Averaging can be applied to a timedomain waveform or to a spectrum.

#### Procedure

#### To display the screen

Press the STATUS key to open the Status screen, and then select the [Status] sheet.

#### **1** Enable averaging.

Move the cursor to [Average].

OFF	Averaging is disabled. (Default setting)
Linear (Time axis)	Time-domain waveforms are summed and averaged and then calculation is performed.
Expo. (Time axis)	The exponential mean of time-domain waveforms is determined and then calculation is performed.
Linear (Frequency)	Frequency-domain waveforms are summed and averaged and then the calculation result is output.
Expo. (Frequency)	The exponential mean of frequency-domain waveforms is determined and then the calculation result is output.
Peak (Frequency)	The maximum value of frequency-domain waveforms is retained.

#### **2** Select the count for averaging.

Move the cursor to [Number].

Select the number of measurements to be averaged. Setting range: 2 to 10000

	Format	Single Standard
	Peak	Off
1	Average	Linear (Time axis) -
2	Number	2
	Highlight(phase)—	Off -

#### About averaging calculation formulas Refer to "Averaging" (p. Appx.30).

# When averaging and auto-save or auto-print are enabled at the same time

Data is saved or printed after the specified number of values has been averaged.

Refer to "Trigger Modes and Averaging" (p. 284).

- After measuring with averaging enabled, display is not available when the channel is changed. Also, when the analysis mode is changed, the analysis modes that can be displayed are limited.
- When averaging is performed with analysis mode disabled (Off), no trace will be displayed when the analysis mode is changed after measurement.
- When [Format] is set to [Running spectrum], [Average] cannot be used.

#### To average time-domain waveform values

Waveforms are acquired and averaged within the time domain. FFT calculation is performed after averaging.

When the trigger mode is **[Auto]**: When the **START** key is pressed, data will be acquired after a certain interval even if trigger criteria are not met. This means that if averaging is applied to an asynchronous signal, the resulting data is meaningless.

Synchronous signals have better SNR (signal-to-noise ratio) and are more suitable for analysis.

#### To average spectrum values

Acquired data is first subject to FFT analysis. After analysis, averaging is performed within the frequency range, and the result is displayed. This differs from time-domain averaging in that averaging can be performed without trigger synchronization. However, if the characteristics of the input waveform allow triggering, using the trigger for synchronization is recommended.

#### To retain peak value on spectrum (peak hold)

After performing FFT calculations on the acquired waveform, peak values are retained (held) and displayed within the frequency range.

#### • FFT Analysis Modes and Averaging

✓: Can be set, –: Cannot be set, ○: Can be partially set

	Averaging				
Analysis Mode	Time-domain waveform averaging		Spectrum averaging		
	Simple	SCI	Simple	SCI	Peak hold
OFF	-	_	-	-	_
Storage Waveform	~	~	-	-	_
Histogram	~	~	-	_	_
Linear Spectrum	~	~	° <sup>*2</sup>	° <sup>*2</sup>	° <sup>*2</sup>
RMS Spectrum	~	~	° <sup>*2</sup>	° <sup>*2</sup>	° <sup>*2</sup>
Power Spectrum	~	~	~	~	~
Power Spectrum Density <sup>*1</sup>	~	~	~	~	~
LPC Analysis (Power Spectrum Density) <sup>*1</sup>	~	~	_	_	_
Transfer Function	~	~	° <sup>*2</sup>	° <sup>*2</sup>	° <sup>*2</sup>
Cross Power Spectrum	~	~	° <sup>*2</sup>	° <sup>*2</sup>	° <sup>*2</sup>
Impulse Response	~	~	~	~	~
Coherence Function	-	-	~	~	_
Phase Spectrum	~	~	-	-	_
Auto-correlation Function	~	~	~	~	~
Cross-correlation Function	~	~	~	~	~
1/1 Octave Analysis *1	~	~	~	~	~
1/3 Octave Analysis <sup>*1</sup>	✓	~	~	~	~

\*1 Not available for external sampling

\*2 Not available when the y axis is real (linear) or imaginary (linear), and for Nyquist plots

**13** FFT Function

#### Trigger modes and averaging

#### If the trigger mode is [Single] or the calculation setting is [Once]

Measurement continues until the specified number of averaging points is acquired.



\*1: Awaiting trigger continues until the specified count is reached.

- \*2: Measurement stops automatically when the specified count is reached.
- If measurement was interrupted by the **STOP** key, the averaging result up to that point is displayed. \*3: If **[Reference]** is **[New Data]** and automatic saving or automatic print is **[On]**, data is saved or printed when the specified number of times is reached.

#### If the trigger mode is [Continue] or the calculation setting is [Repeat]

Measurement continues after the specified averaging count has been acquired. When the specified averaging count is exceeded, averaging is repeated and measurement continues until the **STOP** key is pressed.



\*1: When stopped before the specified count, the average up to that point is displayed.

\*2: If [Reference] is [New Data] and automatic saving or automatic print is [On], data is saved or printed when the specified number of times is reached.

#### When the trigger mode is [Auto]

· For time-domain waveforms

When the **START** key is pressed, after a certain interval data will be acquired even if trigger criteria are not met. This means that if averaging is applied to an asynchronous signal, the resulting data is meaningless.

For time-domain waveforms

When the **START** key is pressed, measurement starts. Even if the trigger criteria are not met, the specified amount of data is acquired, and after FFT analysis, the results are averaged. When the specified averaging count is exceeded, averaging is repeated and measurement continues until the **STOP** key is pressed.



\* When stopped before the specified count, the average up to that point is displayed.

### 13.3.8 Highlighting Analysis Results (Phase Spectra Only)

By specifying a setting factor (rate) to be applied to the input signal, the display of data that exceeds the resulting threshold can be emphasized. This feature is useful for viewing waveforms that may otherwise be obscured by noise.

The reliability of phase spectrum values is poor when discrete Fourier transform values are extremely small. For example, in the case of a pure sine wave, almost all phase values at frequencies other than the input frequency result from calculation errors. By treating the maximum value of the power (or cross-power) spectrum of the input signal,  $P_{max}$ , as a reference value, data that exceeds that value multiplied by rate *R* can be displayed with emphasis.



#### Procedure

#### To display the screen

Press the STATUS key to open the Status screen, and then select the [Status] sheet.

#### **1** Enable the highlighting function.

Move the cursor to [Highlight (phase)].

Off	Emphasis display disabled. (Default setting)
On	Emphasis display enabled.

1	Highlight(phase)—	On
2	Attenuation rate	1
3	(dB)	0dB

#### **2** Set the attenuation rate or attenuation value.

#### To set an attenuation rate

Move the cursor to **[Attenuation rate]**. Enter the attenuation rate. Refer to "8.1.3 Entering Alphanumeric Characters" (p. 163).

#### To set an attenuation value [dB]

Move the cursor to **[Attenuation rate]**. Enter the attenuation value. Refer to "8.1.3 Entering Alphanumeric Characters" (p. 163). Attenuation Rate and Value Attenuation value: A [dB] Attenuation rate: R

 $-A = 10\log_{10}R$  $1x10^{-6} \le R \le 1$  $0 \le A \le 60$ 

### 13.3.9 Configuring the Analysis Mode Settings

You can set the type of FFT analysis, channel(s), waveform display color and X and Y axes.

#### Procedure

#### To display the screen

Press the **STATUS** key to open the Status screen, and then select the **[Status]** sheet. See "13.3.11 Setting and Changing Analysis Conditions on the Waveform Screen" (page 291)



#### **1** Select the FFT analysis mode.

Move the cursor to the [Analyze] column of the Analysis No. you wish to set.

OFF	No analysis (Default setting)	Cross Power Spectrum	(p. 310)
Storage Waveform	(p. 302)	Impulse Response	(p. 311)
Histogram	(p. 302)	Coherence Function	(p. 312)
Linear Spectrum	(p. 303)	Phase Spectrum	(p. 313)
RMS Spectrum	(p. 305)	Auto-correlation Function	(p. 314)
Power Spectrum	(p. 306)	Cross-correlation Function	(p. 315)
Power Spectrum Density*	(p. 307)	1/1 Octave Analysis*	(p. 315)
LPC Analysis (Power Spectrum Density)*	(p. 308)	1/3 Octave Analysis*	(p. 315)
Transfer Function	(p. 309)		

\*Not available with external sampling enabled. Refer to "13.9.2 Analysis Mode Functions" (p. 320).

(When [List] is selected, a list of calculation types appears. To clear the display, press the CH.SET key.)

#### Select whether the waveform will be displayed and its color.

Move the cursor to the **[Wave]** column. Select whether to be display (ON/OFF) the waveform or not, and its color if displayed.

2

#### **3** When [Parameter] setting contents are displayed

#### Set the parameter.

Move the cursor to the [Parameter] column of the Analysis No.that you want to set.

Analysis Mode	Parameters	Settings		
1/1 Octave Analysis,	Filter: Normal	Sets the octave filter.		
1/3 Octave Analysis	Filter: Sharp	Refer to "Octave Filter Settings" (p. 288).		
	1ch FFT	Calculates the phase of [Ch1].		
Phase Spectrum	2ch FFT	Calculates the phase difference between [Ch1] and [Ch2].		
LPC (density)	Order: 2 to 64	Larger numerical values make finer spectrum components visible.		

#### **4** Select the channel for analysis.

Move the cursor to [Ch1]. Select which channel number to use.

# **5** Set the horizontal and vertical axes displaying the calculation results.

Move the cursor to the **[X Axis]** or **[Y Axis]**. Set the contents of the calculation results to be displayed on the horizontal and vertical axes. (Selectable display contents vary by analysis mode.) Refer to "Analysis Modes and X/Y Axis Display" (p. 288).

#### Y-axis display

Lin-Mag	Displays analysis results as amplitude values.
Log-Mag	Displays analysis results as dB values. The dB reference is 1 eu. Example: For voltage, 1 V is displayed as 0 dB.
Lin-Real	Displays the real-number component of analysis values.
Lin-Imag	Displays the imaginary component of analysis values.

#### X-axis display

Linear	Frequency-axis is displayed linearly.
Log	Frequency-axis is displayed logarithmically. This is convenient when the data of interest is at the lower end of the frequency range, such as when measuring sound and vibration.

**To analyze using external sampling** The horizontal axis (x-axis) displays the number of data points.

#### To copy settings to another calculation No.

Refer to "8.9 Copying Settings to Other Channels (Copy Function)" (p. 183).

FFT Function

For the following analysis modes, set both channels 1 and 2. Transfer Function, Impulse Response, Cross-correlation Function, Cross Power Spectrum, Coherence Function, Phase Spectrum (2ch FFT)

#### Octave Filter Settings

Filter features are based on IEC61260 standards.



After determining the entire power spectrum, the instrument performs octave analysis defined by the above filter characteristics.

Refer to "Octave Filter Characteristics" (p. Appx.35).

#### Analysis Modes and X/Y Axis Display

✓: Settable, –: Unsettable

	X-axis		Y-axis				Nyquiot
Analysis Mode	Linear	Log	Amplitude (Linear)	Amplitude (dB)	Lin-Real (Linear)	Lin-Imag	Disp
OFF	-	_	-	-	_	-	-
Storage Waveform	~	_	~	_	_	-	-
Histogram	~	_	~	_	_	-	-
Linear Spectrum	~	~	~	~	~	~	~
RMS Spectrum	~	~	~	~	~	~	_
Power Spectrum	~	~	~	~	_	_	_
Power Spectrum Density	~	~	~	~	_	-	_
LPC Analysis (Power Spectrum Density)	~	~	~	~	_	_	-
Transfer Function	~	~	~	~	~	~	~
Cross Power Spectrum	~	~	~	~	~	~	~
Impulse Response	~	_	~	_	_	-	_
Coherence Function	~	~	~	_	_	_	_
Phase Spectrum	~	~	~	_	_	-	_
Auto-correlation Function	~	_	~	_	_	-	_
Cross-correlation Function	~	_	~	_	_	_	_
1/1 Octave Analysis	-	~	~	~	_	-	-
1/3 Octave Analysis	_	~	~	~	_	_	_

The X/Y axes cannot be set when Nyquist Display is selected.

#### Total Harmonic Distortion (THD)

When the analysis mode is linear spectrum, RMS spectrum or power spectrum the cursor appears and the distortion rate is calculated.

(Linear spectrum, RMS spectrum, power spectrum)

The distortion rate calculates the cursor position as the fundamental wave. When two cursors appear, the A cursor becomes the fundamental wave.

When calculation results cannot be obtained, [---%] is displayed.

Note that distortion rate values may become higher depending on the window function settings.

THD = 
$$\sqrt{\frac{\sum (V_n)^2}{(V_0)}} \times 100$$
 [%]

V<sub>0</sub> = fundamental wave

 $V_n = next$  higher harmonic

### 13.3.10 Setting the Display Range of the Vertical Axis (Scaling)

The display range of the vertical (Y) axis can be set to automatically for analysis results and can be freely expanded and compressed.

#### Procedure

#### To display the screen

Press the STATUS key to open the Status screen, and then select the [Status] sheet.

# Select automatic or manual scaling of the Y-axis display.

Move the cursor to the **[Scale]** column of the Analysis No. you want to set.

Auto	Scaling of the vertical (Y) axis is automatically set according to analysis results. (Default setting)
Manual	Scaling of the vertical (Y) axis can be set as desired, to suit the measurement. This is useful for magnifying or reducing the displayed amplitude, and for shifting the displayed waveform up or down.



#### **2** When [Manual] is selected.

#### Set the upper and lower limit value.

Move the cursor to **[Lower]** or **[Upper]**. Set the upper and lower limits to display the analysis results.

Setting range: -9.9999E+29 to +9.9999E+29

(with exponent from E-29 to E+29)

Refer to "8.1.3 Entering Alphanumeric Characters" (p. 163).

#### To copy settings to another calculation No.

Refer to "8.9 Copying Settings to Other Channels (Copy Function)" (p. 183).

# 13.3.11 Setting and Changing Analysis Conditions on the Waveform Screen

The following settings can be made on the Waveform screen.

Changes to the displayed analysis results take effect when the settings are changed.

- Available settings are frequency range, number of analysis points, type of window function, trigger mode and pre-triggering.
- Available display type settings are analysis number, analysis mode, waveform color, analysis channel and X/Y-axis.
- Trigger settings (p. 214) (Note: If [Reference] is [From Memory], triggers cannot be set.)

#### Setting Descriptions

#### To display the screen

Press the **DISP** key to open the Waveform screen.



### **13.4 Configuring the Channel settings**

Channel selection is the same for all functions.

For the setting method, refer to "3.4 Configuring Input Channels Settings" (p. 70) and "8.10 Setting Details of Modules" (p. 184).

#### Scaling

The scaling setting allows values displayed on the instrument to match the actual values read directly on a sound level meter or vibration meter.



Setting example: To display measurement data on the instrument so that it corresponds with a sound level meter.

In this case the sound level meter displays 93.5 dB and the overall value displayed on the Waveform screen of the instrument is –6.51 dB.



## 13.5 Configuring the Screen Display Settings

Set the display method for FFT calculation results.

#### Procedure

#### To display the screen

Press the STATUS key to open the Status screen, and then select the [Status] sheet.

#### **1** Select the display format.

Move the cursor to **[Format]**. Select the format of data to be displayed. The display format depends on the input data selected for analysis.

1	Format	Single Standard
	Peak	Off
	Average	Linear (Time axis)
	Number	2

Single Standard	The FFT calculation results are displayed in one screen. If the calculations have multiple settings, waveforms will be overlaid. Note: Depending on the analysis mode settings, only analysis No.1 may be displayed.	
Dual Standard	The FFT calculation results are displayed in two screens. If the calculations have multiple settings, waveforms are displayed for each specified calculation.	To use an existi for analysis Select [From M
Single Nyquist*	If the analysis mode is linear spectrum, transfer function or cross power spectrum, the FFT calculation result is displayed in a Nyquist display on two screens. If the calculations have multiple settings, waveforms will be overlaid.	data source for Refer to "13.3.2 Source for Analy (p. 276).
Dual Nyquist*	If the analysis mode is linear spectrum, transfer function or cross power spectrum, the FFT calculation result is displayed in a Nyquist display on one screen. If the calculations have multiple settings, waveforms are displayed for each specified calculation.	point Specify the start memory wavefo Refer to "13.8.1 Specifying the C Point" (p. 300).
Running Spectrum	If the analysis mode is one of the following, analysis results will be displayed in three- dimensions: frequency, oscillation and time. (Linear spectrum, RMS spectrum, power spectrum, power spectrum density, LPC analysis, transfer function, cross power spectrum, 1/1 octave analysis, 1/3 octave analysis) If the calculations have multiple settings, display of No1 will take priority.	

\* The horizontal axis and vertical axis display the real parts and the imaginary parts of calculation results, respectively.

#### **2** Press the DISP key to display the Waveform screen.

#### To use an existing memory waveform for analysis

Select **[From Memory]** as the input data source for **[Reference]**. Refer to "13.3.2 Setting the Data Source for Analysis (Reference Data)" (p. 276).

## To specify the analysis starting point

Specify the starting point on the memory waveform. Refer to "13.8.1 Calculating After Specifying the Calculation Starting Point" (p. 300).

When "Drawing failed" is displayed
NG: Nyquist, Running Spectrum
The display format settings and analysis mode do not match.
• NG: X-Axis
Either change the [Format] setting and increase the number of screen divisions or change the display setting of the X-axis.
Linear and logarithmic X-axes cannot be displayed on the same graph.
• NG: X-unit
Set <b>[Format]</b> and increase the number of screen divisions. Different horizontal axis units cannot be displayed on the same graph.
• NG: EXT
Analysis mode cannot perform external sampling.

### **Display Types and Split-Screen Settings**

Nine display arrangements are available.

	Nor	mal	Nyc	Running Spectrum	
	Single standard	Dual standard	Single Nyquist	Dual Nyquist	Running spectrum
[Reference] setting	[New Data]	[From Memory]	[New Data]	[From Memory]	[New Data]
One division	FFT	FFT	Nyquist	Nyquist	Running spectrum
Two divisions	FFT FFT	MEM FFT FFT	Nyquist	MEM Nyquist Nyquist	

### 13.5.1 Displaying the Running Spectrum

If **[Format]** is set to **[Running spectrum]**, you can observe changes in frequency over time.



#### Procedure

#### To display the screen

Press the STATUS key to open the Status screen, and then select the [Status] sheet.

1	Select the reference data.	Reference	New Data
	nove the cursor to [Reference], and select [New Data].	Sampling Point Frequency Range Res(Recording t	1000 - 8MHz ime) 20kHz(50µs)
2	Select the display format. Move the cursor to [Format], and select [Running spectrum].	Format Peak -Average	Runningspectrum Off Off

- [Running spectrum] can only be set when [Reference] is [New Data].
- The calculation interval (time interval of the running spectrum waveform and the waveform) is not regulated.
- Averaging cannot be used.
- Calculations that can be analyzed by running spectrum are limited to the following list. When other calculations are selected or calculation settings are changed after measurement stops, waveforms will not be displayed.

(Linear spectrum, RMS spectrum, power spectrum, power spectrum density, LPC analysis, transfer function, cross power spectrum, 1/1 octave analysis, 1/3 octave analysis)

• When running spectrum is displayed, the auto-save/auto-print during measurement cannot be performed.

#### Procedure

#### To display the screen

Press the **DISP** key to open the Waveform screen.



### To read measurement values of past waveforms with the cursor

After measurement is finished, the values of each waveform can be read using the cursor.

**1** Press the WAVE key on the panel of the instrument.

#### **2** Select a waveform.

Use the jog and shuttle knobs to select the waveform. (The waveform number is displayed in the lower right of the screen.)

#### **3** Move the cursor.

Press the **AB CSR** key, then rotate the jog and shuttle to read the cursor value.

Older waveforms have larger numbers.







### **13.6 Saving Analysis Results**

The procedure to save analysis results is the same as for the Memory and Recorder functions. Refer to "5 Saving/Loading Data and Managing Files" (p. 91).

The size of saved files depends on the save format and analysis method. Refer to "Appx. 2.1 Waveform File sizes" (p. Appx.2).

#### • When FFT analysis results are saved as text

Each calculation item is saved to a separate file.

#### Text save example

″8847″ <b>◄</b>	Line 1: Title comment
"FFT number of points", "Frequency range", "Trigger date", "Trigger time", "Overall", "THD"	Line 2 and 3: Trigger time
1000 , 400012 , 00 00 04 , 10.47.20.001 , 01.020m , 0.10%	
"No","Analysis method","Analysis Channel 1","Units"	Calculation information
2, Linear spectrum, tho, [V]	· · · · · · · · · · · · · · · · ·
"Frequency[Hz]","[V]"	
+0.000000E+00,+7.174499E-04	
+1.000000E+03,+1.663352E-05	
12.00000ET03,T0.030207ET06	
+4, 000000E+03, +2, 946144E-05	
+5.000000E+03,+4.513562E-05	
+6.000000E+03,+6.034131E-05	
+7.000000E+03,+6.403472E-05	
+8.000000E+03,+8.428788E-05	
+9.000000E+03,+9.635616E-05	
+1.00000E+04,+1.523813E-04	
+1 200000E+04,+1 887871E-04	
+1 300000E+04 +1 921578E-04	
+1.400000E+04.+2.516198E-04	
+1.500000E+04,+3.108865E-04	
+1.600000E+04,+3.912515E-04	
+1.700000E+04,+5.484038E-04	
+1.800000E+04,+8.432313E-04	
+1.900000E+04,+1./09446E-03	
+2.00000E+04,+8.634/60E-02	
12.100000_104,11.014074_00	
X-axis data Y-axis data	

If trigger time is not displayed properly when you open a file with Microsoft Excel<sup>®</sup>, select "Custom" for [Format] of [Format Cells] and enter "hh:mm:ss.000" for Type.

## **13.7 Printing Analysis Results**

The printing procedure is the same as for the Memory and Recorder functions. Refer to "6 Printing Data" (p. 125).

#### Example waveform print



## 13.8 Analyzing Waveforms on the Waveform Screen

### **13.8.1** Calculating After Specifying the Calculation Starting Point

The FFT function can specify the calculation start point for waveforms previously measured using the memory function.

Operation differs depending on the calculation execution settings. Refer to "Trigger Modes and Averaging" (p. 284).

#### Calculation execution: [Single]

The calculation is performed once on the specified number of calculation points beginning with the specified starting point, and the analysis results are displayed. This is convenient for calculating only data belonging a specific range. However, if the averaging is enabled, the calculations repeats for the specified averaging count.

#### Calculation execution: [Repeat]

The calculations are performed repeatedly on the specified number of calculation points beginning with the specified starting point and ending with end of waveform data, and final analysis results are displayed. (The calculations are performed for the number of specified points so a good end point becomes the final analysis result.)

#### To verify the calculation starting point while viewing analysis data





the number of analysis points up to the end of the waveform data is analyzed, and the last data is displayed.

Memory waveforms are not printed.

13

FFT Function

## 13.9 FFT Analysis Modes

### 13.9.1 Analysis Modes and Display Examples

For the functions of each analysis mode, refer to "13.9.2 Analysis Mode Functions" (p. 320).

#### Storage

#### This displays the time-domain waveform of the input signal.

When the window function setting is other than rectangular, the window function is applied to the time-domain waveform before it is displayed.

Axis	Display type	Description
X-axis	Linear	Time-domain display Displays the value of the time-domain waveform corresponding to the set frequency range. Refer to "Relationship between frequency range, resolution and number of analysis points" (p. 278).
Y-axis	Lin-Mag	Displays the module waveform.

#### Waveform Example



Window: Rectangular X-axis: Linear Y-axis: Lin-Mag

#### Histogram

#### This acquires the amplitude distribution of the input signal. Main uses:

- To inspect deviations in the amplitude range of a waveform
- To check analysis point distribution to ascertain whether a waveform is artificial or natural About the Functions, refer to "13.9.2 Analysis Mode Functions" (p. 320).

Axis	Display type	Description
X-axis	Linear	Displays input level of the input signal.
Y-axis	Lin-Mag	Displays analysis data distribution.

#### Waveform Example



#### Normal display

X-axis: Linear Y-axis: Lin-Mag

#### Linear spectrum

## The linear spectrum plots the input signal frequency. It can also be displayed as a Nyquist plot. Main uses:

- · To inspect the peak frequency contents of a waveform
- To inspect signal amplitudes at each frequency

About the Functions, refer to "13.9.2 Analysis Mode Functions" (p. 320).

Axis	Display type	Description
	Linear	Displays the frequency on a linear scale.
X-axis	Log	Displays the frequency on a logarithm scale.
	Nyquist display	The real-number component of analysis values is displayed linearly.
	Lin-Mag	Displays analysis values linearly.
	Log-Mag	Displays analysis results as dB values. (0 dB reference value: 1eu)*
Y-axis	Lin-Real	Displays the real-number component of analysis values.
	Lin-Imag	Displays the imaginary component of analysis values.
	Nyquist display	Displays the imaginary component of analysis values.

\* eu: engineering units that are currently set are the standard. (e.g., when the unit settings is volts, 0 dB = 1 V)

#### Waveform Example



Normal display X-axis: Log Y-axis: Lin-Mag

Normal display X-axis: Log

Y-axis: Log-Mag

#### Normal display

X-axis: Log Y-axis: Lin-Real

Normal display X-axis: Log Y-axis: Lin-Imag

						BBaby No.2 Linear Vi.DAB Y:Lin-Mat X:Linea Overall 70.73ay
	 	ii.	 1	1	÷	-140NY

• If the cursor is displayed, the total harmonic distortion (THD) with the fundamental wave set to the cursor position will be displayed. When two cursors appear, the A cursor becomes the fundamental wave. When results cannot be obtained, [---%] is displayed.

Nyquist display

• When only sine waves are input, the level of this component becomes approximately 1.4 times (3 dB) larger than the overall value. To measure at a reference the same as the overall value, analyze using RMS spectrum or power spectrum.

Refer to "RMS spectrum" (p. 305) and "Power spectrum" (p. 306).



The oscillation component (actual value) is calculated from the frequency axis waveform of the input signal.

RMS and power spectra displays use the same analysis results displayed logarithmically (amplitude in dB).

#### Main uses:

- To inspect the execution value of the frequency component of the waveform
- To inspect the RMS value of each frequency

About the Functions, refer to "13.9.2 Analysis Mode Functions" (p. 320).

Axis	Display type	Description
X avia	Linear	Displays the frequency on a linear scale.
A-axis	Log	Displays the frequency on a logarithm scale.
	Lin-Mag	Displays analysis values linearly.
Vavia	Log-Mag	Displays analysis results as dB values. (0 dB reference value: 1eu)*
T-AXIS	Lin-Real	Displays the real-number component of analysis values.
	Lin-Imag	Displays the imaginary component of analysis values.

\* eu: engineering units that are currently set are the standard. (e.g., when the unit settings is volts, 0 dB = 1 V)

#### Waveform example



If the cursor is displayed, the total harmonic distortion (THD) with the fundamental wave set to the cursor position will be displayed. When two cursors appear, the A cursor becomes the fundamental wave. When results cannot be obtained, [---%] is displayed.

Power spectrum

#### This displays input signal power as the amplitude component. Main uses:

- · To inspect the peak frequency contents of a waveform
- · To inspect the power level of each frequency

About the Functions, refer to "13.9.2 Analysis Mode Functions" (p. 320).

Axis	Display type	Description
V ovio	Linear	Displays the frequency on a linear scale.
A-0212	Log	Displays the frequency on a logarithm scale.
Vovia	Lin-Mag	Analysis data is displayed linearly as squared values. Indicates the power component.
1-0215	Log-Mag (logarithm)	Displays analysis results as dB values. (0 dB reference value: 1eu <sup>2</sup> )*

\* eu: engineering units that are currently set are the standard. (e.g., when the unit settings is volts, 0 dB = 1  $V^2$ )

#### Waveform example



#### Normal display X-axis: Log Y-axis: Lin-Mag

Normal display X-axis: Log Y-axis: Log-Mag

If the cursor is displayed, the total harmonic distortion (THD) with the fundamental wave set to the cursor position will be displayed. When two cursors appear, the A cursor becomes the fundamental wave. When results cannot be obtained, [---%] is displayed.

#### Power spectrum density

# This indicates the power spectrum density of the input signal with only the amplitude component included. This is the power spectrum divided by the frequency resolution. Main uses:

To acquire a power spectrum with 1 Hz resolution for highly irregular waveforms such as white noise About the Functions, refer to "13.9.2 Analysis Mode Functions" (p. 320).

Axis	Display type	Description
X-axis	Linear	Displays the frequency on a linear scale.
	Log	Displays the frequency on a logarithm scale.
Y-axis	Lin-Mag	Displays analysis values linearly.
	Log-Mag (logarithm)	Displays analysis results as dB values. (0 dB reference value: 1eu <sup>2</sup> /Hz)*

\* eu: engineering units that are currently set are the standard. (e.g., when the unit settings is volts, 0 dB =  $1 V^2$ )

#### Waveform example



Normal display X-axis: Log Y-axis: Lin-Mag

Normal display

X-axis: Log Y-axis: Log-Mag

Not available with external sampling enabled.

#### Linear predictive cording (LPC) analysis (Power spectrum density)

# When the spectrum shape is complex and hard to understand with either linear or power spectra, a rough spectrum structure can be obtained.

Main uses:

To obtain a spectral envelope using statistical methods About the Functions, refer to "13.9.2 Analysis Mode Functions" (p. 320).

Axis	Display type	Description
X-axis	Linear	Displays the frequency on a linear scale.
	Log	Displays the frequency on a logarithm scale.
Y-axis	Lin-Mag	Displays analysis values linearly.
	Log-Mag (logarithm)	Displays analysis results as dB values. (0 dB reference value: 1eu <sup>2</sup> /Hz)*

\* eu: engineering units that are currently set are the standard. (e.g., when the unit settings is volts, 0 dB = 1  $V^2$ )

#### Waveform example



X-axis: Log Y-axis: Lin-Mag

X-axis: Log Y-axis: Log-Mag

- Always specify the order (from 2 to 64). Higher orders can expose finer spectral details.
- · Amplitude values provided by LPC are not always the same as the power spectrum density.
- If an error occurs during analysis, no waveform will be displayed.
- Noise-like phenomena can strongly affect the spectrum shape.
- Not available with external sampling enabled.

#### Transfer function

# From the input and output signals, the transfer function (frequency characteristic) of a measurement system can be obtained. It can also be displayed as a Nyquist plot. Main uses:

- To inspect a filter's frequency characteristic
- To inspect the stability of a feedback control system (using the Nyquist plot)

• To inspect the resonance characteristic of an object using an impulse hammer and pick-up sensor About the Functions, refer to "13.9.2 Analysis Mode Functions" (p. 320) and "Linear Time-Invariant Systems" (p. Appx.25).

Axis	Display type	Description
X-axis	Linear	Displays the frequency on a linear scale.
	Log	Displays the frequency on a logarithm scale.
	Nyquist display	Displays the real-number component of the input-output ratio.
Y-axis	Lin-Mag	Displays the input-output ratio linearly. (dimensionless units)
	Log-Mag (logarithm)	Displays the input-output ratio as dB values.
	Lin-Real	Displays the real-number component of the input-output ratio. (dimensionless units)
	Lin-Imag	Displays the imaginary component of the input-output ratio. (dimensionless units)
	Nyquist display	Displays the imaginary component of the input-output ratio.

#### Waveform example











Normal display X-axis: Log Y-axis: Lin-Mag

#### Normal display

X-axis: Log Y-axis: Log-Mag

#### Normal display

X-axis: Log Y-axis: Lin-Real

#### Normal display

X-axis: Log Y-axis: Lin-Imag

#### Nyquist display

FFT Function

#### Cross power spectrum

The product of the spectra of two input signals can be obtained. Common frequency components of two signals can also be obtained.

Using the voltage and current waveforms as input signals, active power, reactive power and apparent power can be obtained for each frequency.

#### Main uses:

To inspect common frequency components of two signals About the Functions, refer to "13.9.2 Analysis Mode Functions" (p. 320).

Axis	Display type	Description
X-axis	Linear	Displays the frequency on a linear scale.
	Log	Displays the frequency on a logarithm scale.
	Nyquist display	Displays the real-number component of the input-output ratio linearly.
Y-axis	Lin-Mag	Displays the squared value of amplitude contents of analysis data linearly.
	Log-Mag (logarithm)	Displays the dB value of amplitude contents of analysis data linearly. (0 dB: reference value: $1eu^2$ )*
	Lin-Real	Displays the squared values of the real component of analysis data linearly.
	Lin-Imag	Displays the squared values of the imaginary component of analysis data linearly.
	Nyquist display	Displays the imaginary component of analysis data linearly.

\* eu: engineering units that are currently set are the standard. (e.g., when the unit settings is volts, 0 dB = 1  $V^2$ )

#### Waveform example



#### Normal display

X-axis: Log Y-axis: Lin-Mag

#### Normal display

X-axis: Log Y-axis: Log-Mag

#### Normal display

X-axis: Log Y-axis: Lin-Real

#### Normal display

X-axis: Log Y-axis: Lin-Imag

#### Nyquist display

#### Impulse response

#### This calculates the transfer characteristic of a system as a time-domain waveform. By using both output and input signals of a measurement system, a unit impulse is applied to the system and the corresponding response waveform is obtained.

#### Main uses:

To inspect circuit time constants

About the Functions, refer to "13.9.2 Analysis Mode Functions" (p. 320) and "Linear Time-Invariant Systems" (p. Appx.25).

Axis	Display type	Description
X-axis	Linear	Time display The center ( $t = 0$ ) is the reference. To the right is lag time (+ $t$ ), and to the left is lead time (- $t$ ).
Y-axis	Lin-Mag	Displays the transfer function provided by inverse Fourier transformation.

#### Waveform example



Normal display X-axis: Linear Y-axis: Lin-Mag

Input signal 1

Input signal 2

Impulse Response

FFT Function

#### Coherence function

# This function gives a measure of the correlation (coherence) between input and output signals. Values obtained are between 0 and 1.

Main uses:

To evaluate transfer functions

• In a system with multiple inputs, to inspect the effect of each input on the output About the Functions, refer to "13.9.2 Analysis Mode Functions" (p. 320).

Axis	Display type	Description
X-axis	Linear	Displays the frequency on a linear scale.
	Log	Displays the frequency on a logarithm scale.
Y-axis	Lin-Mag	Displays the causal relationship and degree of relationship between two input signals, as a value between 0 and 1. (dimensionless units).

#### Waveform example



Normal display X-axis: Log Y-axis: Lin-Mag

- With a single measurement, the coherence function gives a value of one for all frequencies. Spectrum (frequency-domain) averaging should always be performed before measurement (analysis is not available with time-domain averaging).
- The coherence function has two general definition formulas. For the definition formulas, refer to "13.9.2 Analysis Mode Functions" (p. 320).

#### Phase spectrum

#### This shows the phase characteristics of the input signal. Main uses:

- To inspect the phase spectrum of channel 1 Displays the phase of a cosine waveform as a reference (0°).
- To inspect the phase difference between channels 1 and 2

About the Functions, refer to "13.9.2 Analysis Mode Functions" (p. 320).

Although the unit for angle is [  $^{\circ}$  ], it is shown [deg] on the screen.

- 1ch FFT: Displays the phase of the signal on channel 1. Displays the phase of a cosine waveform as a reference (0°). Unless the waveform is synchronous, phase values are unstable.
- 2ch FFT: Displays the phase difference between channels 1 and 2. Positive values indicate that the phase of channel 2 is leading.

Axis	Display type	Description
X-axis	Linear	Displays the frequency on a linear scale.
	Log	Displays the frequency on a logarithm scale.
Y-axis	Lin-Mag	Displays analysis values linearly.

#### Waveform example



1ch FFT X-axis: Log Y-axis: Lin-Mag

2ch FFT X-axis: Log Y-axis: Lin-Mag

#### • Emphasizing only a specific portion (Highlighted display)

A specific portion of a phase spectrum can be emphasized and displayed. Refer to "13.3.8 Highlighting Analysis Results (Phase Spectra Only)" (p. 285).

#### Auto-correlation function

## This shows the correlation of two points on the input signal at time differential t. Main uses:

- To detect periodicity in irregular signals (improving and detecting SNR)
- · To inspect periodic components in a noisy waveform

About the Functions, refer to "13.9.2 Analysis Mode Functions" (p. 320).

Axis	Display type	Description
X-axis	Linear	Time display The center ( $t = 0$ ) is the reference. To the right is lag time (+ $t$ ), and to the left is lead time (- $t$ ).
Y-axis	Lin-Mag	+1 to -1 (dimensionless units) The closest correlation at time differential <i>t</i> is +1, and the least correlation is 0. -1 indicates completely reversed polarity. Because of the characteristics of the function, $t = 0$ becomes +1.

#### Waveform example



X-axis: Linear Y-axis: Lin-Mag

This instrument provides a circular auto-correlation function. Analysis results are normalized to the maximum value.

#### **Cross-correlation function**

# This shows the correlation of two points on tow input signals at time differential t. Output is displayed as a function of differential time *t*.

#### Main uses:

To determine the phase shift of two signals per unit of time

To determine the speed and distance of time lag between two signals About the Functions, refer to "13.9.2 Analysis Mode Functions" (p. 320).

 
 Axis
 Display type
 Description

 X-axis
 Linear
 Time display The center (t = 0) is the reference. To the right is lag time (+t), and to the left is lead time (-t).

 Y-axis
 Lin-Mag
 +1 to -1 is displayed in dimensionless units. At time differential t, this value is +1 when the correlation of input and output signals is the closest, and when correlation is the least the value is 0. -1 indicates completely reversed polarity.

#### Waveform example



X-axis: Linear Y-axis: Lin-Mag

This instrument provides a circular cross-correlation function. Analysis results are normalized to the maximum value.

#### 1/1 octave, 1/3 octave

# These analyze spectrums such as noise using fixed rate spectrum filters of 1/1 octave band or 1/3 octave band.

#### Main uses:

To analyze noise frequency

About the Functions, refer to "13.9.2 Analysis Mode Functions" (p. 320) and "Octave Filter Characteristics" (p. Appx.35).

Axis	Display type	Description
X-axis	Log	Displays the center frequency of each band.
Y-axis	Lin-Mag	Displays octave analysis values linearly.
	Log-Mag (logarithm)	Displays octave analysis values as dB values. (0 dB reference value: 1eu)*

\* eu: engineering units that are currently set are the standard. (e.g., when the unit settings is volts, 0 dB = 1 V)

#### Waveform example



Not available with external sampling enabled.

#### Octave analysis

Octave analysis consists of frequency analysis of the signal passed through a constant-width band-pass filter. The power spectrum displays the power level in each subband after dividing the spectrum into fixed-width segments (subbands), while octave analysis scales the spectrum logarithmically and displays each octave (subband) as a bar graph.

The center frequency of the octave bands and filter characteristics are determined according to IEC61260 standards. 1/1- and 1/3-octave analyses are calculated using power spectrum Analysis results. 1/1 Octave Analysis: 6 subbands 1/3 Octave Analysis: 16 subbands

The octave analysis results of this instrument are displayed based on the oscillation level as a reference. Therefore, when only sine waves are input, the value doubles (3.01 dB) versus the overall value. To directly read by energy base, adjust the level by the setting scaling in advance. Refer to "8.5 Converting Input Values (Scaling Function)" (p. 171).
3	1	7
_		

#### Measurable ranges with octave analysis

200		333m	133m	25		0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0													Τ													Τ	
061	07	1. z 333m	33m	24	ľ	-	╞	•	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0									1	+								$\left  \right $	$\mid$				+	-
6	3 -			53	╞	┢	$\vdash$	•	-	0	•	0	0	•	0	0	•	0	0	•	0	0	•	0	0							-	+	+		+	_				+	$\left  \right $	╞				+	
5	2 4	99	57m 4	22	╞	╞		_			•	0	0	•	0	0	•	0	0	•	0	0	•	0	0	•	0					_	+	+	-	-	_					$\vdash$	$\vdash$			_	+	-
g			00	5	╞	-	-		-		•	_	0	•	0	0	•	0	0	•	0	0	•	0	0	•	0	0	-				+	-	_	-	_			-		-	-		-		+	
0		33 00	33 80	0	╞	╞	┝		-	$\left  \right $		_		•	0	0	•	0	0	•	0	0	•	0	0	•	0	0	•	0		-	+	+		+	_				-		$\vdash$				+	-
[ [			; <del>- ·</del>	2	╞	-	╞					_		•	_		•		_	•	0	0	•	0	0	•	0	0	•	0	0	0	0	0	0	-							$\vdash$				+	-
1			4	1	╞	╞	$\vdash$					_			_					•			•	0	0	•	0	0	•	0	0	•	0	0	•	0	0	0				-	$\vdash$				+	
Ľ			200	18	┞										_			_					•			•	0	0	•	0	0	•	0	0	•	0	0	•	0	0	0	0					$\downarrow$	-
_	7 <sup>2</sup>	202	50	17	Ļ	Ļ									_											•			•	0	0	•			•		0	•	0		•		0	0	0		_	_
_	- 4		9	16	Ļ																								•			•			•		~	•	0		•			•	0	_		_
500m		200	8	15	L																											•			•	0	0	•	0		•			•	0	0	•	
200m		2005	200	14																																	0	•	0	0	•	0	0	•	0	0	•	
100m	1	= =	400	13																																				0	•	0	0	0 •	0	0	•	C
20m		7k	800	12																																							0	0 •	0	0	) ( •	0
20m		200 JJ	2k	11																																											) ( •	C
10m	100	100 H	4	10																																												
m2		20k	8	6	ſ	T																																									Ť	
mC		20 H	20k		t	T	T																										1									ſ	T				t	-
m		100k	40k	7	t	T									-																		1	1							-		t				+	
11 002	100	700k	80k	9	t	t	t	-																									†								T		t				+	-
11 000	H no	2 µ 200k	200k	2	t	ſ	ſ																										†	+									F				+	-
0011	H N	7 NI	400k	4	t	t	╞					-								-					-								+	+							+	t	ŀ				+	
U III	100	2M	Nook	m	t	t	┢					-			_																		†	+									╞				+	-
110	100	unu WS	2M 8	2	╞	┢	┢		-	$\vdash$		_			_					_								$\vdash$				-	+	+		+					-		╞				+	-
- 110		Z MO	4W	-	╞	-									_			_	_														+	+		-	_					-	$\vdash$				+	
11					╞	-	-		-			_		_			_			_					_		_		-	_	_	_	+	+	_	-	_				-	-	$\vdash$		-		+	
L.	5 5		100	ncy (	4m	Sm	. 3m	8m	10m	. 5m	16m	20m	25m	. 5m	40m	50m	63m	80m	00m	25m	60m	00m	50m	15m	00m	00m	30m	00m	-	. 25	1.6	2	2.5	. 15	4	2	6.3	00	10	2.5	16	20	25	1.5	40	50	63	00
		ICV [Hz]	[Hz]	Cente freque IHz		-	°			12		-		31		_				-	-	2	2	m	4	Ń	9	ő		-				m							-			m			$\downarrow$	_
a		1 frequer	cy range	1/3 0CT	-24	-23	-22	-21	-20	-19	-18	-17	-16	-15	-14	-13	-12	-11	-10	6-	8-	-7	9	-2	-4	ñ	-2	7	0		2	m	4	2	9	~	∞	6	10	12	12	13	14	15	16	17	20	10
nahas	Intends	ampline	requence	1/1 0CT	4	φ		L-			-9			-2			-4			ñ			-2			ī			0						2			m			4			2			9	

## 13 FFT Function

		54	101	1 20 1	50 11	100 11	1 200 u	20011	ļa,	2m	5m	10m	20m	50m 1	00m 20	0m 50	0m 1		5	1	30	50	60	100	120	300	
		H C	70	402	HAC -	ri nni	7007	Hone		1	₹		70				- ;			= ;			8	3	77	ŝ	
	1-11	noc	1001	2001	unoc un	7	2μ 5001-	5 µ	10/1	20 μ	50 µ	100 μ	200 /1	500 µ		5 5					m 200		000 P		7.1	2	
		MU2		No Po	W7	WUT	NUNC			AUC 10C	ZUK		X	7K	X 00						n -	7 000	00.1	- 07	1000	100-	
	7	۳ ۲	4W	W7	ouuk	400K	ZUUK	ouk	4UK	ZUK	X	4 <del>4</del>	7K	000	7 ∩1	° 2	¥ ∧	1		4		0	II/00	400		linc l	
	[Hz]	er ency 0	-	2	e	4	2	9	7	œ	6	10	11	12	13 1	4	10	12	1		50	21	22	23	24	25	
		100								ſ	$\mid$	$\vdash$	0	0	0	0			╞								
		125									f	0	0	• •	•	0											
		160										0	0	0	0	0											
		200									$\mid$	0	0	0	0	0	$\vdash$		╞	$\vdash$	$\vdash$	$\vdash$					
$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$		250									0	0	0	•	•												
$ \begin{array}{cccccccccccccccccccccccccccccccccccc$		315									0	0	0	0	0												
		400								t	0	0	0	0	0	╞	╞		╞	╞	$\vdash$	$\mid$					
		500								•	0	0					-			-	-						
		630								0	0	0	0														
		800							ſ	C	0	0	C	00	╞	╞	+	+	╞	╞		+					
		11	+												+	+	+	+	+	+	+	+	+				
	•	- K													+	+	+	+	+	+	+	+	+				
	-	Z5K							Э	Э	Э	Э	Э	┥	┤	+	+	+	+	+	+	$\downarrow$	$\downarrow$				
	-	. 6k							0	0	0	0	0				_	_	_	_	_						
$ \begin{array}{c c c c c c c c c c c c c c c c c c c $		2k						•	•	0 •	0	0	0 •														
$ \begin{array}{c c c c c c c c c c c c c c c c c c c $		. 5k						0	0	0	0	0															
$ \begin{array}{c c c c c c c c c c c c c c c c c c c $	m.	15k						0	0	0	0	0															
$ \begin{array}{c c c c c c c c c c c c c c c c c c c $		4k						•	0	0	0	0									-						
$ \begin{bmatrix} 8 \\ 8 \\ 1 \\ 1 \\ 1 \\ 1 \\ 1 \\ 1 \\ 1 \\ 1 \\$		21								C	C				+	+	+	+	+	+	+	+					
$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$	ľ	36			╞		C			C		t	$\dagger$	╞	╞	╞	╞	╞	╞	╞	╞	╞	╞				
$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$	1	ak ak										t	+	t	╞	╞	╞	╞	╞	╞	╞	╞					
$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$		10k								) C		+	+		+	+	+	+	+	+	+	+	_				
$ \begin{array}{c c c c c c c c c c c c c c c c c c c $	Ê	101		$\downarrow$	╞	C			C	C	t	t	$\dagger$	╞	╞	╀	╞	╞	╞	╞	╞	╞	╞				
$\begin{array}{c ccccccccccccccccccccccccccccccccccc$		16k								0	$\left  \right $	$\uparrow$	+		+	+	╞	+	+	+	+	-					
$ \begin{array}{c c c c c c c c c c c c c c c c c c c $		204									$\uparrow$	t	+	$\mid$	╞	+	╞	╞	╞	╞	╞	+	+				
$ \begin{array}{c c c c c c c c c c c c c c c c c c c $		754									t	t	$\dagger$	╞	╞	╀	╞	╞	╞	╞	╞	╞	╞				
$ \begin{array}{c c c c c c c c c c c c c c c c c c c $	, c	712	+							T	$\dagger$	$\dagger$	+	+	+	+	+	+	+	+	+	+	+				
$ \begin{array}{c c c c c c c c c c c c c c c c c c c $	2	1. 5K					•			+	+	+	+	+	+	+	+	+	+	+							
$ \begin{array}{c c c c c c c c c c c c c c c c c c c $		10L			1					t	$\dagger$	$\dagger$	$\dagger$	╎	┼	+	+	+	+	+	+	+	$\downarrow$				
$ \begin{array}{ c c c c c c c c c c c c c c c c c c c$		20K	+						Ť		+	+	+	+	+	+	+	+	+	+	+	+	+				
$ \begin{array}{c c c c c c c c c c c c c c c c c c c $		100							T	T	+	+		+	+	+	╞	+	+	+	+	+	+				
	ľ	100								T	+	+		╎	╀	+	╞	+	╀	+	+	╞	+				
		JEL								t	+			t	+	+	+	+	+	+	+	+	+				
$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$		107							T	+	+	+	+	+	+	+	+	+	+	+	+	+	+				
$\begin{array}{c c c c c c c c c c c c c c c c c c c $	- (	00K									+		+	+	+	+	+	+	+	+	+	+	+				
	7	200k					2								+	+	+	-	+		_	_	_				
	.4	20k	•	•	•	•	•			1	+	+	+	+	+	+	_	_	_	_	_	_	_				
400k       500k       0       0         500k       0       0       0       0         500k       0       0       0       0       0         1       1       1       1       1       1       1         1       1       1       1       1       1       1       1         1 <td>е</td> <td>115k</td> <td>0</td> <td>0</td> <td>0</td> <td>0</td> <td></td>	е	115k	0	0	0	0																					
500(       •	4	100k	0		0	0									-	╞	-	-	╞	╞							
630k       0	°	00k	•	•	•	•																					
	ľ	30k	0		0	0				t	t																
	ľ	100							T	t	t	t	t	╞	╞	╞	╞	$\mid$	╞	╞	╞	╞	$\mid$				
	1													+	+	+	+	+	+	+	+	+	+				
	ŀ	m nac							T	+	+	+		+	+	+	+	+	+	+	+	+	+				_
	- `	WC7							Ì	T	$\dagger$	$\dagger$	╋	╎	╎	┦	┦	+	┦	+	┦	$\downarrow$	$\downarrow$		$\downarrow$		
	_	- 6M				+	_		Ť	+	+	+	+	+	+	+	+	+	+	+	+	+	+	_			
	_	D W7				+			1	+	+	+	+	+	+	+	+	+	+	+	+	+	+	_			

# (•: 1/1 OCT, 0: 1/3 OCT)

300	m	333m	133m	25									
120	1.2	833m	333m	24									
100	1	1	400m	23									
60	600m	1.66	667m	22									
50	500m	2	800m	21									
30	300m	3. 33	1.33	20									
10	100m	10	4	19									
5	50m	20	∞	18									
2	20m	50	20	11									
-	10m	100	40	16									
500m	Sm	200	80	15									
200m	2m	500	200	14									
100m	Ë	1k	400	13									
50m	500 µ	2k	800	12									
20m	200 µ	5k	2k	Ħ									
10m	100 μ	10k	4k	10									
Sm	50 µ	20k	8k	6									
2m	20 µ	50k	20k	80									
ļ.	$10\mu$	100k	40k	7									
500 Ju	5 μ	200k	80k	9									
200 JJ	2μ	500k	200k	5									
100 µ	1μ	٨٢	400k	4									
50 µ	500n	2M	800k	3									
20 µ	200n	SM	2M	2									
10 μ	100n	10M	44	-	0	•							
5 μ	50n	20M	8M	0	0	•	0	0	•				
		[Hz]	1	Center frequency [Hz]	3. 15M	4M	SM	6. 3M	8M	10M	12. 5M		
		requency	range [H;	1/3 0CT	65	99	67	68	69	70	71		
Timebase	Period [s]	Sampling fi	Frequency	1/1 0CT		22			23			24	
Ĺ	-				_			_					

### 13.9.2 Analysis Mode Functions

Analysis mode	Internal calculation formula (linear, real, imag [imaginary], log [logarithm])
OFF	No analysis
Storage waveform	Waveform obtained by applying the window function to a time-domain waveform
Histogram	Counts amplitude data.
Linear spectrum	$X(k) = \sum_{n=0}^{N-1} x(n)W^{kn} \qquad F(k) = CX(k) \qquad C \begin{cases} 1/N(DC) \\ 2/N(AC) \end{cases}$ linear =  F(k)   real = Re{F(k)}  imag = Im{F(k)}  log = 20log F(k)
RMS spectrum	$F'(k) = C'F(k) \qquad C' \begin{cases} 1 & (DC) \\ 1/\sqrt{2}(AC) \end{cases}$
	$linear =  F'(k)   real = \text{Re}\{F'(k)\}  imag = \text{Im}\{F'(k)\}  \log = 20\log F'(k) $
Power spectrum	$P(k) = a F(k) ^{2} \qquad a = \begin{cases} 1 & (DC) \\ 1/2 & (AC) \end{cases}$
	$linear = P(k) \qquad \log = 10\log P(k) $
Power spectrum density	$P'(k) = P(k)/\delta f \qquad \delta f: \text{ Frequency resolution} \\ linear = P'(k) \qquad \log = 10 \log  P'(k) $
LPC analysis (power	(Omission) Spectrum approximation from Linear Predictive Coding
spectrum density)	Refer to "Linear Predictive Coding (LPC)" (p. Appx.36).
Transfer function	H(k) = Y(k)/X(k) linear =  H(k)  real = Re{H(k)} imag = Im{H(k)} log = 20log H(k)
Cross power spectrum	$\begin{split} S_{yx}(k) &= X^*(k)Y(k): \text{ Cross spectrum} \\ X_{power}(k) &= AS_{yx}(k) \qquad A = \begin{cases} 1/N^2 \\ 2/N^2 \end{cases} \\ linear &=  X_{power}(k)  \qquad real = \operatorname{Re}\{X_{power}(k)\} \\ imag &= \operatorname{Im}\{X_{power}(k)\} \qquad \log = 10\log X_{power}(k)  \end{split}$
Impulse response	$h(n) = \frac{1}{N} \sum_{k=0}^{N-1} \frac{Y(k)}{X(k)} W^{-kn}$
Coherence function	$coh(k) = \sqrt{\frac{S_{yx}(k)S_{yx}^*(k)}{S_{xx}(k)S_{yy}(k)}}$
Phase spectrum	$\theta(k) = \frac{180}{\pi \times \tan^{-1}(\text{Im}(F'(k))/\text{Re}(F'(k)))}$ $\theta(k) = \frac{180}{\pi \times \tan^{-1}(\text{Im}(S_{yx}(k))/\text{Re}(S_{yx}(k)))}$
Auto-correlation function	$R_{xx}(n) = \frac{1}{N} \sum_{k=0}^{N-1}  X(k) ^2 W^{-kn} \qquad \text{(recursive convolution)}$
Cross-correlation function	$R_{yx}(n) = \frac{1}{N} \sum_{k=0}^{N-1} S_{yx}(k) W^{-kn} \qquad \text{(recursive convolution)}$
1/1 octave analysis	(Omission)
1/3 octave analysis	(Omission)

**14** Waveform Evaluation Function

## 14.1 Evaluating Waveforms and Giving GO/NG Judgments (MEM, FFT Function)

The waveform evaluation function can be used from the Memory function (single screen, X-Y single screen), FFT function (1 screen standard, 1 screen Nyquist).

GO (pass) or NG (fail) evaluation of the input signal waveform can be performed using an evaluation area specified by the user. This can detect irregular waveforms. Depending on evaluation results, signals will be output on the external control terminal.

All channels being displayed can be used for GO/NG evaluation.

#### Setting workflow (After the input and other settings have been finished)



When using memory segmentation, the same block is repeatedly measured as long as the stop conditions are not satisfied. Once the stop conditions are satisfied, measurement moves to the next block.

- When the trigger mode is **[Single]**, measurement continues until stop mode conditions are fulfilled, then stops.
- When the trigger mode is [Repeat] or [Auto], waveform recording and evaluation are carried out continuously. Press the STOP key to stop measurement.
- When "Auto Print" is [On], the waveform is printed when the stop conditions are satisfied.
- When "Auto Save" is [On], the data is saved into the media when the stop conditions are satisfied.
- When "Memory Div" is **[On]**, data is recorded to the memory block only when the stop conditions are satisfied.
- The waveform evaluation is performed concurrently with measurement when "Roll Mode" is **[On]** and the timebase is slow as 100 ms/div or less, or when the "Roll Mode" is **[Auto]** and the display is equal to or less than 100 ms/div due to the time axis magnification. Otherwise, the evaluation is performed after measurement.
- When performing evaluation after measurement is complete, data capture and evaluation alternate repeatedly. Data is not captured while the evaluation is in progress. This means that the input signal is not being continuously monitored. The time required for evaluation is less than 100 ms. (not including time required to read data or update the display.)
- When performing evaluation and measurement concurrently, measurement continues while the waveform is displayed and evaluated. However, processing is not necessarily conducted in real time.
- If a high setting is chosen for recording length or if compression is used, the evaluation cycle becomes slower.
- Waveform scrolling is not available while "Waveform Judge" is ON ([Out] or [All out]). To use waveform scrolling, first turn [OFF] "Waveform Judge".
- When memory function waveform evaluation is specified, one screen of display data (25 divisions) is printed out. When you need to print waveform data with a recording length longer than 25 divisions, first set "Waveform Judge" to [OFF].
- Although the waveform display will change if you change display-related settings after measurement completes, the waveform evaluation results from when the measurement was made will be retained. To repeat the evaluation process for the waveform after applying new settings, perform waveform evaluation on the Status basic settings screen.

Refer to "7.5.1 Magnifying and Demagnifying Waveforms Horizontally (in the Time Axis Direction)" (p. 150).

• When using the highlight function with the FFT function, only the highlighted data is evaluated.

#### Waveform evaluation mode and stop mode



#### **14.2 Setting the Evaluation Area**

An evaluation area is required to evaluate waveforms. Two methods are available: one is to load a previously created evaluation area and settings, and the other is to create a new evaluation area.

#### Loading the previously created evaluation area

#### Procedure

Setting screen: File

- **1** Press the FILE key to open the File screen.
- **2** Select the [Media] from which to load.
- **3** Use the bar cursor to select the desired file in the media.
- **4** Select a command. Select [Load].
- **5** Choose [Exec] from the F key menu.
- 6 When no more changes need be made to the loaded settings, press the DISP key to make the Waveform screen appear, and then press the START key to initiate measurement.

To change the settings, first change the contents, then press the **DISP** key to make the Waveform screen appear, and then press the **START** key to initiate measurement.

Refer to "5.3 Loading Data" (p. 110) for file loading.

#### Requirements for loading waveform evaluation area BMP files

Observe the following requirements when creating waveform evaluation areas on a PC and when loading waveform evaluation areas created on other equipment:

Items	Condition	Loading operation
Color	Black and white	White pixels are treated as background. Black pixels are treated as the evaluation area.
Size	501 horizontal pixels × 626 vertical pixels	The file will be used as the evaluation area for the Memory Function 1 screen.
	501 horizontal pixels × 501 vertical pixels	When using the FFT function, the file will be used as the FFT evaluation area. When using other functions, the file will be used as the memory function X-Y evaluation area.

Files that do not satisfy these requirements cannot be loaded properly.



#### Creating a new evaluation area

#### Procedure

Setting screen: Status

- **1** Press the STATUS key to display the Status screen.
- **2** Move the flashing cursor to [Waveform Judge].
- **3** Choose [edit] from the F key menu.
- **4** Create the evaluation area. Refer to "14.5 Creating the Evaluation Area" (p. 329).
- **5** Store the created area in the internal memory.
- 6 After setting "Waveform Judge setting" and "Stop Mode," press the DISP key to show the Waveform screen, then press the START key to begin measurement.
- 7 Save the evaluation area on the File screen, if necessary.

Refer to "5.2 Saving Data" (p. 95).

#### Memory Function

10KI 🥖 Status 📃 Num Calc	Memory Div 🔪 Wave	Calc	TATUS (Malk)	11-Nov 18-48
[Recording setting]				Function:
ERCCOTOTINE SECTIONS 2				MEMOKI
Timebase	5_us/div			
Sampling	( 50ns/S)			
Shot	25d i v	(MAX	50000div)	
Recording Period	( 125µs)			
Format			+	
Format	Single			
				TRIG
Channels to use			+	
Used Ch	Ch 1-16			
[Utility functions]			+	+
				011
Roll Mode	Off			A
Overlay	Off			flut
-【Waveform Judge Setting】—			+ +	
Waveform Judge	Off			All-Out
-				0-
			+	Ever
GO/NG (Pass/Fail) of in Hint reference rando	nput waveform can be	evaluate	d comparing to a pr	eset 🚺 📈
interence range.				edit

FFT Function



Only one waveform evaluation area may be stored in internal memory.

For example, when operation is changed from the Memory function screen to the X-Y screen and an X-Y screen waveform evaluation area is stored, a waveform evaluation area created for the Memory function will be lost.

### 14.3 Configuring the Waveform Evaluation Setting

#### Procedure

Setting screen: Status

#### **1** Move the flashing cursor to [Waveform Judge].

#### Memory Function

2 Choose the required setting from the F key menu.

OFF	Disables waveform evaluation.
Out	Returns NG if any part of the waveform leaves the evaluation area.
All out	Returns NG if the entire waveform leaves the evaluation area.
Execute	Enables waveform evaluation.
edit	Creates the evaluation area.

HOKI Status Num Calc	Memory Div 🔪 Wave Calc 🦙		11-Nov 18:48:41
[Pasarding satting]			Function:
- Kecoluliis Secting 2			MEMUKT
Timebase	5µs/div		
Sampling	( 50ns/S)		
Shot	25div (MAX	50000div)	
Recording Period	( 125µs)		
++Format		+	
Format	Single		
			TRIG
Channels to use		+	
Used Ch	Ch 1-16		
[] [] [] [] [] [] [] [] [] [] [] [] [] [		-	<u></u> , – – "
			0ff
Roll Mode	Off		M MIFE
Overlay	Off		first
[Waveform_Judge_Setting]		-	
Waveform Judge	Out		All-Out
a top mode	GUISING		
+		+	Exec
CD 40C (Daras (E-11) - 4 1-			
Hint reference range.	put wavetorm can be evaluate	o comparing to a preset	
			edit

#### **FFT Function**

юкі Status					27-Apr 15:1
[FFT]					Function
Peference	New Data				
Kelefence	Hew Data	Format	Si	n¢le	
Sampling Point	1000	Peak	0	lff	
Frequency Range	8MHz	Average	- 0	lff +	
Res(Recording time	) 20kHz(50µs)				
Window	Rectangular	+ +Highlight(pha	se) (	t Iff +	TRIG
(Compensation rate	) ×1.000(0.00dB)				7
Analyze】					0.44
No Wave Analyz	e Paramete	r Ch1 Ch	12 YAxis	X Axis	
1 Off					
2 📕 🛛 🕅					Out
Scale ]					
No Scale Lower	Upper U	nit 🚽	and an Indea I	Santan .	All-Out
1 Auto		Wa	veform Judge	OUT	0-
2 Auto			o top mode	aavina	C
					ILXEC
Make basic set	tings of measuremen	t on this screen			~
nini					odic

## 14.4 Setting the Waveform Evaluation Stopping conditions

When waveform evaluation is enabled (Out or All out is selected), the "Stop mode" menu appears. Specify which evaluation option, GO or NG, should be used to stop the recording. The auto-save and auto-print functions are only executed when interruption conditions are satisfied.

#### Procedure

Setting screen: Status

- **1** Move the flashing cursor to [Stop Mode].
- 2 Choose the required setting from the F key menu.

GO	Stops recording on GO result.
NG	Stops recording on NG result.
GO& NG	Stops recording on GO or NG result.

[Recording setting]				MEMORY
Timebase	5µs/div			
Sampling	( 50ns/S)			
Shot	25d i v	(MAX	50000div)	
Recording Period	( 125µs)			
Format			+	
Format	Single			
				TRIG
Channella, da una			4	
Used Ch	Ch 1=16			
	017 2 20		+	
[Utility functions]			+	60
Roll Mode	Off			0
Overlay	Off			
[Waveform Judge Setting]				10
				100
Come Hards				BURNS
этор моде	U			
No	until the est esitesia	210.000		

#### Relationship between stop conditions and trigger mode

- There are three trigger modes: Single, Repeat, and Auto. Refer to "9.2 Setting the Trigger Mode" (p. 213).
- There are three stop conditions: GO (Pass), NG (Fail), and GO&NG (Pass & Fail)
- By combining a trigger mode and a stop condition, you can halt measurement when the desired comparison result is achieved. You can also automatically save, automatically print, or superimpose the waveform for the desired evaluation results.

Automatic saving, automatic printing, and superimposition are performed when the stop conditions are met.



- When the trigger mode is [Single], the measurement finishes when the stop conditions are fulfilled. The measurement continues until stop conditions are fulfilled.
- When the trigger mode is [Repeat] or [Auto], the measurement continues until the **STOP** key is pressed (or the STOP signal is input) regardless of whether the stop conditions are fulfilled or not.

### 14.5 Creating the Evaluation Area

#### Procedure

Setting screen: Status

- **1** Move the flashing cursor to the [Waveform Judge] item and select [edit] from the F key menu.
- 2 Select appropriate editors from the F key menu and create an area to be used as the reference for the waveform evaluation.

You can also use the mouse to create an area. Refer to "1.4.2 Using Mouse to Enable Key Operation" (p. 25).

- **3** Press the F key for [Exit] to exit the editor.
- **4** Store the created area in the internal memory.

Save and End	Saves the created evaluation area in the instrument's internal memory and exits.
Discard and End	Discards the created evaluation area and exits.

**5** Save the evaluation area through the File screen or SAVE key, if necessary.

Refer to "5.2 Saving Data" (p. 95).

DKI	Command Selection Menu	11-Nov 8:5
		_
	·	Exit
		N.C.
		Cance I
		-
		Load Nev
		- <b>-</b>
		Zaam in/
	· · · · · · · · · · · · · · · · · · ·	
		Fill col
		-
		Draw sha
		101 011 1011

14

#### **14.6 Details About the Editor Commands**



#### Load Wave

Loads and displays the waveform shown on the Waveform screen in the editor.

#### Instructions

#### **1** Press the F key for [Load Wave].

**2** Select the type of waveform capture to perform. The waveform displayed on the Waveform screen will be loaded into the editor.

Waveform capture	Captures the storage waveform displayed on the Waveform screen.
Overlay capture	Captures the overlay waveforms shown on the Waveform screen, then connects the uppermost and lowermost positions with the same display color and fills in the resulting enclosed space. When the waveforms overlap, portions of the waveforms that are not displayed cannot be recognized. This option can be selected when an overlay has been drawn on the screen.
Memory segmentation reference waveform	Captures the memory segmentation reference waveform shown on the Waveform screen, then connects the uppermost and lowermost positions with the same display color and fills in the resulting enclosed space. When the waveforms overlap, portions of the waveforms that are not displayed cannot be recognized. This option can be selected when a memory segmentation reference waveform has been drawn on the screen.

#### **3** Press the F key for [Load Wave] to exit waveform capture mode.



#### Zoom in/out

Magnifies or compresses the waveform shown on the screen in the horizontal and vertical directions.

#### Instructions

**1** Press the F key for [Zoom in/out].

2 Select whether to magnify or compress the waveform.

- **3** Set the amount of magnification or compression.
  - You can set values with the F keys, jog knob, or shuttle knob.
  - The amount of movement can be set in increments of 0.04 div.

Execute	Performs magnification or compression processing based on the settings and creates an evaluation area.
Exit magnification/ compression	Exits magnification/compression mode.



#### Fill color

Fills in an enclosed area.

#### Instructions

- **1** Press the F key for [Fill color].
- 2 Use the cursor keys to move the paintbrush 开 mark to the area to be filled in.

Press [Speed up] to accelerate the movement of the mark.

If the area is not completely enclosed, adjacent areas will also be filled in.

Execute	The area completely enclosed by lines is filled in.	
Exit paint	Exits paint mode.	



#### Draw shape

Draws a line, square or circle.

#### Instructions

- **1** Press the F key for [Draw shape].
- **2** Select the figure you wish to draw.
- 3 Use the cursor keys to move the mark to the origin of the figure. Press [Speed up] to accelerate the movement of the mark.
- **4** Press the F key for [Set].

The origin is set at the current position.

**5** Move the  $\square$  mark.

A figure is drawn between the origin and the  $\square$  mark.

6 Press [Set] again.

The color of the figure changes and the figure is confirmed. For straight lines, the origin is set at the accepted position. For other types of figure, accepting the figure has the same effect as pressing [Cancel].

- **7** To draw another figure, press [Select], and select the figure type.
- 8 Repeat steps 3 through 7 to draw figures as desired.
- **9** Press the [Exit Draw shape] key to exit figure mode.

Eraser Erases unwanted sections. Move the x mark with the cursor keys to erase parts of the image.

#### Instructions

- **1** Press the F key for [Eraser].
- **2** Using the cursor keys, move the <u>mark</u> to the origin of the area to be erased. Press [Speed up] to accelerate the movement of the mark.
- **3** Press the F key for [Set].

Now you can erase figures by moving the eraser. Press the **F** key for **[Cancel]** and you can move the eraser without erasing figures.

- 4 Move the x mark in the [Set] state to erase the parts of figures you do not need.
- **5** Press the [Exit Erase] key to exit erase mode.



#### Clear all

Clears the entire editor screen.

#### Press the F key for [Clear all].

The editor screen is cleared.



#### **Clear select area**

Clears a specified rectangular area of the editor screen.

#### Instructions

- **1** Press the F key for [Clear select area].
- 2 Using the cursor keys, move the mark to the origin of the area to be erased. Press [Speed up] to accelerate the movement of the mark.
- **3** Press the [Set] function key to set the position as the origin.

#### 4 Move the $\square$ mark.

A rectangle is drawn between the origin and the  $\square$  mark.

**5** Press [Set] again.

The area inside the rectangle is erased. Press **[Cancel]** and the position of the origin is canceled.

**6** Press the F key for [Exit Area Clear] to exit from the area clear mode.



#### **Invert colors**

Reverses the colors of a filled-in area and the surrounding area.

#### Press the F key for [Invert colors].

The filled in area is displayed in reverse.



#### Cancel

Undoes the last executed command. Undo can be used with any command other than [Save and End] and [Discard and End].

#### Press the F key for [Cancel].



Exit Exits the editor.

#### Instructions

#### **1** Press the F key for [Exit].

## 2 Select whether to store the evaluation area in memory or discard it before quitting the editor.

Waveforms loaded into the editor will be displayed in different colors than those set with the original settings.

Save and End	Stores evaluation area in memory and quit editor. Refer to "5.2 Saving Data" (p. 95).	
Discard and	Quits the editor without storing the evaluation area in memory.	
End	The created area is discarded.	

Details About the Editor Commands

## 15 Setting the System Environment

You can set the system environment on the [Environment] sheet of the system screen.

#### To display the [Environment] sheet



HIOKI Environment	File Save Prin	nter Interface	Init 🔊 SYSTEM 🖓	D 27-0ct 16:52:27
-【Waveform Display】-				Function: MEMORY
Grid Time Value Start Backup	Dotted Line Time	Start Action Stop Action	One Push Two Push	
-【Display Settings】-				+
Auto Scale	On	Beep Sound	Warning	
–【System Environment】	]			+
Backlight Saver	Off	Language	English	
Display Contrast Display Color	Normal Color 3	Mouse Speed	Min 📩 Max	F1.
EXT I/O Input START/EXT IN1 STOP /EXT IN2 SAVE /EXT IN3 EXT TRIG	Start Stop Save 1	+Output GO/EXT OUT1 NG/EXT OUT2 TRIG OUT	Measure Measure Pulse	KEKORY RECORDER
EXT SMPL	1			FFT
Select the me Hint	asurement function	n by pressin F1-4	key.	

Refer to "17 Controlling the Instrument Externally" (p. 369).

#### **Description of the settings**

HIOKI Environment F	ile Save 🔷 Pri	inter 📃 Interface	Init 🔊 SYSTEM (Push)
+【Waveform Display】—			
Grid	Dotted Line	Start Action	One Push
Time Value	Time	Stop Action	Two Push
Start Backup	Off		
- 【Display Settings】—			
Auto Scale	On	Beep Sound	Warning
+ 【System Environment】			
Backlight Saver	Off	Language	English
Display Contrast	Normal		
Display Color	Color 3	Mouse Speed	Min 🗖 Max

#### Grid

Select the grid (graticule) type for the waveform screen.

Off	Does not display any grids.
Dotted Line	Displays the dotted-line grid. (Default setting)
Solid Line	Displays the solid-line grid.

#### **Time Value** Display the time elapsed from the trigger point on the display.

Time	Displays the time elapsed from the trigger point (the unit is fixed). (Default setting)
Time (60)	Displays the time elapsed from the trigger point (in the sexagesimal [base-60] system).
div	Displays the number of divisions (div) from the trigger point.
Date	Displays the time when the waveform is acquired.
Sample Num	Displays the number of data points from the trigger point.

• During the external sampling, the number of points is fixed.

• These settings are also applied to the values of Cursors A and B.

**Start Backup** The instrument preserves measurement condition settings. When the instrument is turned off during the recording due to a power outage or other reasons, the operation resumes automatically when the power is restored. When the triggering is enabled, the instrument is set to wait for a trigger.

#### Off (Default setting), On

• This function is valid only while the instrument is recording data.

• This function does not start automatically when the instrument is turned on.

Backlight Saver	The screen bla specified perio The screen rec	nks automatically when the instrument has been not in use for the d (unit: minutes). covers when any key is pressed.		
	Off	Disables the backlight saver function. (Default setting) The screen remains visible at all times.		
	(Setting the time)	Setting range: 1 min to 30 min (in one-minute increments)		
	<ul> <li>When the ba function origi key again to</li> <li>Using the ba backlight.</li> </ul>	cklight saver activated, pressing a key does not perform the nally allotted to the key; but reactivates the backlight. Press the perform the original function. cklight saver conserves energy and extends the life of the		
Display	Selects one of	three backlight brightness levels.		
Contrast	Light, Normal, Dark			
Display Color	You can set screen background and character colors on the waveform screen freely. Select [Color Edit], and then change the values in the [R] (red), [G] (green), and [B] (blue) boxes of each item to change respective color. (p. 339) Color 1, Color 2, Color 3, Color Edit			
Beep Sound				
	Warning	Beeps for error messages (warning displays) and NG (fail) judgments. (Default setting)		
	Warn+Act	In addition to the warning beeps described above, beeps when the instrument starts the measurement, triggers, stops the measurement, and completes the auto-saving.		
Language	Selects the dis	play language.		
	English (Default setting), Japanese, Korean, Chinese			
Auto-scale	Variable values voltage range. Refer to "8.6 Set	s are automatically changed according to changes in scaling and ting the Waveform Position (Variable Function)" (p. 178).		
	Off, On (Defaul	t setting)		

## **Start Action** To prevent the instrument from starting measurement unintentionally due to operation mistakes, you can change the **START** key operation method. This setting does not affect the external control terminal function.

One Push	Starts the measurement by pressing the <b>START</b> key once. (Default setting)
Two Push	Starts the measurement by pressing the <b>START</b> key twice.
Hold 2s*	Starts the measurement by holding down the <b>START</b> key for two seconds.

When the **START** key is pressed, the message "Hold START key down." will be displayed.

After pressing the **START** key for two seconds, the message disappears, and the measurement starts.

**Stop Action** Normally, pressing the **STOP** key once stops the measurement to after the specified recording length of the data is acquired, and pressing the key twice stops the measurement in progress immediately. This setting is provided to allow you to stop the measurement immediately by pressing the **STOP** key once.

Two Push	Stops the measurement by pressing the <b>STOP</b> key twice. (Default setting)
One Push	Stops the measurement by pressing the STOP key once.

**Mouse Speed** You can set the mouse movement speed. Dragging the slider handle while holding down the left mouse button allows you to set the mouse pointer speed. While sliding it towards "Min" enables the mouse pointer to move slowly, sliding it towards "Max" enables the pointer to move quickly.

Mouse Speed Min \_\_\_\_\_ Max

#### Additional description

#### Customizing the screen color

Select [Color Edit] to display the [Custom Color] screen.

Change the values in the **[R]** (red), **[G]** (green), and **[B]** (blue) boxes of each item to change its color.

Refer to "8.1.3 Entering Alphanumeric Characters" (p. 163).

#### [Custom Color] screen



Done	Confirms the entered settings.
Reset	Restores the default settings.

## 16 Connecting the Instrument to a Computer

Read "Before connecting the instrument to an external device" (p. 14) carefully.

This instrument is equipped with the Ethernet 100BASE-TX interface for LAN communications. You can control the instrument from a computer or other devices by connecting it to a network with 10BASE-T or 100BASE-TX cable (maximum length 100 m). It is also possible to directly connect the instrument to the computer via USB.



#### Operations available on the [Interface] sheet

## Setting LAN, connecting the instrument via LAN (p. 342)

- Connecting the instrument to the computer via the network
- Connecting the instrument to the computer directly

## Transferring data to the computer (p. 359)

Setting the USB, connecting the instrument via USB (p. 361)

Remotely control the instrument using an Internet browser (p. 348)

Operating the instrument remotely, acquiring data using Model 9333 LAN Communicator (p. 367).

## Accessing the files on the instrument via the FTP (p. 355)

This instrument is equipped with the File Transfer Protocol (FTP, RFC959 compliant) server. You can use an FTP client software installed on the computer to transfer files in instrument media to the computer and manage the files.

## Controlling the instrument with the command communications (p. 365)

You can control the instrument by creating programs and connecting to the command communications port using the TCP. You can also control the instrument via USB. For more information about the commands, refer to the Communications Command Instruction Manual on the supplied application disc.

#### 16.1 Setting LAN and Connecting the Instrument to the LAN Network (Before Using FTP/Internet Browser/Command Communications)

Before accessing the instrument from a computer using the FTP or an Internet browser, or using command communication, you must configure the instrument's LAN settings and connect it to your network with a LAN cable.

Always configure the LAN settings before connecting the instrument to the network. When you change the settings while connected to the network, the IP addresses may not be unique or invalid address data may be transmitted over the network.

#### **16.1.1** Configuring the LAN Settings With the Instrument

#### Things to be checked before configuring the LAN settings

The required settings are different depending on whether you are to connect the instrument to an existing network or you are to establish a new network consisting of only the instrument and a computer.

When connecting the instrument to the existing network

The following items must be assigned in advance by your network administrator. Be sure that there is no conflict with other devices.

- The TCP/IP port number to be used: X (default 880x) (Specify the most significant 3 digits of the 4-digit number. The least significant digit, 0 through 9, is reserved for use by the instrument. Specify it when the default value, 8800 through 8809, cannot be used.)

When establishing a new network consisting of the computer and the instrument

(Use the instrument on the local network, which does not connect to any external network.)

When no administrator exists for your network, or you are entrusted with the settings, the following addresses are recommended.

(Example settings)	IP Address computer: 192.168.0.1 Recorder 1: 192.168.0.2	
	Recorder 2: 192.168.0.3	. the same applies in sequence.
	$\downarrow$	$\downarrow$
	Host name	. Any name (Must be unique)
	Subnet mask:	.255.255.255.0
	Gateway	.OFF
	Port number	.880X

eotting dotailo	
Interface	Choose between LAN and USB.
Host Name	<ul><li>This name identifies the instrument on the network. Set a unique host name among those of other devices.</li><li>This instrument does not support dynamic DNS. The name that you set is not registered with a DNS server.</li></ul>
IP Address	The IP addresses identify individual devices on the network. Set a unique address among those of other devices.
Subnet Mask	The subnet mask divides the IP address into the network address and the host address. Set the subnet mask in the same way as those of other devices on the network.
Gateway IP Address	<b>For network connections</b> When your computer (the communication device) is on another network than this instrument, set this setting to <b>[On]</b> and specify the gateway device. When the computer is on the same network, this setting is usually set to the same address as the default gateway in the computer communications settings.
Authorization user name and password	These are used when you log in to the instrument with the FTP or use a computer Internet browser (When authorization is <b>[On]</b> ). With the authorization set, you can log in only when entering a valid user name and password. Configure this setting when you want to restrict the users to access the instrument. The password you entered is displayed as the character string ""**********." Valid characters: Alphabetic characters and symbols (however, the colon (:) is prohibited.) When you want to allow anyone to access the network, or you wish to log in as "anonymous" of the FTP client, leave the user name and password fields blank.

#### Setting details

Setting LAN and Connecting the Instrument to the LAN Network (Before Using FTP/Internet Browser/Command Communications)

#### Procedure of setting LAN

Press the SYSTEM key to display the [Interface] sheet. Follow the procedure as intended usage.

HIOKI Environme	ent / File Save / Printer	Interface	Init	> SYSTEM (Push)	10-Oct 18:00:07
- [Common]					Function: MEMORY
Delimiter	CR+LF	Header	Off		
- 【Interface】—					
Interface	LAN	USB Set	USB Stic	k	
Host Name IP Address Subnet Mask Gateway IP Address Port Number	192 168 0 2 255 255 255 0 0ff 0 0 0 0 0 888x	LAN Communicatı Data Server	or On 192 168 0	1	
		[MAC Adress]			
Authorization User Name	Off	00 01 0	57 00 00 00		USB
Password Access Ctrl	Read-Only				
+	Res	et			
Configu Hint right o	re various settings for comm f this instrument to move to	nunications.Use 1 o other setting s	the MENU key or screens.	n the top	

Press the **CURSOR** key to move the settings cursor and press the **F** key to select the setting.

Refer to "Setting details" (p. 343).

For the details on each setting Refer to "Setting details" (p. 343).

#### About the network

For details about your network including the IP address, contact your network administrator. Setting LAN and Connecting the Instrument to the LAN Network (Before Using FTP/Internet Browser/Command Communications)



## 16.1.2 Connecting the Instrument to the Computer With the LAN Cable

Connect the instrument to the computer with the LAN cable as follows.

#### **ACAUTION**



When connecting the instrument to your LAN using a LAN cable of more than 30 m or with a cable laid outdoors, take appropriate countermeasures that include installing a surge protector for LANs. Such signal wiring is susceptible to induced lighting, which can cause damage to the instrument.

**1** Plug the LAN cable (100BASE-TX compliant) into the 100BASE-TX connector on the right side of the instrument.

Right side



#### 2 Connect the LAN cable to the computer.

There are two connection ways.

#### 1. Connecting the instrument to the existing network

#### (Connect the Instrument to the hub)

You can control and monitor the instrument with the computer by connecting the instrument to the hub with the LAN cable (100BASE-TX cable).

Connection cable: Use one of the following.

- 100BASE-TX straight-through cable (maximum length 100 m, commercially available) (10BASE-T compatible cable can also be used for 10BASE communications)
- Model 9642 LAN Cable (optional)



#### 2. Connecting the instrument to the computer directly

(Connect the instrument to the computer)

You can control and monitor the instrument with the computer by connecting the instrument to the computer with the LAN cable.

- · Connection cable: Use one of the following.
- 100BASE-TX compatible crossover cable (maximum length 100 m)
- 100BASE-TX straight-through cable (maximum length 100 m)
- · Model 9642 LAN Cable (optional, supplied with crossover connector)

This completes the connection procedure.

Access the files on the instrument from the computer. Refer to the following pages:

"16.2 Controlling the Instrument Remotely (Using an Internet Browser)" (p. 348)

"16.3 Accessing Files on the Instrument From the computer (Using the FTP)" (p. 355)

"16.7 Controlling the Instrument with Command Communications (LAN/USB)" (p. 365)

If noise affects surrounding equipment, wind the LAN cable once around the supplied ferrite clamp-on choke (for LAN cable), as shown in the illustration on the right.



## 16.2 Controlling the Instrument Remotely (Using an Internet Browser)

You can control the instrument remotely from the computer using an Internet browser.

Attempting to control the instrument simultaneously from multiple computers may result in unintended operation. Use only one computer to operate the instrument remotely.

To use an Internet browser, you must set the instrument properly and connect it to the computer with LAN cable. (p. 342), (p. 346)

Microsoft<sup>®</sup> Internet Explorer<sup>®</sup> 8 or later is recommended. Set the security level to "Medium." If the commands, [Remote Control] and [Aquire data by FTP] do not work, install JRE included in the application disc. Turn off the pop-up blocker.

#### Procedure for installing JRE

**1** Insert the supplied application disc (CD) into the CD-ROM drive. The top page appears automatically. If it does not appear, open the "index.htm" file with your web browser.

- 2 Select the display language. Click the [English] icon.
- **3** Click the [JRE installation] icon.
- **4** Click the [Install] icon, then follow the prompts that appear to complete the installation.

#### 16.2.1 Setting HTTP With the Instrument

#### Procedure

#### To display the screen

Press the SYSTEM key to display the system screen, and then select the [Interface] sheet.

#### First, set the "LAN Communicator" setting to [Off].

#### 1 Choose authorization settings.

Move the cursor to the [Authorization] box.

Off	Enables you to operate the instrument without the web server authentication. (Default setting)
On	Enables you to operate the instrument with the web server authentication.

#### 2 When [On] is selected

#### Set the user name and password.

Move the cursor to the **[User Name]** and **[Password]** boxes in turn, and enter the user name and password. Refer to "8.1.3 Entering Alphanumeric Characters" (p. 163) and Authorization user name and password (p. 343).

#### **3** Confirm the settings.

Move the cursor to the **[Reset]** box. Select **[Reflect Set]**.

The message "LAN was reconnected" appears at the bottom of the screen.

🕰 USET Name	
2 Password	
Access Ctrl	Read-C

The user name and password for authentication are the same for the Internet browser and for the FTP.

#### 16.2.2 Connecting the Computer to the Instrument With the Internet Browser

The following example shows how to use the Internet Explorer<sup>®</sup> on Windows 7. Start Internet Explorer<sup>®</sup> on the computer and enter the character string "http://" followed by the IP address or host name of the instrument in the address bar.

#### When the IP address of the instrument is "192.168.0.2"



\* When user name and password for authentication were set on the **[Interface]** sheet of the system screen of the instrument

Refer to "16.2.1 Setting HTTP With the Instrument" (p. 348).

#### 16.2.3 Operating the Instrument With the Internet Browser

. . .

#### Starting/Stopping the measurement

You can start and stop the measurement.

#### Start/Stop screen

#### To display the screen

Click [Start/Stop] in the operation list.

🗿 SETTING PAGE – Microsoft Internet Explorer		
File Edit View Favorites Tools Help		
🌀 Back 🝷 🐑 - 😠 🛃 🏠 🔎 Search 🤺 Favorites 🤣 🎯 - 头 🔜 🦓		
Address 🕘 http://192.168.0.2/SETUP.H	itm	
HIOKI MR8847A	Start Stop	
<u>Start/Stop</u>	Current Measurement Configuration Waiting in progress.	
Remote Control		
Acquire data by FTP	Start	
<u>Title Comment</u>	Stop	
Analog Ch Comment		
Logic Ch Comment		
<u>To Main Page</u>		

#### Procedure

Click **[Start]** to start the measurement. Click **[Stop]** to stop the measurement.

Click **[Current Measurement Configuration]** to display the present measurement information acquired from the instrument.

#### Remotely operating the instrument

You can operate the instrument remotely. (This remote operation is mainly intended for monitoring the screen. When you want to perform the remote control of the instrument more smoothly, use Model 9333 LAN Communicator.)

#### Remote Control screen

#### To display the screen

Click [Remote Control] in the operation list.



The remote control screen consists of the instrument display section and operation panel section.



#### Basic operation

When you click a button on the operation panel, the instrument performs the same action as if the corresponding key on the instrument was pressed. However, simultaneously activating more than one button is not possible. You can directly click inside the screen to move the flashing cursor onto the item or click the GUI figure directly to set it. You can also operate the instrument directly during the remote operation.

- You may not be able to control the instrument remotely without installing JRE. (p. 348)
- Printing during remote operation may be interrupted. Set the display updating speed to a slower option.

#### Acquiring the data stored in the memory of the Instrument

You can acquire the measured data.

You can select the data format among binary, text, and MS Excel\*.

\* Microsoft Excel®

#### Start/Stop screen

#### To display the screen

Click [Start/Stop] in the operation list.

🖉 SETTING PAGE - Win	dows Internet Explorer の提供元	: HIOKI	×
🔆 💽 🔻 🙋 http://192	168.0.2/SETUP.HTM	Socie P Google	•
ファイル( <u>F</u> ) 編集(E) 表示(	2) お気に入り( <u>A</u> ) ツール( <u>T</u> ) ヘルプ( <u>E</u>	)	
🚖 お気に入り 🛛 🚖 🙋 Hot	Mail の無料サービス 🙋 Web スライス ギャ	ሀ− 👻 😰 ሀンクのカスタマイズ	
🔡 👻 🏉 SETTING PAGE	× 🌈 Internet Explorer ではこ	ペ_	»
HIOKI MR8847A V1.00 Start/Stop Remote Control	Start/Stop	Current Measurement Configuration Waiting in progress.	
Acquire data by FTP Title Comment		2 Stop	
Analog Ch Comment Logic Ch Comment		Download waveform data <u>3</u> <u>Get binary data</u>	
<u>To Main Page</u>		<u>Get text data</u> <u>To MS Excel</u>	
	(Note) - Since old data may remain in - You cannot download data du - You cannot download the text	ash of the browser, when you download new data, please download after re-displaying a browser. ring measurement. Please download, after measurement finishes. data in the X-V recorder function (-2/2-2x)	
1 7A-K 6 10	* C C¥Documents and S		

#### Procedure

- **1** Start the measurement.
- **2** Stop the measurement.
- **3** Select one of the options under [Download waveform data].

Get binary data	Downloads the data in binary format.
Get text data	Downloads the data in text format.
To MS Excel	Displays the data in Microsoft Excel. (The data can be opened with Microsoft Excel.)

- You may not be able to acquire data without installing JRE. (p. 348)
- You cannot acquire measured data during the measurement. Stop the measurement and then acquire the data.
- When you press **[To MS Excel]** and select **[Open]** using Internet Explorer, an error may occur during transmission. In such a case, select **[Save]**.
## Acquiring the data using the FTP

You can acquire the data using the FTP from the CF card, built-in drive, or USB flash drive.

## Acquire data by FTP screen

#### To display the screen

Click [Acquire data by FTP] in the operation list.



## Procedure

Click [Acquire data by FTP].

The list of folders is displayed.

For information on how to perform file operations, refer to "16.3.3 Managing Files With the FTP" (p. 358).

## **Entering the Comment**

You can specify character strings to be used as title comments, logic channel comments, and analog channel comments.

Information about the module type and channel (installation location in the module) can be obtained and displayed only for used channels.

#### Comment setting screens

#### To display the screen

Click [Title Comment], [Analog Ch Comment], or [Logic Ch Comment] in the operation list.



SETTING FACE - Management File Edit New Facebox Tool	leternet Explorer 1 190	
Q text + () () ()	🐔 🖉 Sant 👷 Facetor 🕢 🔝 😓 🔜 🖏	× 0
HIOKI MR8847A V100 Start Store Remote Control	HIOKI MR8847A	
Accesses Ann. In. JETP Tele Comment Annion Ch. Comment	<u>Start/Stop</u>	(Berry)
Losic Ch. Consumt To Main Patr	<u>Acquire data by FTP</u>	
	<u>Title Comment</u>	Serry
	Analog Ch Comment	
	<u>To Main Page</u>	(Setty)
Date .	Logic Chanr	nel Comment setting screen

#### Procedure

#### Enter the title in the comment input box and click [Setting].

The comment string can be up to 40 characters long.

Comment LC2	
Comment LC3	
Comment LC4	
	Setting
Comment LD1	
Comment LD2	

# 16.3 Accessing Files on the Instrument From the computer (Using the FTP)

Using the FTP client software of the computer allows you to transfer files from the instrument's storage media to the computer, and manage the files.

- This instrument is equipped with the File Transfer Protocol (FTP, RFC959 compliant) server.
- You can use Internet Explorer<sup>®</sup> or other popular FTP clients.
- The FTP server of the instrument allows only one connection at a time. More than one computer cannot access the server simultaneously.
- If no command is sent from the computer for more than one minute after connecting to the FTP server, the FTP may disconnect the computer. If this occurs, reconnect the computer via the FTP.
- Starting the measurement interrupts the FTP connection.
- Before inserting or removing a CF card or USB flash drive, terminate the FTP connection.
- Do not manage files while the FTP is being used.
- With Internet Explorer<sup>®</sup>, the refresh date of files may not match those of the instrument.
- With Internet Explorer<sup>®</sup>, temporary internet files created at the previous access may retain; thus, the previous data may be obtained instead of the updated data.

## To use the FTP, you must set the instrument properly and connect it to the computer with the LAN cable.

Refer to "16.1.1 Configuring the LAN Settings With the Instrument" (p. 342) and "16.1.2 Connecting the Instrument to the Computer With the LAN Cable" (p. 346).

Be careful when moving files via the FTP, as some FTP client/browser programs may delete all selected files or folders from the source if you cancel the transfer before its completion. We recommend you to copy (download) the files and then delete them from the original place manually.

## Things to be checked before using the FTP

the storage media and

directories

Relationship between Each of the storage media appears as a directory on the FTP server.

/CF	CF card
/HDD	Built-in drive
/RAM	Internal memory
/USB1	USB flash drive
/STORAGE	Storage memory

Limitations You cannot access files during measurement.

Even when the SSD built-in drive is installed, it is recognized as an HDD.

## 16.3.1 Setting the FTP With the Instrument

#### Procedure

#### To display the screen

Press the SYSTEM key to display the system screen, and then select the [Interface] sheet.

#### **1** Set the access restrictions.

Move the cursor to the [Access Ctrl] box.

Read/ Write	Enables you to delete and rename files.
Read- Only	Enables you to read files only. This setting prevents files from being deleted or changed from outside the instrument.

+ 【FTP/HTTP】 2 Authorization 3 User Name	Off
3 Password 1 Access Ctrl	Read-Only

## **2** Set the authorization setting.

Move the cursor to the [Authorization] box.

Off	Enables you to operate the instrument without the web server authentication. (Default setting)
On	Enables you to operate the instrument with the web server authentication.

## **3** When [On] is selected

#### Set the user name and password.

Move the cursor to the **[User Name]** and **[Password]** boxes in turn, and enter the user name and password.

Refer to "8.1.3 Entering Alphanumeric Characters" (p. 163) and Authorization user name and password (p. 343).

## **4** Confirm the settings.

Move the cursor to the **[Reset]** box. Select **[Reflect Set]**.

The message "LAN was reconnected" appears at the bottom of the screen.

The user name and password for authentication are the same for the Internet browser and for the FTP.

## 16.3.2 Connecting the Computer to the Instrument Using the FTP

The following example shows how to use the Internet Explorer® on Windows 7.

Start Internet Explorer<sup>®</sup> on the computer and enter the character string "http://" followed by the IP address of the instrument in the address bar.

## When the IP address of the instrument is "192.168.0.2"

Without   Addres     Pp://192.168.0.2     Without   authorization     Log in screen   Enter the user name and password to log in.   Connection     The storage media of the instrument appear.     ftp://192.168.0.2/     Microsoft Internet Explorer     File Edit View Favorites Tools Help   Stack   Search   Folders     File Edit View Favorites Tools Help   Connection     The storage media of the instrument appear.     Connection     The storage media of the instrument appear.     ftp://192.168.0.2/     CF   RAM	tp://192.168.0.2/ - Micro	osoft Internet Explorer
Without authorization       With authorization*         Log in screen       Enter the user name and password to log in.         Connection       The storage media of the instrument appear.         Image: Connection       Image: Connection         Image: Connec	<u> </u>	es <u>T</u> ools <u>H</u> elp
Addreg       Hp://192.168.0.2         Without authorization       With authorization*         Log in screen         Enter the user name and password to log in.         Connection         The storage media of the instrument appear.         Image: Signature of the instrument appear.	🚽 🖨 Back 🔻 🔿 🗾 🥘	Search 🔁 Folders 🎯 Histor
Without authorization Log in screen Enter the user name and password to log in. Connection The storage media of the instrument appear. Internet Explorer File Edit View Favorites Tools Help Come Search Come Folders Ftp://192.168.0.2/ - Microsoft Internet Explorer File Edit View Favorites Tools Help Come Folders Cother Places Therenet Explorer Internet Explorer	Address ftp://192.168.0.2	2
Without authorization Log in screen Enter the user name and password to log in. Connection The storage media of the instrument appear. Internet Explorer File Edit View Favorites Tools Help CF FAM		
Log In screen Enter the user name and password to log in. Connection The storage media of the instrument appear. Internet Explorer File Edit View Favorites Tools Help Search Folders File Places The provide a construction of the provide	Without authorization	With authorization*
Connection The storage media of the instrument appear. ftp://192.168.0.2/ - Microsoft Internet Explorer File Edit View Favorites Tools Help Back Back File Edit View Favorites Tools Help CF RAM FAM		Enter the user name and password to log
The storage media of the instrument appear.	Connection	
Ip://192.168.0.2/ - Microsoft Internet Explorer         File       Edit       View       Favorites       Tools       Help         Back •       •       •       •       •       •       •         Address       Internet Explorer       •       •       •       •       •       •         Other Places       •       •       •       •       •       •       •         Internet Explorer       •       •       •       •       •       •       •	The storage media o appear.	f the instrument
File       Edit       View       Favorites       Tools       Help         Image: Search       Image: Search       Image: Folders       Image: Search       Image: Folders         Address       Image: Fitp://192.168.0.2/       Image: Search       Image: Folders       Image: Search         Other Places       Image: Search       Image: Search       Image: Search       Image: Search       Image: Search         Image: Search       Image: Search       Image: Search       Image: Search       Image: Search       Image: Search       Image: Search         Other Places       Image: Search       Image: Search <td>👰 ftp://192.168.0.2/ - Microsoft  </td> <td>Internet Explorer</td>	👰 ftp://192.168.0.2/ - Microsoft	Internet Explorer
Back       Image: Search       Image: Folders       Image: Search         Address       Image: Ftp://192.168.0.2/         Other Places       Image: Search       Image: Search         Internet Explorer       Image: Search       Image: Search	File Edit View Favorites Tools	Help
Address R ftp://192.168.0.2/	🕒 Back 🝷 🕥 🕤 🏂 Sea	arch 🎼 Folders 🛄 🗸
Other Places CF RAM	Address 👰 ftp://192.168.0.2/	
	Other Places	CF RAM

Click a folder icon to display files stored on the media.

\* An authorization user name and password have been set on the **[Interface]** sheet of the system screen. Refer to "16.3.1 Setting the FTP With the Instrument" (p. 356).

You can also enter the user name and password delimited by the colon (:) and the at sign (@) in front of the normal IP address directly.

#### [ftp://Username: Password@instrument IP address]

Example: When the user name is "hioki" and the password is "1234", enter [ftp://hioki:1234@192.168.0.2].

#### If the connection fails

Check the communication settings of the instrument. Refer to "Procedure of setting LAN" (p. 344).

## 16.3.3 Managing Files With the FTP

## Acquiring Files

Select the file to be acquired on the folder list and drag\* it to the download destination (the desktop or a folder outside the Internet Explorer<sup>®</sup> window).

\* Click the file and hold the button down. Move the mouse pointer to the target destination, and then release the button.



Minutes and seconds on the timestamp (date and time) may not be reflected.

#### Deleting and renaming files

Right-click a file in the FTP folder list, and select [Delete] or [Rename] from the shortcut menu.



You cannot upload any files from the computer to the instrument. To copy a file to the built-in drive of the instrument, use a USB flash drive or CF card.

## **16.4 Transferring Data to the computer**

You can transfer the data stored on the built-in drive or in a CF card to the computer using the supplied USB cable.

For more information on how to analyze the data using the supplied application software, refer to the application's help function.

For details about installing and starting the application, refer to "16.5 Wave Viewer (Wv)" (p. 360).

#### System requirements: The computer running Windows 7, Windows 8, or Windows 10

## Setting the instrument

#### Procedure

#### To display the screen

Press the SYSTEM key to display the system screen, and then select the [Interface] sheet.

**1** Move the cursor to the [Interface] box, and select [LAN].

2	Move the cursor to the [USB Set] box, and select [Mass	
	storage HDD] or [Mass storage CF].	

Interface	LAN
USB Set	Mass Storage

You cannot access the USB flash drive, built-in drive, or CF card from the instrument with the **[Mass Storage]** setting. Furthermore, the printer prints at **[Slow/Fine]**, regardless of the **[Print Speed]** setting.

## Connecting the USB cable

Preparation

Stop the measurement in progress and make sure that the file screen is not displayed.



When the connection is established, the computer recognizes the instrument as a removable disk. The computer can now access the data stored on the built-in drive or CF card of the instrument.

## **Disconnecting the USB Cable**

To disconnect the USB cable from the computer that is presently running, click the **[Safely Remove Hardware]** icon and follow the prescribed steps.

## 16.5 Wave Viewer (Wv)

The program, Wave viewer is equipped with the CSV conversion function. You can open the converted files with spreadsheets.

This section explains how to install, uninstall, start, and exit Wave Viewer.

#### System requirements: The computer running Windows 7, Windows 8, or Windows 10

## Installing Wave viewer (for the computer running Windows 7)

- Insert the supplied application disc (CD) into the CD-ROM drive.
   The top page appears automatically.
   If it does not appear, open the "index.htm" file with your web browser.
- 2 Select the display language. Click the [English] icon.
- **3** Click the [Wave viewer (Wv)] icon. The Wv specifications and revision history are displayed.
- 4 Click the [Install] icon at the top right of the page. The [File Download] dialog appears.
- **5** Click [Open]. The confirmation dialog box appears.
  - The committation dialog box appears.
- Click [Next].
   The window for selecting the installation destination opens.
   Click [Browse] to change the installation folder.

7 Click [Next]. The installation starts.

## **Starting Wave viewer**

#### Before using Wave viewer, read the "READ ME."

Click the Start button of Windows<sup>®</sup>, select [Programs], click [HIOKI], and then [Wv].

Wave Viewer is started.

## **Exiting Wave viewer**

#### On the [File] menu of Wave Viewer, click [Exit].

Alternatively, you can click the Close button at the top right of the screen.

## **Uninstalling Wave viewer**

**1** Click the Windows<sup>®</sup> Start button, click [Control Panel], and then click [Uninstall a program].

## 2 Select [HIOKI Wave Viewer (Wv)] to uninstall Wave viewer.

When updating Wave Viewer to a later version, uninstall the earlier version of it before installing the new version.

## 16.6 Configuring the USB Settings and Connecting the Instrument to the Computer (Before Performing Command Communications)

Connecting the instrument and the computer to each other with the USB cable, supplied with the instrument, allows you to control the instrument from the computer.

Before performing command communications, configure the USB settings and establish the connection.

## 16.6.1 Configuring the USB Settings With the Instrument

## Procedure

#### To display the screen

Press the SYSTEM key to display the system screen, and then select the [Interface] sheet.

Move the cursor to the [Interface] box, and select [USB].

The [USB Set] setting is automatically set to [Interface].

– 【 Interface 】— Interface	USB
USB Set	Interface

When the interface has been set to **[USB]**, the following functions are not available.

- Using a USB flash drive
- · Viewing the data saved on the instrument with a computer

## 16.6.2 Installing the USB Driver

Before connecting the instrument via the USB interface, install the USB driver.

Log on to the computer with an administrator privilege to install the driver.

Run [HiokiUsbCdcDriver.msi] in the CD X:\Driver folder.
 ([X] represents the CD-ROM drive. The letter will differ depending on your computer.)

Depending on the environment, it may take some time before the dialog box appears.

Configuring the USB Settings and Connecting the Instrument to the Computer (Before Performing Command Communications)

## 2 Click [Next].



## **3** Click [Next].

#### To change the installation destination

Click **[Browse...]** to change the driver installing folder. Normally, there is no need to change.



4 Click [Next].





## Connecting the Instrument to the computer on which the driver is installed

#### System requirements: The computer running Windows 7, Windows 8, or Windows 10

- If you connect the USB cable while both the instrument and the computer are turned off, be sure to turn on the <u>computer first</u>. If you turn them on in the wrong order, the instrument and computer cannot communicate with each other.
- If noise emitted from the USB cable affects other equipment in the vicinity, wind the USB cable once around the supplied ferrite clamp-on choke (for LAN/USB cable), as shown in the illustration on the right.



- Plug the USB cable supplied with the instrument into the USB connector (Type B) on the right side of the instrument.
- 2 Connect the other end of the cable to a USB port on the computer.





The instrument will be recognized, and the device is ready to use automatically.

## Uninstalling the USB Driver

When the USB driver is no longer needed, uninstall it by following the procedure below (for the computer running Windows 7).

- 1 Click the Windows<sup>®</sup> Start button, click [Control Panel], and then click [Uninstall a program]. The list of the installed programs appears.
- **2** Click [HIOKI USB CDC Driver], and then, click [Uninstall].

## 16.7 Controlling the Instrument with Command Communications (LAN/USB)

You can control the instrument remotely using commands via the communications interface (LAN or USB).

- For details, see the Communication Command Instruction Manual on the supplied application disc.
- Before using the command communications, the LAN or USB setting and connections must be configured properly.

Refer to LAN "16.1" (p. 342) and USB "16.6" (p. 361).

## CAUTION

In an environment where noise from inverters or similar devices is present, errors may occur when controlling the instrument remotely. Ensure that the environment is not subject to excessive noise.

## Setting Details

Delimiter	Set the newline delimiter, used in the command response messages, to LF or CR+LF. The instrument accepts both of the LF and CR+LF settings.
Header	The header is used for controlling the instrument with the communications commands. The header setting specifies whether to prefix the header to the command response messages. For more information about commands, refer to the Communications Command Instruction Manual on the supplied CD.
Command Port (Port number) (LAN only)	The instrument uses the TCP/IP protocol for the communications. The TCP/IP protocol allows communicating devices to establish multiple connections, which are distinguished by the port numbers. By default, the instrument uses the port numbers 8800 through 8809. • 8800 through 8801: Reserved • 8802 (the instrument servers as the server): For the communications command control • 8803 through 8809: Reserved Normally, these port numbers do not need to be changed. You can change them if certain ports cannot be used for security reasons, or if certain ports are not available on the computer to be communicated. Set only the most significant three digits. The least significant digit (0 through 9) is used by the instrument or reserved for use by the instrument.

## 16.7.1 Setting the Instrument

Configure the command communications settings.

## Procedure

#### To display the screen

Press the **SYSTEM** key to display the system screen, and then select the **[Interface]** sheet.

## **1** Set the delimiter.

Move the cursor to the [Delimiter] box.

## **2** Select the header.

Move the cursor to the [Header] box.

LF	Sends the character code 0x0a.
CR+LF	Sends the character codes 0x0d and 0x0a.
Off	Does not add any header to response data.
On	Adds the header to response data.

. . . .

## **3** Set the communications command port. (LAN only)

Move the cursor to the [Port Number] box and enter the port number.

About the header		<b>1</b> Delimiter	LF
The response to the <b>[:FUNCTION?]</b> query sent from	About the port number Specify only the most significant 3	2Header	Off
the computer differs according to the header setting. With the [On]setting [:FUNCTION MEM] With the [OFF]setting [MEM]	digits of the 4-digit port number. If you specify "880x," the port number 8802 will be used. (p. 365)	<b>3</b> Port Number	690x

## 16.8 Operating the Instrument Remotely and Acquiring Data Using the Model 9333 LAN Communicators

The Model 9333 LAN Communicator, which is the optional communication program for computers, allows you to control the instrument from the computer remotely and store data directly on the computer. Additionally, Model 9333 enables you to print waveforms with the printer connected to the computer.

## Procedure

## 1 Configure the LAN Communicator setting.

On	Allows you to use LAN Communicator.
OFF	Does not allow you to use LAN Communicator.

## **2** Set the data collection server.

Specify the IP address of the computer on which Model 9333 LAN Communicator is running to communicate with the instrument.

The IP address is required to acquire data using the Model 9333 LAN Communicator.

If necessary, set "LAN:\" as the save destination on the [File Save] screen and set [LAN] as the output destination of the Print Key operation and the auto-print setting.

## **3** Confirm the settings.

Move the cursor to the **[Reset]** box. Select **[Reflect Set]**.

The message "LAN was reconnected" appears at the bottom of the screen.

For the settings of the 9333 LAN Communicator, see the instruction manual of Model 9333 LAN Communicator.

	. 1	- 1	
USB Set USB Stick			
1 LAN Communicator On 2 Data Server 192 168 0 1			
	J	-	

Operating the Instrument Remotely and Acquiring Data Using the Model 9333 LAN Communicators

# 17 Controlling the Instrument Externally

Read "Before connecting the instrument to an external device" (p. 14) carefully.

This chapter describes how to exchange signals through the terminals, enabling you to control the

instrument externally.

We use the term "external control terminals" to refer to all of those terminals.

Signals input into the external control terminals take effect even when the key lock function is engaged.

## To display the [Environment] Sheet



## **17.1 Connection of the External Control Terminals**

The method for connecting wires to the external control terminals is as follows.

#### Procedure

## Cables to be connected



Supporting wire: Compatible wire:

to 22)



Stripped length:

#### Wire Connecting procedure





Solid wire 0.65 mm in diameter (AWG22) Stranded wire 0.32 mm<sup>2</sup> (AWG22) Solid wire 0.32 mm to 0.65 mm in diameter (AWG28

Stranded wire 0.08 mm to 0.32 mm<sup>2</sup> (AWG28 to 22) Strand diameter 0.12 mm or more (per wire) 9 mm to 10 mm Button pressing tool: Flat-blade screwdriver (shaft diameter: 3 mm, tip width: 2.6 mm)

- 1 Depress the button on the connector with the flat-blade screwdriver or another tool.
- 2 While depressing the button, insert the cable into the cable connection hole.
- 3 Release the button. The cable is locked.



Terminal No.	Operation
1	Executes the following operations
2	when signals are input externally. <ul> <li>Starts/ends the measurement</li> </ul>
3	<ul> <li>Prints/saves the data.</li> <li>Sets the X-Y curve plotting setting to on/off (for X-Y recorder function)</li> </ul>
4	GND (common with the instrument's ground)
5	Outputs signals depending on the instrument state.
6	
7	GND (common with the instrument's ground)
8	Sets the sampling rate when a signal is input externally.
9	GND (common with the instrument's ground)
10	Outputs a signal when triggers.
11	Triggers when a signal is input externally.

## 17.2 External I/O

## 17.2.1 External Input (START/EXT.IN1) (STOP/EXT.IN2) (PRINT/EXT.IN3)

Externally inputting signals can start and stop the measurement as well as print and save the data. The factory-default settings are **[Start]**, **[Stop]**, and **[Print]**.

## Signal inputting procedure

**1** Connect each of the START/EXT.IN1, STOP/EXT.IN2, PRINT/EXT.IN3, and GND terminals to an external signal-outputting device using the wires.

Refer to "17.1 Connection of the External Control Terminals" (p. 370).

- **2** Press the SYSTEM key to display the [Environment] sheet and move the cursor to the [START/EXT. IN1], [STOP/EXT. IN2], or [PRINT/EXT. IN3] box.
- **3** Select the operation to be performed by the instrument in response to the external input signal.

START	Starts the measurement. (Regardless of [Start Action] [p. 338]).
STOP	Stops the measurement. (Post-measurement processes such as numerical calculations and automatic saving are performed.)
START/STOP	Starts measurement when the low-level signal is input; stops the measurement when the high-level signal is input.
ABORT	Stops the measurement immediately. (Post-measurement processes such as numerical calculations and automatic saving are performed.)
PRINT	Performs the same operation as that when the <b>PRINT</b> key is pressed. ([Select at print] [p. 130] is disabled.)
SAVE	Saves the data to the specified media under the specified condition, both of which are specified with the SAVE key. ([Select at save] [p. 103] is disabled
Pen Up/Down	Plots the X-Y composite curves when the low-level signal input; does not plot them when the high-level signal is input. (for X-Y recorder function)
RUN/STOP	Outputs the waveforms when the low-level signal is input; stops outputting the waveforms when the high-level signal is input.
PAUSE	Pauses the outputting of the waveforms.

• When the STOP signal is input, the instrument stops the measurement along the [STOP Action] setting, in the same manner as when the [STOP] key is pressed (p. 338).

• The instrument ignores external inputs while displaying the HELP screen or a dialog box.

\_

# **4** Short-circuit the terminal and GND with each other, or the input pulse wave or rectangular wave to the terminal. The signal shall be with a high-level voltage of between 3.0 V and 5.0 V and a low-level voltage of between 0 V and 0.8 V.

The low level of the input waveform controls the instrument.

	20 ms or 5 V
Maximum input voltage	-0.5 V to 7 V
Pulse width	High level: 20 ms or longer; Low level: 30 ms or longer
Available voltage range	High level: 3.0 V to 5.0 V; Low level: 0 V to 0.8 V



## 17.2.2 External Output (GO/EXT.OUT1) (NG/EXT.OUT2)

The instrument can output various signals depending on its state.

## Signal inputting procedure

**1** Connect each of the GO/EXT.OUT1, NG/EXT.OUT2, and GND terminals to an external signalinputting device using the wires.

Refer to "17.1 Connection of the External Control Terminals" (p. 370).

**2** Press the SYSTEM key to display the [Environment] sheet, and move the cursor to the [GO/ EXT. OUT1] or [NG/EXT. OUT2] box.

## **3** Select the conditions under which the instrument outputs a signal.

(When using the [GO/EXT. OUT1] setting)

Measure	Outputs the low-level signal when giving a GO (pass) judgment to the numerical calculation result.
Waveform Evaluation	Outputs the low-level signal when giving a GO (pass) judgment to the waveform evaluation result.
Value Evaluation or Waveform Evaluation	Outputs the low-level signal when giving a GO (pass) judgment to either the value calculation or waveform calculation evaluation result.
Value Evaluation and Waveform Evaluation	Outputs the low-level signal when giving GO (pass) judgments to both the value calculation and waveform evaluation result.
Error	Outputs a low-level signal when an error occurs.
BUSY	Outputs a low-level signal when rejecting a START signal because the instrument is in the busy state such as performing the measurement, saving the data, and printing the data.
Trigger	Outputs a low-level signal while waiting for a trigger.

The instrument keeps outputting the signal for a GO (pass) judgment (low-level output) until it starts the next measurement.

## (When using the [NG/EXT. OUT2] setting)

Measure	Outputs the low-level signal when giving an NG (fail) judgment to the numerical calculation result.
Waveform Evaluation	Outputs the low-level signal when giving an NG (fail) judgment to the waveform evaluation result.
Value Evaluation or Waveform Evaluation	Outputs the low-level signal when giving an NG (fail) judgment to either the value calculation or waveform calculation evaluation result.
Value Evaluation and Waveform Evaluation	Outputs the low-level signal when giving NG (fail) judgments to both the value calculation and waveform evaluation result.
Error	Outputs a low-level signal when an error occurs.
BUSY	Outputs a low-level signal when being in the busy state such as performing the measurement, saving the data, and printing the data. Switches to the high level when coming out of the busy state.
Trigger	Outputs a low-level signal while waiting for a trigger.
Probe Calibration	Outputs the signal (1 kHz) that can be used for the calibration of Model 9665 10:1 Probe and Model 9666 100:1 Probe.

The instrument keeps outputting the signal for an NG (fail) judgment (low-level output) until it starts the next measurement.

The instrument can output various signals depending on its state.



(M E M)

## 17.2.3 External Sampling (EXT.SMPL)

This function can be used in the memory function only. Externally inputting the signal can control the sampling rate.

## Signal inputting procedure

- **1** Connect each of the EXT.SMPL and GND terminals to an external signal-outputting device using the wires.
- **2** Press the SYSTEM key to display the [Environment] sheet, and move the cursor to the [EXT. SMPL] box.
- 3 Select whether the instrument triggers on the rising edge (↑) or falling edge (↓) of the waveform.
- **4** Input the pulse wave or rectangular wave to the EXT.SMPL terminal. Make sure that the signal is with a high-level voltage of between 3.0 V and 5.0 V and a low-level voltage of between 0 V and 0.8 V.

The instrument samples the data on the rising edge or falling edge of the input waveform. Note that the sampling rate is limited depending on the selected edge. For proper operation, pulse width must be at least that shown in the following table.

	Pulse width					
Setting (EXT.SMPL)	When Roll mode is set to [On]			When Roll Mode is set to [Off]		
	t <sub>H</sub>	t <sub>L</sub>	t	t <sub>H</sub>	tL	t
Rising edge (↑)	> 5 µs	> 5 µs	> 10 µs	> 50 ns	> 50 ns	> 100 ns
Falling edge ( $\downarrow$ )	> 5 µs	> 5 µs	> 10 µs	> 50 ns	> 50 ns	> 100 ns

Minimum pulse width of the external sampling

Available voltage rangeHigh level: 3.0 V to 5.0 V; Low level: 0 V to 0.8 VPulse widthHigh level, low level: 50 ns or longer

Pulse width Response frequency

10 MHz or lower

Maximum input voltage -0.5 V to 7 V



17

- If a sampling signal of 5 MHz or higher is input, trigger points are delayed by one sample.
- The Roll mode setting of **[Auto]** and **[On]** are valid even when the external sampling is used: however, if the frequency of the external sampling signal is higher than 100 kHz, set Roll mode to **[Off]**. Failure to do so will make the instrument unable to sample the data correctly.
- The anti-aliasing filter (A.A.F) is disabled regardless of its setting. Refer to "8.10.1 Setting the Anti-aliasing Filter (A.A.F)" (p. 186).
- When Roll mode is set to [Auto] or [On], the instrument ignores external sampling signals during the following periods:

(1) The period between 150  $\mu s$  and 200  $\mu s$  after the first sampling clock has been entered

- (2) Two clock periods after the dead time described in item (1)
- When the external sampling setting is valid, you cannot change the output settings of Models MR8790, MR8791, and U8793.

## 17.2.4 Trigger Output (TRIG OUT)

The instrument output the signal when triggering. This feature allows multiple instruments to be controlled, achieving the synchronous operation.

## Signal outputting procedure

**1** Connect each of the TRIG OUT and GND terminals to an external signal-inputting device using the wires.

Refer to "17.1 Connection of the External Control Terminals" (p. 370).

**2** Press the SYSTEM key to display the [Environment] sheet, and move the cursor to the [TRIG. OUT] box.

## **3** Select the output signal type for the trigger output terminal.

Pulse	Outputs the low-level signal, and then switches to the high level after the specified time has elapsed.
Level	Outputs the low-level signal after triggering, keeping outputting it during the measurement.

When triggering, the instrument outputs the pulse, which switches from the high level (4.0 V to 5.0 V) to the low level (0 V to 0.5 V) via the TRIG OUT terminal.

Output signal	Open drain output (with voltage output), active low*
Output voltage range	High level: 4.0 V to 5.0 V low level: 0 V to 0.5 V (current value of 15 mA)
Pulse width	When using the pulse setting: $2 \text{ ms} \pm 0.1 \text{ ms}$ When using the level setting: (Sampling rate) × (Number of pieces of data after trigger) or longer
Maximum input voltage	50 V DC, 50 mA DC, 200 mW

\* The instrument triggers when the signal voltage level switches from high to low.



- When the auto-ranging function is used in the memory function, the instrument triggers, outputting the TRIG OUT signal. Keep this in mind when performing auto-range measurement while using the TRIG OUT signals.
- When using the memory division function, the instrument may output the TRIG\_OUT signals irregularly under the following conditions:
  - The timebase is set to one between 5 µs/div and 100 µs/div
  - The record (measurement) time is set to 5 ms or less
  - [Wave display] is set to [OFF].

## 17.2.5 External Trigger Terminal (EXT.TRIG)

Externally inputting the trigger signal can trigger the instrument. This feature allows multiple instruments to be controlled, achieving the synchronous operation.

## Signal inputting procedure

**1** Connect each of the EXT.TRIG and GND terminals to an external signal-outputting device using the wires.

Refer to "17.1 Connection of the External Control Terminals" (p. 370).

- 2 In the Trigger Settings window, set the external trigger to [On].
- **3** Press the SYSTEM key to display the [Environment] sheet, and move the cursor to the [EXT. TRIG] box.
- 4 Select whether the instrument triggers on the rising edge (↑) or falling edge (↓) of the waveform.
- 5 Short-circuit the EXT.TRIG terminal and GND with each other, or input the pulse wave or rectangular wave to the EXT.TRIG terminal. The signal shall be with a high-level voltage of between 3.0 V and 5.0 V and a low-level voltage of between 0 V and 0.8 V.

The instrument triggers on the rising or falling edge of the input waveform.





## **18.1 General Specifications of the Instrument**

## **Basic specifications**

Measurement functions	<ul> <li>Memory function</li> <li>Recorder function</li> <li>X-Y recorder function</li> <li>FFT function</li> </ul>			
Maximum number of channels	number of Analog 16 channels + logic 16 channels at a maximum, or analog 32 channels + logic 16 channels at a maximum (when 8 modules of Model U8978 4CH Analog Unit or U8978 4CH Analog Unit are installed), or analog 10 channels + logic 64 channels at a maximum (Together with the logic channels the instrument provides, when 3 modules of Model 8973 Logic Unit are installed) or analog 20 channels + logic 64 channels at a maximum (Together with the logic channels the instrument provides, when 5 modules of Model U8975 4CH Analog Unit or U8978 4CH Analog Unit are installed)			
Number of modules	Up to 8 modules Restrictions • Up to 4 modules of Model 8971 Current Unit can be installed. • Up to 3 modules of Model 8973 Logic Unit can be installed. • Up to 3 modules of Model U8977 3CH Current Unit			
Number of the instrument logic channels	<ul> <li>16 (The input connectors of logic channels share the ground with the instrument.)</li> <li>Installing Model MR8990 Digital Voltmeter Unit in both slots for Unit 1 and Unit 2 disables the instrument logic channels.</li> <li>Restrictions imposed when the logic instrument channels are used (when the logic measurement is set to on)</li> <li>Measurement resolution of each measuring module decreases to 12 bits when the module is installed in a slot for Unit 1 or Unit 2.</li> <li>No frequency measuring modules are available when the module is installed in the slots for Unit 1 or Unit 2.</li> </ul>			
Sampling rate	20 MS/s (Simultaneously sampling all channels)			
Memory capacity	<ul> <li>Model MR8847-51 (Total memory: 64 MW)</li> <li>2 MW/ch (in 32-channel mode), 4 MW/ch (in 16-channel mode), 8 MW/ch (in 8-channel mode), 16 MW/ch (in 4-channel mode), 32 MW/ch (in 2-channel mode)</li> <li>Model MR8847-52 (Total memory: 256 MW)</li> <li>8 MW/ch (in 32-channel mode), 16 MW/ch (in 16-channel mode), 32 MW/ch (in 8-channel mode), 64 MW/ch (in 4-channel mode), 128 MW/ch (in 2-channel mode)</li> <li>Model MR8847-53 (Total memory: 512 MW)</li> <li>16 MW/ch (in 32-channel mode), 32 MW/ch (in 16-channel mode)</li> <li>Model MR8847-53 (Total memory: 512 MW)</li> <li>16 MW/ch (in 32-channel mode), 32 MW/ch (in 16-channel mode), 64 MW/ch (in 8-channel mode), 128 MW/ch (in 16-channel mode), 64 MW/ch (in 8-channel mode), 128 MW/ch (in 4-channel mode), 256 MW/ch (in 2-channel mode)</li> </ul>			
Operating environment	Indoors, Pollution Degree 2, altitude up to 2000 m (6562 ft.)			
Operating temperature and humidity	Temperature: −10°C to 40°C (14°F to 104°F) Humidity: 20% RH to 80% RH (no condensation) When the printer and the internal drive (Model U8331 SSD Unit) are used Temperature: 0°C to 40°C (32°F to 104°F) Humidity: 20% RH to 80% RH (no condensation)			
Storage temperature and humidity	−20°C to 50°C (−4°F to 122°F), 90% RH or less (no condensation)			
Standards	Safety EN61010 EMC EN61326 Class A			

18

Power supply	Rated supply voltage: Rated supply frequency: Anticipated transient overvoltage DC power supply input Rated supply voltage:	<ul> <li>100 V to 240 V AC (continuous input) (Voltage fluctuations of ±10% from the rated supply voltage are taken into account.)</li> <li>50 Hz / 60 Hz</li> <li>2500 V</li> <li>10 V to 28 V DC (Model 9784 DC Power Supply Unit) (Voltage fluctuations of ±10% from the rated supply voltage are taken into account.)</li> </ul>	
Maximum rated power	220 VA (When the printer is used) 130 VA (When the printer is not used)		
Clock	Automatic calendar, automatic leap year adjustment, 24-hour clock Accuracy: $\pm 100$ ppm (Operated within the operating temperature range) Reference value: $\pm 10$ ppm (at 25°C)		
Backup battery life	Approx. 10 years (reference duration at 25°C) for clock and settings		
Interface	LAN, USB, External control terminals		
Dimensions	Approx. 351W × 261H × 140D mm (13.82"W × 10.28"H × 5.51"D) (excluding protrusions) Approx. 365W × 307H × 160D mm (14.37"W × 12.09"H × 6.30"D) (including protrusions)		
Mass	Approx. 7.6 kg (268.1 oz.) (Model MR8847A with no modules is installed) Approx. 9.6 kg (338.6 oz.) (Model MR8847A with Model 8966 Analog Unit is installed)		
Product warranty period	3 years U8331 SSD UNIT : 1 year		

## Specifications for accuracy

Conditions of guaranteed accuracy	Guaranteed accuracy period: Temperature and humidity for Warm-up time:	1 year guaranteed accuracy: 23°C ±5°C (73°F ±9°F), 20% RH to 80% RH At least 30 minutes
Time axis accuracy	±0.01% (represents the relative error between the grid and time)	
Paper feeding accuracy	±1% (25°C, 60% RH)	

## Display

Display type	10.4-inch SVGA TFT color LCD (800 × 600 dots)		
Display resolution	T-Y waveform display: 25 div (horizontal axis [time axis]) × 20 div (vertical axis [voltage axis]) X-Y composite curve display: 20 div (X-axis) × 20 div (Y-axis)		
Dot pitch	0.264 (horizontal) × 0.264 (vertical) mm		
Backlight operating life	Approx. 80,000 hours (until brightness of LED light source decreases by half)		

## Printer

Recording method	Thermosensitive recording method using the thermal line head	
Recording paper	Approx. 216 mm × 30 m (8.50" × 98.43 ft.) roll-type thermosensitive paper (Model 9231 Recording Paper)	
Recording width	Overall recording width:Approx. 208 mmWaveform part:Approx. 200 mm	
Recording speed	Approx. 50 mm/s (at a maximum)	
Recording paper loading method	One-touch system	

## External storage device

## CF card

CF card slot	50-pin, 1 slot
Card type	CompactFlash
Compatible CF card	Model 9728 PC Card 512M Model 9729 PC Card 1G Model 9830 PC Card 2G
Data format	FAT, FAT32
Storage contents	Setting conditions, measured data (binary or text, saving data within the period between Cursors A and B is available), screen images (BMP), printing images (BMP), numerical calculation results, data decimation saving (text: simple), waveform evaluation conditions (evaluation area and setting conditions), user-defined waveform data (when Model U8793 is installed), generation program data (when Model U8793 is installed), pulse pattern data (when Model MR8791 is installed)

## Built-in drive (Model U8331 SSD Unit, which is a factory-option, is installed)

Storage system	2.5-inch SSD (MLC)
Storage capacity	128 GB
Data format	FAT32
Storage contents	Setting conditions, measured data (binary or text, saving data within the range between Cursors A and B is available), screen images (BMP), printing images (BMP), numerical calculation results, data decimation saving (text: simple), waveform evaluation conditions (evaluation area and setting conditions), user-defined waveform data (when Model U8793 is installed), generation program data (when Model U8793 is installed), pulse pattern data (when Model MR8791 is installed)

## Specifications of interface

## LAN interface

Compliant standards	IEEE802.3 Ethernet 100BASE-TX	
Function	FTP server, HTTP server	
Connector	RJ-45	
Maximum cable length	100 m	

## **USB** interface

Compliant standards	Compliant with USB2.0
Host	Connector: Series-A receptacle Connecting device: USB flash drive, mouse
Functions	Number of ports: 1 Connector: Series-B receptacle Connecting device: Computer Functions: Mass storage device class (for transferring contents from built-in drive or CF card to computer) Communications device class (computer-controlled)

## Accessories and options

Accessories	Refer to "Instrument and accessories" (p. 3).
Options	Refer to "Appx. 3.1 Options" (p. Appx.15).

## **18.2 Common Functions**

## Module settings / Waveform display settings

Measurement mode	Depends on modules		
Measurement range	Depends on modules		
Input coupling	Depends on modules		
Low-pass filter	Depends on modules		
Probe settings	Automatic scaling based on probes (by entering model or voltage division ratio)		
Displayed graphs	Graph display setting with multi-screen and multi-printing function enabled (up to 16 graphs)		
Waveform display	Off or selectable from among 16 colors		
Display sheet	1 through 4 It is possible to set settings related to waveform display with respect to each display sheet, and switch a display sheet to another.		
Print density	4 levels		
Waveform display position	In 1% increments Preset position (selectable from ascending order, descending order, 0%, or 50%)		
Zero adjust	Executable collectively for all ranges of all channels		
Waveform display magnification/ reduction	Horizontal axis (Time axis): ×10, ×5, ×2, ×1, (Magnification is available for the memory function only) ×1/2, ×1/5, ×1/10, ×1/20, ×1/50, ×1/100, ×1/200, ×1/500, ×1/1000, ×1/2000, ×1/2000, ×1/20000, ×1/20000, ×1/20000 Vertical axis (Voltage axis): ×100, ×50, ×20, ×10, ×5, ×2, ×1, ×1/2, ×1/5, ×1/10		
Variable (user- defined display range)	Settable between by specifying upper and lower values and by specifying a voltage per division		
Scaling	Automatic scaling (10:1, 100:1, 1000:1, predetermined ratios based on current probes selectable) Manual scaling (conversion ratio setting, two-point setting, measurement unit settings)		
Invert function	Polarity reversal		
Vernier function	Yes		
Comment entry	Alphanumeric, Japanese characters (title, each analog channel, each logic channel)		
Comment entry method	Simple input with the keys of the Memory HiCorder, mouse, keyboard Previously saved strings and past input strings entry (previously saved and past input strings can be recalled, inserted and edited)		
Channel setting copy	Copy and paste, paste all		
Logic setting	Width:Selectable from three options: wide, standard, and narrowDisplay position:Freely settable in 1% incrementsDisplay bits:Off or selectable from among 16 colors, settable with respect to each bit		
Zoom function	Screen horizontally split into two, and the lower portion displays zoomed waveforms.		

## **Trigger function**

Trigger method	Digital comparison
Trigger mode	Single, repeat, automatic (memory function, FFT function) Single, repeat (recorder function)

Trigger source	Analog module (CH1 through CH32), 16 logic channels included as standard and logic modules (up to 3 modules, 48 channels) External trigger, manual trigger, timer trigger		
Trigger conditions	Logical AND or OR of each of trigger sources		
Analog trigger	Level trigger	The instrument triggers when an input signal voltage exceeds or falls below a predetermined voltage.	
	Voltage sag trigger	The instrument triggers when the peak voltage of an input signal falls below a user-defined voltage. (dedicated to 50 Hz / 60 Hz commercial power)	
	Window trigger	A range provided by upper and lower levels is previously set. The instrument triggers when an input signal voltage falls within (IN) or outside (OUT) the user-defined range.	
	Period trigger	A period-measuring level and a period range are previously set. Periods between when a voltage exceeds or falls a predetermined level are measured, and the instrument triggers when the period falls outside the user-defined range.	
	Glitch trigger	A voltage level and a pulse width (glitch width) are previously set. Pulse widths from when rising or falling edges crosses the predetermined level are measured, and the instrument triggers when a signal pulse width becomes narrower than the predetermined pulse width.	
	Event trigger	The number of events (numerical value) is previously set. The instrument triggers when the number of events exceeds the predetermined number.	
Logic trigger	Pattern trigger speci	fied by 1, 0, or x (x represents that either of them is accented.)	
External trigger	The instrument triggers when an external signal is input		
Manual trigger	The instrument triggers when the manual trigger key is pressed.		
Timer trigger	The instrument triggers on event based on the time and interval settings		
Trigger filter	Off, 0.1, 0.2, 0.5, 1.0, 1.5, 2.0, 2.5, 5.0, 10.0 div (memory function, FFT function) Off On (10 ms fixed, recorder function)		
Trigger level resolution	0.1% f.s. (f.s. = 20 div)		
Pre-trigger	Applicable for memory function and FFT functionSetting in0, 2, 5, 10, 20, 30, 40, 50, 60, 70, 80, 90, 95, 100, -95%percent:Setting inSettable in one division incrementsdivisions:Trigger priority:Off, on		
Trigger output	Open collector output With 5-volt outputs, active low, low output level: 0 V to 0.5 V (current of 15 mA) Pulse width for level setting: [(sampling rate) × (number of data points after trigger)] or more Pulse width for pulse setting: 2 ms ±1 ms		
Trigger input and output terminals	Terminal block		
Trigger marker	Trigger marks indica	te positions of trigger events	
Trigger timing (behavior on trigger)	Start (all functions), stop (recorder function), start & stop (recorder function)		
Trigger search function	After a measuremen	t, the position that meets a trigger condition is searched for.	

## **18.3 Measurement Functions**

## 18.3.1 Memory Function

	• • • • • • • • • • • • • • • • • • • •	· · · · · · · · · · · · · · · · · · ·	
Timebase (time axis)	5*, 10, 20, 50, 100, 200, 500 µ 1, 2, 5, 10, 20, 50, 100, 200, 5 1, 2, 5, 10, 30, 50, 100 s/div 1, 2, 5 min/div External sampling (100 sampl * If using Model U8975, U897	ıs/div 00 ms/div es/div, freely settable) 7, or U8978, 5 μs/div will not be available.	
Time axis resolution	100 points/div		
Sampling rate	1/100 of timebase setting		
Recording length	Model MR8847-51 (Total memory: 64 MW)		
	Fixed recording length:	25, 50, 100, 200, 500, 1,000, 2,000, 5,000, 10,000 div (in 2-, 4-, 8-, 16, 32-channel mode), 20,000 div (in 2-, 4-, 8-, 16-channel mode), 50,000 div (in 2-, 4-, 8-channel mode), 100,000 div (in 2-, 4-channel mode), 200,000 div (in 2-channel mode)	
	User-defined recording length	Settable in one div increments (up to 320,000 div)	
	• Model MR8847-52 (Total me	mory: 256 MW)	
	Fixed recording length:	25, 50, 100, 200, 500, 1,000, 2,000, 5,000, 10,000, 20,000, 50,000 div (in 2-, 4-, 8-, 16, 32-channel mode), 100,000 div (in 2-, 4-, 8-, 16-channel mode), 200,000 div (in 2-, 4-, 8-channel mode), 500,000 div (in 2-, 4-channel mode), 1,000,000 div (in 2-channel mode)	
	User-defined recording length	Settable in one division increments (up to 1,280,000 div)	
	Model MR8847-53 (Total me	mory: 512 MW)	
	Fixed recording length:	25, 50, 100, 200, 500, 1,000, 2,000, 5,000, 10,000, 20,000, 50,000, 100,000 div (in 2-, 4-, 8-, 16, 32-channel mode), 200,000 div (in 2-, 4-, 8-, 16-channel mode), 500,000 div (in 2-, 4-, 8-channel mode), 1,000,000 div (in 2-, 4-channel mode), 2 000 000 div (in 2-channel mode)	
	User-defined recording length	Settable in one division increments (up to 2,560,000 div)	
	If using Model U8975, U8977, 16-channel mode will not be a	or U8978, the setting is fixed to 32-channel mode (2-, 4-, 8-, vailable).	
Screen and printing settings	1 screen, 2 screens, 4 screens	s, 8 screens, 16 screens, X-Y 1 screen, or X-Y 4 screens	
Interpolation function	Line, line and dot (X-Y display	)	
Waveform scrolling	Horizontally scrolling the displa Backward scrolling is available	ay is available. e in roll mode.	
Overlay function	Automatic: Always overlays w restarting measurements Manual: Overlays necessary	vaveforms when starting measurements and clears when waveforms only, and clears them as needed	
Automatic printing	Automatically prints waveform printing waveforms is available	s after measurements (At relatively slower sampling rate, e while recording them.)	
Manual printing	By pressing the <b>PRINT</b> key (pri	nts waveforms at up to 50 mm/s, depending on print coverage)	
Partial printing	Prints waveforms within the ra	nge between Cursors A and B (Whole, A-B)	
Automatic saving	Automatically saves data on a measurements (in binary or te At relatively slower sampling r	CF card, a USB flash drive, or the built-in drive after xt format). ate, saving waveforms is available while recording them.	
Report printing	Yes		
Channel modes	Selectable between 2-, 4-, 8-, If using Model U8975, U8977,	and 16-channel modes or U8978, the setting is fixed to 32-channel mode.	

. . . . . . . . . . . .

## 18.3.2 Recorder Function

Timebase (time axis)	10, 20, 50, 100, 200, 500 ms/ 1, 2, 5, 10, 30, 50, 100 s/div 1, 2, 5, 10, 30 min/div 1 h/div	div
Time axis resolution	100 points/div	
Sampling rate	1, 10, 100 μs 1, 10, 100 ms (select from per	iods that are 1/100 or less of the timebase setting)
Recording length	• Model MR8847-51 (Total memory: 64 MW)	
	Fixed recording length:	25, 50, 100, 200, 500, 1,000, 2,000, 5,000, 10,000, 20,000* div
	User-defined recording length:	Settable in one division increments (up to 20,000 div)
	Repeat	
	Model MR8847-52 (Total me	mory: 256 MW)
	Fixed recording length:	25, 50, 100, 200, 500, 1,000, 2,000, 5,000, 10,000, 20,000, 50,000* div
	User-defined recording length:	Settable in one division increments (up to 80,000 div)
	Repeat	
	Model MR8847-53 (Total me	mory: 512 MW)
	Fixed recording length:	25, 50, 100, 200, 500, 1,000, 2,000, 5,000, 10,000, 20,000, 50,000, 100,000* div
	User-defined recording length:	Settable in one division increments (up to 160,000 div)
	Repeat	
	* Not available if using Model	U8975, U8977, or U8978
Screen and printing settings	1, 2, 4, 8, 16 screens	
Screen and printing settings Waveform storage	1, 2, 4, 8, 16 screens Model MR8847-51: The most internal m Model MR8847-52: The most internal m Model MR8847-53: The most	recent 20,000 divisions of measured data are written in the lemory (if using Model U8975, U8977, or U8978: 10,000 div). recent 80,000 divisions of measured data are written in the hemory. (if using Model U8975, U8977, or U8978: 40,000 div). recent 160,000 divisions of measured data are written in the
Screen and printing settings Waveform storage	1, 2, 4, 8, 16 screens Model MR8847-51: The most internal m Model MR8847-52: The most internal m Model MR8847-53: The most internal m	recent 20,000 divisions of measured data are written in the lemory (if using Model U8975, U8977, or U8978: 10,000 div). recent 80,000 divisions of measured data are written in the hemory. (if using Model U8975, U8977, or U8978: 40,000 div). recent 160,000 divisions of measured data are written in the hemory. (if using Model U8975, U8977, or U8978: 80,000 div).
Screen and printing settings Waveform storage Waveform scrolling	1, 2, 4, 8, 16 screens Model MR8847-51: The most internal m Model MR8847-52: The most internal m Model MR8847-53: The most internal m Scrolling horizontally the displ Backward scrolling during me	recent 20,000 divisions of measured data are written in the hemory (if using Model U8975, U8977, or U8978: 10,000 div). recent 80,000 divisions of measured data are written in the hemory. (if using Model U8975, U8977, or U8978: 40,000 div). recent 160,000 divisions of measured data are written in the hemory. (if using Model U8975, U8977, or U8978: 80,000 div). ay is available with the jog dial and shuttle ring. asurement is available.
Screen and printing settings Waveform storage Waveform scrolling Real-time printing	1, 2, 4, 8, 16 screens Model MR8847-51: The most internal m Model MR8847-52: The most internal m Model MR8847-53: The most internal m Scrolling horizontally the displ Backward scrolling during me Available with the timebase set (Even during measurement, p With the timebase set to one h simultaneously with some delated except continuous is available With the timebase set to one h waveforms is required after m	recent 20,000 divisions of measured data are written in the hemory (if using Model U8975, U8977, or U8978: 10,000 div). recent 80,000 divisions of measured data are written in the hemory. (if using Model U8975, U8977, or U8978: 40,000 div). recent 160,000 divisions of measured data are written in the hemory. (if using Model U8975, U8977, or U8978: 80,000 div). recent 160,000 divisions of measured data are written in the hemory. (if using Model U8975, U8977, or U8978: 80,000 div). ay is available with the jog dial and shuttle ring. asurement is available. At to 500 ms/div or slower. ressing the specific <b>F</b> key starts and stops printing.) between 10 ms/div and 200 ms/div, prints waveforms ay from recording (Any of the recording length settings ). between 10 ms/div and 200 ms/div, manually printing easurement stops.
Screen and printing settings         Waveform storage         Waveform scrolling         Real-time printing         Automatic printing	<ul> <li>1, 2, 4, 8, 16 screens</li> <li>Model MR8847-51: The most internal m</li> <li>Model MR8847-52: The most internal m</li> <li>Model MR8847-53: The most internal m</li> <li>Scrolling horizontally the disple Backward scrolling during me</li> <li>Available with the timebase set (Even during measurement, p</li> <li>With the timebase set to one b</li> <li>simultaneously with some delates except continuous is available</li> <li>With the timebase set to one b</li> <li>waveforms is required after m</li> <li>Automatically prints waveform</li> </ul>	recent 20,000 divisions of measured data are written in the hemory (if using Model U8975, U8977, or U8978: 10,000 div). recent 80,000 divisions of measured data are written in the hemory. (if using Model U8975, U8977, or U8978: 40,000 div). recent 160,000 divisions of measured data are written in the hemory. (if using Model U8975, U8977, or U8978: 80,000 div). recent 160,000 divisions of measured data are written in the hemory. (if using Model U8975, U8977, or U8978: 80,000 div). ay is available with the jog dial and shuttle ring. asurement is available. At to 500 ms/div or slower. ressing the specific <b>F</b> key starts and stops printing.) between 10 ms/div and 200 ms/div, prints waveforms ay from recording (Any of the recording length settings ). between 10 ms/div and 200 ms/div, manually printing easurement stops. s after measurement (At relatively slower sampling rate, e while recording them.)
Screen and printing settings         Waveform storage         Waveform scrolling         Real-time printing         Automatic printing         Manual printing	1, 2, 4, 8, 16 screens Model MR8847-51: The most internal m Model MR8847-52: The most internal m Model MR8847-53: The most internal m Scrolling horizontally the displ Backward scrolling during me Available with the timebase set (Even during measurement, p With the timebase set to one h simultaneously with some dela except continuous is available With the timebase set to one h waveforms is required after m Automatically prints waveform printing waveforms is available By pressing the <b>PRINT</b> key (p coverage)	recent 20,000 divisions of measured data are written in the temory (if using Model U8975, U8977, or U8978: 10,000 div). recent 80,000 divisions of measured data are written in the temory. (if using Model U8975, U8977, or U8978: 40,000 div). recent 160,000 divisions of measured data are written in the temory. (if using Model U8975, U8977, or U8978: 80,000 div). ay is available with the jog dial and shuttle ring. asurement is available. et to 500 ms/div or slower. ressing the specific <b>F</b> key starts and stops printing.) between 10 ms/div and 200 ms/div, prints waveforms ay from recording (Any of the recording length settings ). between 10 ms/div and 200 ms/div, manually printing easurement stops. s after measurement (At relatively slower sampling rate, e while recording them.) rints waveforms at up to 50 mm/s, depending on print
Screen and printing settingsWaveform storageWaveform scrollingReal-time printingAutomatic printingManual printingPartial printing	<ul> <li>1, 2, 4, 8, 16 screens</li> <li>Model MR8847-51: The most internal m Model MR8847-52: The most internal m Model MR8847-52: The most internal m</li> <li>Model MR8847-53: The most internal m</li> <li>Scrolling horizontally the disples backward scrolling during measurement, p</li> <li>With the timebase set to one h simultaneously with some delate except continuous is available with the timebase set to one h waveforms is required after m</li> <li>Automatically prints waveform printing waveforms is available</li> <li>By pressing the <b>PRINT</b> key (proverage)</li> <li>Prints waveforms within the rate</li> </ul>	recent 20,000 divisions of measured data are written in the hemory (if using Model U8975, U8977, or U8978: 10,000 div). recent 80,000 divisions of measured data are written in the hemory. (if using Model U8975, U8977, or U8978: 40,000 div). recent 160,000 divisions of measured data are written in the hemory. (if using Model U8975, U8977, or U8978: 80,000 div). recent 160,000 divisions of measured data are written in the hemory. (if using Model U8975, U8977, or U8978: 80,000 div). recent 160,000 divisions of measured data are written in the hemory. (if using Model U8975, U8977, or U8978: 80,000 div). recent 160,000 divisions of measured data are written in the hemory. (if using Model U8975, U8977, or U8978: 80,000 div). recent 160,000 divisions of measured data are written in the hemory. (if using Model U8975, U8977, or U8978: 80,000 div). recent 10 ms/div or slower. ressing the specific <b>F</b> key starts and stops printing.) between 10 ms/div and 200 ms/div, prints waveforms ay from recording (Any of the recording length settings ). between 10 ms/div and 200 ms/div, manually printing easurement stops. s after measurement (At relatively slower sampling rate, e while recording them.) rints waveforms at up to 50 mm/s, depending on print
Screen and printing settingsWaveform storageWaveform scrollingReal-time printingAutomatic printingPartial printingAutomatic saving	<ul> <li>1, 2, 4, 8, 16 screens</li> <li>Model MR8847-51: The most internal m</li> <li>Model MR8847-52: The most internal m</li> <li>Model MR8847-53: The most internal m</li> <li>Model MR8847-53: The most internal m</li> <li>Scrolling horizontally the disple Backward scrolling during me</li> <li>Available with the timebase set (Even during measurement, p</li> <li>With the timebase set to one h simultaneously with some dela except continuous is available</li> <li>With the timebase set to one h waveforms is required after m</li> <li>Automatically prints waveform printing waveforms is available</li> <li>By pressing the <b>PRINT</b> key (p coverage)</li> <li>Prints waveforms within the rational measurement (in binary or tex At relatively slower sampling relations)</li> </ul>	recent 20,000 divisions of measured data are written in the bemory (if using Model U8975, U8977, or U8978: 10,000 div). recent 80,000 divisions of measured data are written in the bemory. (if using Model U8975, U8977, or U8978: 40,000 div). recent 160,000 divisions of measured data are written in the bemory. (if using Model U8975, U8977, or U8978: 80,000 div). ay is available with the jog dial and shuttle ring. asurement is available. et to 500 ms/div or slower. ressing the specific <b>F</b> key starts and stops printing.) between 10 ms/div and 200 ms/div, prints waveforms ay from recording (Any of the recording length settings ). between 10 ms/div and 200 ms/div, manually printing easurement stops. s after measurement (At relatively slower sampling rate, e while recording them.) rints waveforms at up to 50 mm/s, depending on print mge between Cursors A and B (Whole, A-B) CF card, a USB flash drive, or the built-in drive after t format). ate, saving waveforms is available while recording them.

• • • • • • • • • • • • • •

## 18.3.3 X-Y Recorder Function

Sampling rate	1, 10, 100 ms
Recording length	Repeat
Screen and printing settings	1 screen, 4 screens
Number of X-Y display	Up to 8 phenomena
X-Y setting	Select 8 channels out of 32 for each of X-axis and Y-axis
Interpolation function	Dot, line
Clearing waveforms	On, off
Waveform storage	The most recent 4,000,000 samples of measured data are written in the internal memory (if using Model U8975, U8977, or U8978: 2,000,000 samples).
Raising/lowering pen (plotting/not plotting waveforms)	Yes (for all phenomena simultaneously)
External pen control	Controllable by inputting a signal into the external control terminal (all phenomena simultaneously)
Automatic printing	No
Manual printing	By pressing the <b>PRINT</b> key (prints waveforms at a speed of up to 50 mm/s, depending on print coverage rates)
Automatic saving	No

## 18.3.4 FFT Function

Frequency range	133 mHz to 8 MHz, 133 mHz to 4 MHz (if using U8975, U8977, or U8978), external
Dynamic range	72 dB (theoretical value), 96 dB (theoretical value) with Model 8968 High Resolution Unit used
Number of sampling points	1000 points, 2000 points, 5000 points, 10000 points
Frequency resolution	1/400, 1/800, 1/2000, 1/4000
Anti-aliasing filters	The cutoff frequency is automatically set along with frequency ranges. (Available only with Model 8968 High Resolution Unit or Model U8979 Charge Unit used)
Analysis channel setting	Freely selectable between the channels
FFT analysis mode	Storage waveform, linear spectrum*, RMS spectrum*, power spectrum*, cross power spectrum, auto-correlation function, histogram, transfer function, cross-correlation function, impulse response, coherence function, 1/1 octave analysis, 1/3 octave analysis, LPC analysis, phase spectrum *Setting the cursors to on enables the total harmonic distortion (THD) to appear.
Display formats	Single, dual, Nyquist display, running spectrum display
Window function	Rectangular window, Hanning, exponential, Hamming, Blackman, Blackman-Harris, flat top
Display scale	Linear scale, logarithmic scale
Print function	In accordance with the specifications of the memory function. Note: Partial printing is not available.
Peak hold	Yes
Averaging	Simple average in the time domain and the frequency domain, exponential moving average, peak hold (frequency axis) Number of averaging (2, 4, 8,, 10,000)

. . . . . . . . . . .

. . .

.

## **18.4 Other Functions**

## Numerical calculation function

Function supporting numerical calculation	Memory function
Number of calculations	Up to 16 calculations for freely-selected channels
Calculation range	Selectable between the entire range, the range between Cursors A and B, and the range after the trigger
Calculation types	Average, RMS value, peak-to-peal value, maximum value, time to maximum value, minimum value, time to minimum value, period, frequency, rise time, fall time, standard deviation, area, X-Y area, time to user-defined level, level at user-defined time, pulse width, duty ratio, pulse count, four basic arithmetic operations, time lag, phase difference, high level, low level
Statistical calculation	Selectable between first, average, maximum, and minimum
Printing calculation results	Yes
Automatically saving calculation results	Automatically saves on a CF card, a USB flash drive, or the built-in drive (in text format) after measurement.
Judging calculation results	Calculation results can be judged based on user-defined maximum/minimum value Stop condition: GO, NG, GO&NG
Judgment result output	Generates a GO or NG result and outputs a signal from the external control terminal. Open collector output With 5-volt outputs, active low, low output level: 0 V to 0.5 V (current of 15 mA) Pulse width: 1.8 ms or more

## Waveform calculation function

Function supporting waveform calculation	Memory function
Number of calculations	Up to 16 calculations for freely-selected channels
Calculation range	Selectable between the entire range and the range between Cursors A and B
Calculation recording length	Up to 1/4 of the maximum memory length
Calculation types	Four arithmetic operations, absolute values, indexes, common logarithms, square root, moving average, differential (primary, secondary), integral (primary, secondary), parallel displacement in time axis direction, trigonometric function, reverse trigonometric function, integration time correction based on NPLC setting
Printing calculation results	Yes
Automatically saving calculation results	Automatically saves to a CF card, a USB flash drive, or the built-in drive (in binary or text format) after measurement.

## Memory dividing function

Function supporting memory dividing	Memory function	
Number of divided memories	2 to 1024 (if using the U8975, U8977, or U8978: 2 to 512)	
Recording length consisting of the divided memories	Freely settable (depends on the number of divided memories)	
---	--	--
Sequential saving	Specifying a start and end blocks enables the sequential saving.	
Sequential saving dead time	With the block display set to off: 1 to 8 samples (with the timebase set to $5 \mu$ s/div to 20 $\mu$ s/div)	
	1 sample (with the timebase set to 50 µs/div or more)	
	With the block display set to on: 40 ms or more (with the timebase set to 5 $\mu$ s/div to 20 $\mu$ s/div)	
	1 sample (with the timebase set to 50 µs/div or more)	
Multi-block saving	Freely specifying divided blocks enables the multi-block saving.	
Block display	On, off	
Overlaying waveforms belonging to blocks	Specified blocks or entire blocks	

## **Cursor measurement function**

Functions supporting cursor measurement	Memory function, recorder function, X-Y recorder function, FFT function	
Number of cursors	Two (Cursors A and B)	
Cursor types	Line cursor (vertical or horizontal), trace cursor	
Cursor movements	Cursor A, Cursor B, Cursors A and B	
Measurement functions	Cursor A:Potential at each cursor, time from trigger eventCursors A andDifference in time, difference in potential, frequency (period)B:	
Supported channels	Specify the entire channels (default setting), or any one channel	
Included functions	Specify a range for partial printout or partial saving	

## **Monitor function**

Monitor display	<ul><li>Level monitor: Pressing the DISP key enables the level monitor, displaying levels and numerical values.</li><li>DMM display: Pressing the DISP key displays numerical values.</li></ul>
Numerical value display	Displaying instantaneous values, equipped with the hold function
Level monitor sampling	Fixed at 10 kS/s
Refresh rate	0.5 s or more, depends on the NPLC settings when Model MR8990 Digital Voltmeter Unit is used

## Position display (VIEW) function

Display function	Position: Blocks:	Displays a present position with respect to the entire recording length Blocks of divided memories (with the memory division set to on)
Position display	Presently displayed position (linked to scrolling), positions of Cursors A and B, trigger position, waveform search results position	
Block display	Block usage st Waveform histo Display of freel	atus (with the memory dividing set to on) ory status (with the memory dividing set to off) ly-selected blocks with respect to the entire blocks

Jump function Jump to a trigger position or cursor positions	
	Jump to user-defined blocks (with the memory dividing set to on)
	Jump to previously observed waveforms (with the memory dividing set to off)
	Jump to searched waveform positions

## Waveform judgment function

Function supporting waveform judgment	Memory function (Y-T waveform, X-Y composite curve), FFT function Compares captured waveforms with a user-defined waveform area, and determines whether the captured waveform falls within or outside the user-defined waveform area.	
Judgment modes	Out: All out:	If any part of a waveform falls outside the area, generates an NG (fail) result. If the entire waveform falls outside the area, generates an NG (fail) result.
Measurement stopping conditions based on judgment	GO, NG, GO&NG Stopping measurement based on judgments enables printer output to be generated and waveforms to be saved.	
Judgment result output	Generates a GO or NG result and output a signal from the external control terminal Open collector output With 5-volt outputs, active low, low output level: 0 V to 0.5 V (current of 15 mA) Pulse width: 1.8 ms or more	
Waveform judgment time	Judgment time: 100 ms or less, evaluation period: 250 ms or less* * Number of judgment channels: 1, Timebase: 5 µs/div, recording length: 25 div, magnification: × 1, for 2 periods of input waveform A relatively slower sampling setting enables waveforms to be judged during measurement.	
Graphic editor	Instrument: Ar External: Wav grap	n editor is provided to create waveform judgment reference areas. eform judgment reference areas, which are created in BMP format with hic applications installed in a computer, can be loaded onto the instrument.
Editor commands	Load wave, Zo colors, Cancel	om in/out, Fill color, Draw shape, Eraser, Clear all, Clear select area, Invert , Exit

## Waveform generation function

The detailed hardware functions are in accordance with the generator module specifications of Models MR8790, MR8791, and U8793

Waveform generation mode	Based on generator	modules of Models MR8790, MR8791, and U8793
Waveform output control	Output control RUN (generation), STOP (stop), PAUSE (suspension) Output control method	
	Manual: Measurement and	Controls output by pressing the <b>F</b> keys on the settings screen. d synchronization:
	Keys:	Outputs a waveform in synchronization with the start of measurement Controls output by pressing the <b>START</b> key and the <b>STOP</b> key (measurement disabled)
Output waveform	Model MR8790 Waveform Generator Unit:	
	Model MR8791 Puls	se Generator Unit:
	Model U8793 Arbitra	ary Waveform Generator Unit:
		DC, sine wave, triangular wave, rectangular wave, pulse, ramp-up, ramp-down, user-defined waveform, program
Supporting waveform for output (Model U8793 only)	Refer to "Specificati	ions of user-defined waveform generation function" (p. 418).

## Other functions

Online help function	Pressing the <b>HELP</b> key displays help for the presently selected (flashing) item. (Does not occupy the entire screen) Basic help (When enabled, displays a brief description of the selected [flashing] item on the bottom of the screen.)
Grid types	Waveform screen: Off, dotted line, solid linePrintout:Off, normal, fine, normal (dark), fine (dark)
Comment display	Channel number comments are displayed on the screen and included in printouts.
Time axis label	Time, time in base 60 system, scale, date, number of samples
Start backup function	Off, on
START key acceptance conditions	Pressing the key once, pressing the key twice, holding the key for two seconds
STOP key acceptance conditions	Pressing the key once, pressing the key twice
Auto-variable scale	Off, on
Веер	Off, warnings, warnings and operation
Backlight saver	Off, 1 min. to 30 min.
Display brightness	3 levels
Display color combination	Color 1 to 3, user-defined color combination
Language	English, Japanese, Chinese, Korean
Mouse speed	Set the speed when using it.
External control terminals	Trigger control terminals (EXT.TRIG, TRIG OUT), External sampling input terminal (EXT.SMPL) Remote control input terminals (START/EXT.IN1, STOP/EXT.IN2, PRINT/EXT.IN3), Judgment output terminals (GO/EXT.OUT1, NG/EXT.OUT2)
Remote control	Assign the following tasks to each of the three remote control terminals: START/EXT.IN1, STOP/EXT.IN2, and PRINT/EXT.IN3. [START], [STOP], [START/STOP], [ABORT], [PRINT], [SAVE], [Pen Up/Down], [RUN/STOP], [Pause]
Internal status output	Assign the following status to each of the two judgment terminals: GO/EXT.OUT1, NG/ EXT.OUT2. [Error], [BUSY], [Trigger]
Probe calibration output	Assign the status [Probe Calibration] to the judgment output terminal NG/EXT.OUT2.
Judgment result output	Assign the following status to each of the two judgment terminals: GO/EXT.OUT1, NG/ EXT.OUT2. [Measure], [Waveform Evaluation], [Value Evaluation or Waveform Evaluation], [Value Evaluation and Waveform Evaluation]
Key lock function	Press and hold the <b>ESC</b> key for 3 seconds. (Engage the key lock function, disengage the key lock function)
Print speed	Fast (coarse), normal, slow (fine)
Print density	Light, Midlight, Standard, Middark, Dark
Print key operation	Select whether to generate print output or not (Yes, No) Print output destination (printer, LAN)
Automatic printing setting	Automatic printing (off, on) Print output destination (printer, LAN)

Channel marker	Off, channel number, comment	
List	Off, on (Prints a list including setting information)	
Gauge	<ul> <li>Off, on (includes gauges of measured channels in printouts*, displays gauges on the screen)</li> <li>* If both range and zero position of a channel are set to the same as those of other channels, a single gauge is included in printouts, shared by those channels.</li> </ul>	
Printout scaling	Prints waveforms magnified or compressed on the time axis, regardless of the screen display settings	
Print range	Selectable between the entire range and the range between Cursors A and B	
Includes upper/lower limits in printouts	Off, on	
Zero-position comments	Off, on (shall not be overlaid with others)	
Text comment printing	Loads a text file and includes comments at the beginning of a printout.	
Counter printing	Off, date, counter name and count value	
GUI saving	Off, on (Decide whether to include the GUI when saving a screen image in BMP format.)	
Waveform backup function	No	
Automatic setup function	Automatically loads the setting file STARTUP.SET on a CF card on start-up	
Automatic range select function	Pressing the <b>AUTO</b> key engages the automatic range select function, which automatically selects an optimal timebase and voltage axis based on an input waveform.	
Backlight brightness	Selectable from three levels	
Time setting	Year, month, day, hour, minute	
Initialization	Clears waveform data System reset (Settings/System settings 1 [Environment]/System settings 2 [Interface])	
Self-check function	ROM/RAM, printer, display, keys, system configuration	

# 18.5 File

## Data saving

Storage device	CF card, built-in drive*, USB flash drive, internal RAM, LAN (Model 9333 LAN Communicator)	
Data that can be saved	Setting data, measured data, analysis data, screen image, print image, waveform judgment condition, waveform evaluation area	
Data saving format	<ul> <li>Setting data (.SET) (The internal RAM is dedicated to setting data.)</li> <li>Measured data Binary format (.MEM, .REC, .XYC, .FFT), text format (.TXT)</li> <li>Index Memory division (.SEQ), division save (.IDX)</li> <li>Screen image (.BMP)</li> <li>Print image (.BMP)</li> <li>Startup (STRATUP.SET)</li> <li>Waveform judgment conditions (.ARE) (Judgment areas and setting conditions are saved.)</li> <li>Waveform judgment area (.BMP) (Judgment areas are saved.)</li> <li>User-defined waveform data (.WFG) (when Model U8793 is installed)</li> <li>Generation program data (.FGP) (when Model MR8791 is installed)</li> </ul>	
File name entry	Alphanumeric, Japanese characters	
Waveform saving range	Selectable between the entire range and the range between Cursors A and B	
Data decimation saving	Available in text format Off, 1/2, 1/5, 1/10, 1/20, 1/50, 1/100, 1/200, 1/500, 1/1000	
Division saving	Available in binary format 16 MB, 32 MB, 64 MB	
Handling of a duplicate file	<ul> <li>Auto: If a file is tried to be saved in a folder containing a file that has the same name, saves it as another file by adding a 4-digit number at the beginning of the file name.</li> <li>Serial: Saves files, adding a 4-digit number at the beginning of the file name without condition.</li> <li>Overwrite: If a file is tried to be saved in a folder containing a file that has the same name, overwrites the existing file.</li> <li>Error: If a file is tried to be saved in a folder containing a file that has the same name, an error message will be displayed.</li> </ul>	
Selection of blocks to be saved	Saves data in selected blocks if the memory is divided.	
Selection of channels to be saved	Saves data acquired through selected channels (measured data, calculation data), all channels	

## Data loading

Supported storage devices	CF card, built-in drive*, USB flash drive, internal RAM
Loadable data types	Setting data, measured data, analysis data, text comments, waveform judgment conditions, waveform judgment area
Loadable data formats	<ul> <li>Setting data (.SET) (The internal RAM is dedicated to setting data.)</li> <li>Measured data Binary (.MEM, .REC, .XYC, .FFT)</li> <li>Index Memory division (.SEQ), division save (.IDX)</li> <li>Text comment (.TXT)</li> <li>Startup (STRATUP.SET)</li> <li>Waveform judgment conditions (.ARE)</li> <li>Waveform judgment area (.BMP)</li> <li>User-defined waveform data (when Model U8793 is installed) In binary format (.WFG), in text format (.TFG)</li> <li>Generation program data (.FGP) (when Model U8793 is installed)</li> <li>Pulse pattern data (.PLS) (when Model MR8791 is installed)</li> </ul>
Data Loading method	Newly loads data

## **Other functions**

File information display	Yes
Data deletion	Selected file, multiple selected files
File sorting	By name, date, size, extension Ascending order, descending order
File renaming	Yes
Directory	Can be created, renamed, and deleted.
File copy	Copy files to other storage devices
Print list	Prints file lists
One-touch saving	User-defined data items in a predetermined format can be saved by pressing the <b>SAVE</b> key or clicking the mouse button.

\* When Model U8331 SSD Unit is installed.

. . . . .

# **18.6 Specifications of Modules**

## 18.6.1 Model 8966 Analog Unit

The accuracy has been specified under the following conditions: installed in a Memory HiCorder and operated at  $23^{\circ}C \pm 5^{\circ}C (73^{\circ}F \pm 9^{\circ}F)$  in the range of 20% to 80% RH after a half-hour (at least) warm-up and execution of zero-adjustment.

Product warranty period	3 years
Guaranteed accuracy period	1 year
Number of input channels	2 channels
Measurement range	5, 10, 20, 50, 100, 200, 500 mV, 1, 2, 5, 10, 20 V/div
Measurement accuracy	$\pm 0.5\%$ f.s. (with the low-pass filter set to 5 Hz)
Temperature characteristic	±0.06% f.s./°C
Frequency characteristic	DC coupling: DC to 5 MHz, −3 dB AC coupling: 7 Hz to 5 MHz, −3 dB (lower cut-off frequency: 7 Hz ±50%)
Noise	1.5 mV p-p (typ.), 2 mV p-p (max.) (highest sensitivity range, with input terminals short- circuited)
Common mode rejection ratio	80 dB or more (at 50 Hz / 60 Hz, a signal source resistance of 100 $\Omega$ or less)
Low-pass filter	OFF, 5 ±50%, 50 ±50%, 500 ±50%, 5 k ±50%, 50 k ±50%, 500 k ±50% (Hz) −3 dB
Input type	Unbalanced input (floating)
Input coupling	AC/DC/GND
Input resistance	1 MΩ ±1%
Input capacitance	30 pF ±10 pF (at 100 kHz)
A/D resolution	12 bits
Maximum sampling rate	20 MS/s
Input terminals	Insulated BNC terminal
Maximum input voltage	400 V DC
Maximum rated voltage to earth	300 V AC, DC (between each input channel and enclosure, between any two of input channels) Measurement category II (anticipated transient overvoltage: 2500 V)
Operating temperature and humidity	In accordance with the specification of the Memory HiCorder in which Model 8966 is installed
Operating environment	In accordance with the specification of the Memory HiCorder in which Model 8966 is installed
Storage temperature and humidity	-10°C to 50°C (14°F to 122°F), 80% RH or less (no condensation)
Dimensions	Approx. 106W × 19.8H × 196.5D mm (4.17"W × 0.78"H × 7.74"D)
Mass	Approx. 250 g (8.8 oz.)

Effect of radiated radio-frequency electromagnetic field	±15% f.s. (at a maximum) at 3 V/m
Effect of conducted radio-frequency electromagnetic field	$\pm45\%$ f.s. (at a maximum) at 3 V (100 mV/div range, with 1-volt DC input)
Standards	Safety EN61010 EMC EN61326 Class A
Options	Model L9197 Connection Cord (CAT IV 300 V, CAT III 600 V, 1 A) Model L9198 Connection Cord (CAT III 300 V, CAT II 600 V, 0.2 A) Model L9217 Connection Cord (CAT III 300 V, CAT II 600 V, 0.2 A) Model L9790 Connection Cord (with Model L9790-01 or 9790-03: CAT III 300 V, CAT II 600 V, 1 A) (with Model 9790-02: CAT III 150 V, CAT II 300 V, 1 A) Model 9322 Differential Probe (with grabber clips attached: CAT II 1000 V) (with alligator clips attached: CAT III 600 V, CAT II 1000 V) Model P9000-01 Differential Probe (CAT III 1000 V) Model P9000-02 Differential Probe (CAT III 1000 V) Model 9665 10:1 Probe (CAT II 300 V) Model 9666 100:1 Probe (CAT II 300 V)

...

# 18.6.2 Model 8967 Temp Unit

The accuracy has been specified under the following conditions: installed in a Memory HiCorder and operated at 23°C  $\pm$ 5°C (73°F  $\pm$ 9°F) in the range of 20% to 80% RH after a half-hour (at least) warm-up and execution of zero-adjustment.

Product warranty period	3 years					
Guaranteed accuracy period	1 year					
Number of input channels	2 channels	2 channels				
Input terminals	Push-button type	terminal blo	ck (2 termin	als/channel)		
Measurement device	Thermocouple (K,	J, E, T, N, F	R, S, B, W)			
Measurement range	Measurement device	Measurement range Measurable range		Resolution	Measurement accuracy	
Measurable range			10°C/div	-100°C to 200°C	0.01°C	
Resolution		K *1	50°C/div	-200°C to 1000°C	0.05°C	
accuracy			100°C/div	-200°C to 1350°C	0.1°C	
(f.s.=20 div)			10°C/div	-100°C to 200°C	0.01°C	
		J *1	50°C/div	-200°C to 1000°C	0.05°C	
			100°C/div	-200°C to 1100°C	0.1°C	±0.1% f.s.±1°C
			10°C/div	-100°C to 200°C	0.01°C	(0°C or higher)
		E *1	50°C/div	-200°C to 800°C	0.05°C	±0.1% f.s.±2°C
			100°C/div	-200°C to 800°C	0.1°C	(-200°C or higher
			10°C/div	-100°C to 200°C	0.01°C	
	Thormosounio	T *1	50°C/div	-200°C to 400°C	0.05°C	
	Inermocouple (not including reference junction compensation accuracy)		100°C/div	-200°C to 400°C	0.1°C	
		N *1	10°C/div	-100°C to 200°C	0.01°C	
			50°C/div	-200°C to 1000°C	0.05°C	
		R *1	100°C/div	-200°C to 1300°C	0.1°C	+0.1% f s +3.5°C
			10°C/div	0°C to 200°C	0.01°C	
			50°C/div	0°C to 1000°C	0.05°C	
				0 C to 1700 C	0.1 C	(0°C or higher but
		S *1		0 C to 200 C	0.01 C	(For Type B,
				0°C to 1700°C	0.05 C	accuracy is not
			50°C/div	0 C to 1700 C	0.1 C	temperature below
		B *1	100°C/div	400°C to 1800°C	0.03 C	400°C)
			10°C/div	0°C to 200°C	0.1°C	±0.1% f.s.±3°C
		W *2	50°C/div	0°C to 1000°C	0.01°C	(400°C or higher)
		(WRe5-26)	100°C/div	0°C to 2000°C	0.1°C	
	*1: JIS C 1602-199	5 *2' ASTM	E-988-96			
D.C.	1. 515 C 1002-199	5, 2. ASTIN	L-900-90		(	11 - C
Reference junction compensation accuracy	±1.5°C (When the reference junction compensation is set to internal, add the figure to thermocouple measurement accuracy)					
Reference junction compensation	Selectable between internal or external (during temperature measurement with thermocouples)					
Temperature characteristics	Add [(measureme	ent accuracy	/) × 0.1]/°C t	o the measurement a	accuracy	

Data refreshing	Selectable between normal, fast, and slow		Fast	Normal	Slow	
		Data refresh rate	Approx. 1.2 ms	Approx. 100 ms	Approx. 500 ms	
Wire break detection	Selectable between on or off					
Input resistance	5 MΩ or	more (both with the wire break	detection is set to	on and off)		
Common mode rejection ratio	80 dB or more (at 50 Hz / 60 Hz, a signal source resistance of 100 $\Omega$ or less, with the data refresh set to Fast) 100 dB or more (at 50 Hz / 60 Hz, a signal source resistance or 100 $\Omega$ or less, with the data refresh set to Normal)					
Input type	Unbalar	nced input (floating)				
Maximum rated voltage to earth	300 V AC, DC (between each input channel and enclosure, between any two of input channels) Measurement category II (anticipated transient over-voltage: 2500 V)					
Operating temperature and humidity	In accordance with the specifications of Memory HiCorder in which Model 8967 is installed					
Storage temperature and humidity	−20°C to 50°C (−4°F to 122°F), 90% RH or less (no condensation)					
Operating environment	In accordance with the specifications of Memory HiCorder in which Model 8967 is installed					
Dimensions	Approx.	Approx. 106W × 19.8H × 204.5D mm (4.17"W × 0.78"H × 8.05"D)				
Mass	Approx. 240 g (8.5 oz.)					
Effect of radiated radio-frequency electromagnetic field	±2% f.s.	(at a maximum) at 3 V/m				
Effect of conducted radio-frequency electromagnetic field	±2% f.s. (at a maximum) at 3 V					
Standards	Safety EMC	EN61010 EN61326 Class A				
Accessories	Ferrite clamp-on choke (2 pieces)					
Options	Model 9810 Thermocouples (K)					

••

## 18.6.3 Model 8968 High Resolution Unit

The accuracy has been specified under the following conditions: installed in a Memory HiCorder and operated at 23°C  $\pm$ 5°C (73°F  $\pm$ 9°F) in the range of 20% to 80% RH after a half-hour (at least) warm-up and execution of zero-adjustment.

Product warranty period	3 years
Guaranteed accuracy period	1 year
Number of input channels	2 channels
Measurement range	5, 10, 20, 50, 100, 200, 500 mV, 1, 2, 5, 10, 20 V/div
Measurement accuracy	$\pm 0.3\%$ f.s. (with the low-pass filter setting set to 5 Hz, operated after the zero-adjustment)
Temperature characteristics	±0.045% f.s./°C
Frequency characteristic	DC coupling: DC to 100 kHz, −3 dB AC coupling: 7 Hz to 100 kHz, −3 dB (lower cut-off frequency: 7 Hz±50%)
Noise	500 μV p-p (typ.), 1 mV p-p (max.) (highest sensitivity range, with input short-circuited)
Common mode rejection ratio	80 dB or more (at 50 Hz / 60 Hz, a signal source resistance of 100 $\Omega$ or less)
Low-pass filter	Off, 5±50%, 50±50%, 500±50%, 5 k±50%, 50 k±50% (Hz) −3 dB
Anti-aliasing filters	Cutoff frequency (fc) 20, 40, 80, 200, 400, 800, 2 k, 4 k, 8 k, 20 k, 40 k (Hz) (Automatically set if the anti-aliasing filter is set to on) Attenuation property: −66 dB or higher at 1.5 fc
Input type	Unbalanced input (floating)
Input coupling	AC/DC/GND
Input resistance	1 MΩ±1%
Input capacitance	30 pF ±10 pF (at 100 kHz)
A/D resolution	16 bits
Maximum sampling rate	1 MS/s
Input terminals	Insulated BNC terminal
Maximum input voltage	400 V DC
Maximum rated voltage to earth	300 V AC, DC (between each input channel and enclosure, between any two of input channels) Measurement category II (anticipated transient overvoltage: 2500 V)
Operating temperature and humidity	In accordance with the specifications of Memory HiCorder in which Model 8968 is installed
Operating environment	In accordance with the specifications of Memory HiCorder in which Model 8968 is installed
Storage temperature and humidity	−10°C to 50°C (14°F to 122°F), 80% RH or less (no condensation)
Dimensions	Approx. 106W × 19.8H × 196.5D mm (4.17"W × 0.78"H × 7.74"D)
Mass	Approx. 250 g (8.8 oz.)

Effect of radiated radio-frequency electromagnetic field	±15% f.s. (at a maximum) at 3 V/m
Effect of conducted radio-frequency electromagnetic field	±20% f.s. (at a maximum) at 3 V (100 mV/div range, with 1 V DC input)
Standards	Safety EN61010 EMC EN61326 Class A
Options	Model L9197 Connection Cord (CAT IV 300 V, CAT III 600 V, 1 A) Model L9198 Connection Cord (CAT III 300 V, CAT II 600 V, 0.2 A) Model L9217 Connection Cord (CAT III 300 V, CAT II 600 V, 0.2 A) Model L9790 Connection Cord (with Model L9790-01 or 9790-03: CAT III 300 V, CAT II 600 V, 1 A) (with Model 9790-02: CAT III 150 V, CAT II 300 V, 1 A) Model 9322 Differential Probe (with grabber clips attached: CAT II 1000 V) (with alligator clips attached: CAT III 600 V, CAT II 1000 V) Model P9000-01 Differential Probe (CAT III 1000 V) Model P9000-02 Differential Probe (CAT III 1000 V) Model 9665 10:1 Probe (CAT II 300 V) Model 9666 100:1 Probe (CAT II 300 V)

...

....

# 18.6.4 Model 8969 Strain Unit, U8969 Strain Unit

	Model 8969	Model U8969		
Product warranty period	1 year	3 years		
Conditions of guaranteed accuracy	<ul> <li>Guaranteed accuracy period: 1 year</li> <li>Temperature and humidity for guaranteed accuracy: 23°C ±5°C (73°F ±9°F), 20% RH to 80% RH</li> <li>Warm-up time: At least 30 minutes</li> <li>Specified after performing the autobalance</li> </ul>	<ul> <li>Guaranteed accuracy period: 1 year</li> <li>Guaranteed accuracy period from adjustment made by Hioki: 1 year</li> <li>Temperature and humidity for guaranteed accuracy: 23°C ±5°C (73°F ±9°F), 80% RH or less</li> <li>Warm-up time: At least 30 minutes</li> <li>Specified after performing the auto- balance</li> </ul>		
Number of input channels	2 cha	annels		
Input terminals	Weidmüller SL3.5/7/90G	NDIS connector EPRC07-R9FNDIS		
Measurement device	Strain gaug	le transducer		
Gauge ratio	2	2.0		
Bridge voltage	2 V ±	0.05 V		
Bridge resistance	120 Ω	to 1 kΩ		
Balance adjustment range	±10000 $\mu\epsilon$ or less			
Balancing method	Electronic a	uto-balancing		
Measurement range	20, 50, 100, 200, 500, 1000 με/div			
Measurement accuracy	$\pm 0.5\%$ f.s. $\pm 4~\mu\epsilon$ (with the low-pass filter set to 5 Hz)			
Temperature characteristics	Gain: ±0.05% f.s./°C Zero position: ±2.5 με/°C			
Frequency characteristic	DC to 20 kHz +1/-3 dB			
Low-pass filter	Off, 5±30%, 10±30%, 100±30%, 1 k±30% (Hz) −3 dB			
A/D resolution	16 bits (±f.s. equals ±25000 pieces of data)			
Maximum sampling rate	200 kS/s			
Maximum rated voltage to earth	33 V rms AC or 70 V DC (between each input channel and enclosure, between any two of input channels) Anticipated transient overvoltage: 330 V (Based on EN61010-2-030:2010)	30 V rms AC or 60 V DC (between each input channel and enclosure, between any two of input channels) Anticipated transient overvoltage: 330 V		
Operating temperature and humidity	In accordance with the specifications of Memory HiCorder in which Model 8969 is installed	Temperature: -10°C to 40°C (14°F to 104°F) Humidity: 90% RH or less (no condensation)		
Storage temperature and humidity	In accordance with the specifications of Memory HiCorder in which Model 8969 is installed	Temperature: −20°C to 50°C (−4°F to 122°F) Humidity: 80% RH or less (no condensation)		
Operating environment	In accordance with the specifications of Memory HiCorder in which Model 8969 is installed	Indoors, Pollution Degree 2, altitude up to 2000 m (6562 ft.)		
Dimensions	Approx. 106W × 19.8H × 196.5D mm (4.17"W × 0.78"H × 7.74"D)			
Mass	Approx. 220 g (7.8 oz.)	Approx. 245 g (8.6 oz.)		

Accessories	Model 9769 Conversion Cable × 2 (Compatible connector: NDIS connector PRC03-12A10-7M10.5)	Model L9769 Conversion Cable × 2 (Compatible connector: NDIS connector PRC03-12A10-7M10.5)		
Effect of radiated radio-frequency electromagnetic field	±10% f.s. (at a maximum) at 3 V/m (with the low-pass filter set to 5 Hz)			
Effect of conducted radio-frequency electromagnetic field	$\pm 10\%$ f.s. (at a maximum) at 3 V (with the low-pass filter set to 5 Hz)			
Standards	Safety: EMC:	EN61010 EN61326 Class A		

....

# 18.6.5 Model 8970 Freq Unit

The accuracy has been specified under the following conditions: installed in a Memory HiCorder and operated at 23°C ±5°C (73°F ±9°F) in the range of 20% to 80% RH after a half-hour (at least) warm-up.

Product warranty period	3 years
Measurement functions	The following types of measurement based on voltage input: frequency, rotation speed, power frequency, count, pulse duty ratio, and pulse width
Input terminals	Insulated BNC terminal
Input resistance	1 MΩ±1%
Input capacitance	30 pF±10 pF
Maximum input voltage	400 V DC
Maximum rated voltage to earth	300 V AC, DC (Measurement category II) Anticipated transient overvoltage: 2500 V (between each input channel and enclosure, between any two of input channels)
Input type	Unbalanced input (floating)
Guaranteed accuracy period	1 year
Frequency mode Measurement	1, 5, 10, 50, 100, 500, 1 k, 5 kHz/div (f.s.= 20 div)
Measurement accuracy Measurable range	±0.1% f.s. (except for 5 kHz/div range) ±0.7% f.s. (5 kHz/div range) DC to 100 kHz (minimum pulse width: 2 μs
Rotation speed mode Measurement range Measurement accuracy Measurable range	100, 500, 1 k, 5 k, 10 k, 50 k, 100 kr/min /div (f.s.= 20 div) ±0.1% f.s. (except for 100 kr/min range) ±0.7% f.s. (100 kr/min range) 0 Mr/min to 2 Mr/min (minimum pulse width 2: μs)
Power frequency mode Measurement range Measurement accuracy	50 Hz (40 Hz to 60 Hz), 60 Hz (50 Hz to 70 Hz), 400 Hz (390 Hz to 410 Hz) (f.s. = 20 div) ±0.03 Hz (50 Hz, 60 Hz), ±0.1 Hz (400 Hz)
Count mode Measurement range Measurement accuracy Measurable range	2 k, 10 k, 20 k, 100 k, 200 k, 1 M counts/div ±(range/2000) DC to 100 kHz (minimum pulse width: 2 μs)
Duty ratio mode Measurement range Measurement accuracy Measurable range	5%/div (f.s.= 20 div) ±1% (10 Hz to 10 kHz) ±4% (10 kHz to 100 kHz) 10 Hz to 100 kHz (minimum pulse width: 2 μs)
Pulse width mode Measurement range Measurement accuracy Measurable range	500 μ, 1 m, 5 m, 10 m, 50 m, 100 ms/div (f.s.= 20 div) ±0.1% f.s. 2 μs to 2 s

Measurement resolution	Count mode: 2000LSB/div (f.s. = 20 div) Except for count mode and power frequency mode: 500LSB/div (f.s. = 20 div) Power frequency mode: 100LSB/div (f.s. = 20 div)
Response time	Within 40 $\mu$ s + (sampling interval of instrument in which the module is installed)
Input voltage range	±10 V, ±20 V, ±50 V, ±100 V, ±200 V, ±400 V
Threshold value	±10 V range:Variable in the range between -10 V and +10 V (in 0.1 V increments)±20 V range:Variable in the range between -20 V and +20 V (in 0.2 V increments)±50 V range:Variable in the range between -50 V and +50 V (in 0.5 V increments)±100 V range:Variable in the range between -100 V and +100 V (in 1 V increments)±200 V range:Variable in the range between -200 V and +200 V (in 2 V increments)±400 V range:Variable in the range between -400 V and +400 V (in 5 V increments)
Slope	Rising, falling (frequency mode, rotation speed mode, power frequency mode, count mode)
Level	High, low (duty ratio mode, pulse width mode)
Hold	Frequency mode, rotation speed mode: On, off (1 Hz, 0.5 Hz, 0.2 Hz, 0.1 Hz) Behavior with the hold function not engaged: If a subsequent measured value is not determined within the waiting time period, the frequency or the rotation speed will be determined and recorded using the value that is calculated based on the time period between the timing of the previous measurement and the timing of the sampling. If these calculated values are less than a user-defined value, then the value will be assumed to be zero.
Smoothing	Off, on (The permissible smoothing frequency is up to 10 kHz.) (Frequency mode, rotation speed mode)
Low-pass filter	Off, 5, 50, 500, 5 k, 50 kHz
Input coupling	DC, AC (Lower frequency cut-off in AC-coupled mode: 7 Hz)
Frequency dividing function	Setting range: 1 to 4096, in one increments (frequency mode, rotation speed mode, count mode)
Counting start timing	Start, trigger (count mode)
Count over handling	Hold, back (count mode)
Operating temperature and humidity	In accordance with the specifications of Memory HiCorder in which Model 8970 is installed
Operating environment	In accordance with the specifications of Memory HiCorder in which Model 8970 is installed
Storage temperature and humidity	In accordance with the specifications of Memory HiCorder in which Model 8970 is installed
Standards	Safety EN61010 EMC EN61326 Class A
Dimensions	Approx. 106W × 19.8H × 196.5D mm (4.17"W × 0.78"H × 7.74"D)
Mass	Approx. 250 g (8.8 oz.)
Options	Model L9197 Connection Cord (CAT IV 300 V, CAT III 600 V, 1 A) Model L9198 Connection Cord (CAT III 300 V, CAT II 600 V, 0.2 A) Model L9217 Connection Cord (CAT III 300 V, CAT II 600 V, 0.2 A) Model L9790 Connection Cord (with Model L9790-01 or 9790-03: CAT III 300 V, CAT II 600 V, 1 A) (with Model 9790-02: CAT III 150 V, CAT II 300 V, 1 A) Model 9322 Differential Probe (with grabber clips attached: CAT II 1000 V) (with alligator clips attached: CAT III 600 V, CAT II 1000 V) Model P9000-01 Differential Probe (CAT III 1000 V) Model P9000-02 Differential Probe (CAT III 1000 V) Model 9665 10:1 Probe (CAT II 300 V) Model 9666 100:1 Probe (CAT II 300 V)

• • ••

# 18.6.6 Model 8971 Current Unit

The accuracy has been specified under the following conditions: installed in a Memory HiCorder and operated at 23°C ±5°C (73°F ±9°F) in the range of 20% to 80% RH after a half-hour (at least) warm-up and execution of zero-adjustment.

Product warranty period	3 years
Guaranteed accuracy period	1 year
Number of input channels	2 channels
Supported current sensors	<ul> <li>Models 9272-10, 9277, 9278, 9279, 9709, CT6841, CT6843, CT6844, CT6845, CT6846*<sup>2</sup>, CT6862, CT6863, CT6865*<sup>2</sup></li> <li>(Model 9318 Conversion Cable is required to connect a sensor with Model 8971.)</li> <li>Models 9272-05, 9709-05, CT6841-05, CT6843-05, CT6844-05, CT6845-05, CT6846-05*<sup>2</sup>, CT6862-05, CT6863-05, CT6865-05*<sup>2</sup>, CT6875, CT6876*<sup>2</sup></li> <li>(Model 9318 Conversion Cable + Model CT9901 Conversion Cable are required to connect a sensor with Model 8971.)</li> <li>Hioki current sensors with RM515EPA-10PC (Hirose) installed</li> <li>(Supported conversion ratios: 2 V/20 A, 2 V/50 A, 2 V/200 A, 2 V/500 A, 2 V/1000 A*<sup>2</sup>)</li> </ul>
Measurement range	<ul> <li>When Model 9272-10 (20 A), 9272-05 (20A), 9277, CT6841 or CT6841-05 is used: 100 m, 200 m, 500 m, 1, 2, 5 A/div</li> <li>When Model CT6862 or CT6862-05 is used 200 m, 500 m, 1, 2, 5, 10 A/div</li> <li>When Model 9272-10 (200 A), 9272-05 (200A), 9278, CT6843, CT6843-05, CT6863 or CT6863-05 is used 1, 2, 5, 10, 20, 50 A/div</li> <li>When Model 9279, 9709, 9709-05, CT6844, CT6844-05, CT6845, CT6845-05, CT6846*<sup>2</sup>, CT6846-05*<sup>2</sup>, CT6865*<sup>2</sup>, CT6865-05*<sup>2</sup>, CT6875, or CT6876*<sup>2</sup> is used: 2, 5, 10, 20, 50, 100 A/div</li> </ul>
Measurement accuracy <sup>*1</sup>	±0.65% f.s. (with the low-pass filter set to 5 Hz) ±0.85% f.s. (with the low-pass filter set to 5 Hz, when Model 9278 or 9279 is used)
RMS accuracy* <sup>1</sup>	±1% f.s. (DC, 30 Hz to 1 kHz), ±3% f.s. (1 kHz to 10 kHz) (Sine wave input, with the low-pass filter set to 5 Hz, crest factor: 2)
Response time*1	100 ms (rising from 0% of f.s. to 90% of f.s.)
Temperature characteristic* <sup>1</sup>	±0.075% f.s./°C
Frequency characteristic* <sup>1</sup>	DC coupling: DC to 100 kHz ±3 dB AC coupling: 7 Hz to 100 kHz ±3 dB (lower cut-off frequency: 7 Hz ±50%)
Noise* <sup>1</sup>	10 mA p-p max. (Highest sensitivity range, with input terminals short-circuited) (for 20 A/2V range)
Low-pass filter	OFF, 5, 50, 500, 5 k, 50 k±50% (Hz) −3 dB
Input type	Unbalanced input (Not isolated)
Input coupling	AC/DC/GND
Input resistance	1 MΩ±1%
A/D resolution	12 bits
Maximum sampling rate	1 MS/s
Input terminals	Sensor connector HR10A-10R-S (Hirose)
Operating temperature and humidity	In accordance with the specifications of Memory HiCorder in which Model 8971 is installed

Operating environment	In accordance with the specifications of Memory HiCorder in which Model 8971 is installed
Storage temperature and humidity	−10°C to 50°C (14°F to 122°F), 80% RH or less (no condensation)
Dimensions	Approx. 106W × 19.8H × 196.5D mm (4.17"W × 0.78"H × 7.74"D)
Mass	Approx. 250 g (8.8 oz.)
Standards	Safety EN61010 EMC EN61326 Class A
Accessories	(for connecting the clamp sensor) Model 9318 Conversion Cable ×2
Options	Model 9318 Conversion Cable, Model CT9901 Conversion Cable
Number of installable modules	Up to 4 modules

\*1 For current measurement, add the accuracy and characteristic of the clamp sensor used with Model 8971.

\*2 The instrument recognizes this as a 500 A AC/DC sensor is connected; setting the ratio of the scaling function to 2 is required.

• • •

# 18.6.7 Model 8972 DC/RMS Unit

The accuracy has been specified under the following conditions: installed in a Memory HiCorder and operated at  $23^{\circ}C \pm 5^{\circ}C (73^{\circ}F \pm 9^{\circ}F)$  in the range of 20% to 80% RH after a half-hour (at least) warm-up and execution of zero-adjustment.

Product warranty period	3 years
Guaranteed accuracy period	1 year
Number of input channels	2 channels
Measurement range	5, 10, 20, 50, 100, 200, 500 mV, 1, 2, 5, 10, 20 V/div
Measurement accuracy	$\pm 0.5\%$ f.s. (with the low-pass filter set to 5 Hz)
RMS accuracy	±1% f.s. (DC, 30 Hz to 1 kHz), ±3% f.s. (1 kHz to 100 kHz) (Sine wave input, response time setting: Slow)
Response time	Slow: 5 s (rising from 0% of f.s. to 90% of f.s.) Normal: 800 ms (rising from 0% of f.s. to 90% of f.s.) Fast: 100 ms (rising from 0% of f.s. to 90% of f.s.)
Crest factor	2
Temperature characteristics	±0.045% f.s./°C
Frequency characteristics	DC coupling: DC to 400 kHz, −3 dB AC coupling: 7 Hz to 400 kHz, −3 dB (lower cut-off frequency: 7 Hz ±50%)
Noise	500 μV p-p (typ.), 750 μV p-p (max.) (Highest sensitivity range, with input shorted)
Common mode rejection ratio	80 dB or more (at 50 Hz / 60 Hz, a signal source resistance of 100 $\Omega$ or less)
Low-pass filter	Off, 5±50%, 50±50%, 500±50%, 5 k±50%, 100 k±50% (Hz) −3 dB
Input type	Unbalanced input (floating)
Input coupling	AC/DC/GND
Input resistance	1 MΩ±1%
Input capacitance	30 pF ±10 pF (at 100 kHz)
A/D resolution	12 bits
Maximum sampling rate	1 MS/s
Input terminals	Insulated BNC terminal
Maximum input voltage	400 V DC
Maximum rated voltage to earth	300 V AC, DC (between each input channel and enclosure, between any two of input channels) Measurement category II (anticipated transient overvoltage: 2500 V)
Operating temperature and humidity	In accordance with the specifications of Memory HiCorder in which Model 8972 is installed
Operating environment	In accordance with the specifications of Memory HiCorder in which Model 8972 is installed
Storage temperature and humidity	-10°C to 50°C (14°F to 122°F), 80% RH or less (no condensation)
Dimensions	Approx. 106W × 19.8H × 196.5D mm (4.17"W × 0.78"H × 7.74"D)

Mass	Approx. 250 g (8.8 oz.)
Effect of radiated radio-frequency electromagnetic field	±15% f.s. (at a maximum) at 3 V/m
Effect of conducted radio-frequency electromagnetic field	$\pm 20\%$ f.s. (at a maximum) at 3 V (100 mV/div range, with 1 V DC input)
Standards	Safety EN61010 EMC EN61326 Class A
Options	Model L9197 Connection Cord (CAT IV 300 V, CAT III 600 V, 1 A) Model L9198 Connection Cord (CAT III 300 V, CAT II 600 V, 0.2 A) Model L9217 Connection Cord (CAT III 300 V, CAT II 600 V, 0.2 A) Model L9790 Connection Cord (with Model L9790-01 or 9790-03: CAT III 300 V, CAT II 600 V, 1 A) (with Model 9790-02: CAT III 150 V, CAT II 300 V, 1 A) Model 9322 Differential Probe (with grabber clips attached: CAT II 1000 V) (with alligator clips attached: CAT III 600 V, CAT II 1000 V) Model P9000-01 Differential Probe (CAT III 1000 V) Model P9000-02 Differential Probe (CAT III 1000 V) Model 9665 10:1 Probe (CAT II 300 V) Model 9666 100:1 Probe (CAT II 300 V)

. . . . . . . . . . . .

# 18.6.8 Model 8973 Logic Unit

Product warranty period	3 years
Number of input channels	4 probes (16 channels)
Input terminals	Mini DIN
Supported probes	Model 9320-01 Logic Probe, Model MR9321-01 Logic Probe, Model 9327 Logic Probe
Operating temperature and humidity	In accordance with the specifications of Memory HiCorder in which Model 8973 is installed
Operating environment	In accordance with the specifications of Memory HiCorder in which Model 8973 is installed
Storage temperature and humidity	−20°C to 50°C (−4°F to 122°F), 80% RH or less (no condensation)
Dimensions	Approx. 106W × 19.8H × 196.5D mm (4.17"W × 0.78"H × 7.74"D)
Mass	Approx. 190 g (6.7 oz.)
Standards	Safety EN61010 EMC EN61326 Class A

• • • • • • • • • • •

. . . .

## 18.6.9 Model MR8990 Digital Voltmeter Unit

The accuracy has been specified under the following conditions: installed in a Memory HiCorder and operated at 23°C  $\pm$ 5°C (73°F  $\pm$ 9°F) in the range of 20% to 80% RH after a half-hour (at least) warm-up and execution of calibration.

Product warranty period	3 years						
Guaranteed accuracy period	1 year						
Number of input channels	2 channels	2 channels					
Measurement item	DC voltage						
Measurement range	Measurement range		Effective input	range*	Maximum resolution	Input resistance	
	5 mV/div (f.s.= 100 mV)		-120 mV to 1	20 mV	0.1 µV		
	50 mV/div (f.s.= 1000 mV)		-1200 mV to 1	200 mV	1 µV	100 MΩ or more	
	500 mV/div (f.s.= 10	) V)	-12 V to 1	2 V	10 µV		
	5 V/div (f.s.= 100 V)		-120 V to 1	20 V	100 µV	40 MO + 5%	
	50 V/div (f.s.= 1000	V)	-500 V to 5	V 00	1 mV	10 ML2 ±5%	
	* Guaranteed ran	ige of me	easurement acci	uracy			
Measurement	Measurement r	ange	NPLC	< 1	Ν	IPLC ≥1	
accuracy	5 mV/div (f.s.= 100	mV)	±0.01% rdg.±0	0.015% f.s	. ±0.01%	o rdg.±0.01% f.s.	
	50 mV/div (f.s.= 100	00 mV)		+0 01% r	'da +0 0025% f	e	
	500 mV/div (f.s.= 10	) V)		10.01701	ug.10.0023701.	3.	
	5 V/div (f.s.= 100 V)			+0 025%	rda +0 0025% f	s	
	50 V/div (f.s.= 1000	V)		20.02070	149.20.0020701		
Temperature characteristics	±(0.002% rdg. + 0	.00025%	f.s.)/°C				
A/D conversion measurement method	Delta-sigma modulation method						
Integration time	Power frequency Integration time						
	50 Hz	20 ו	ms × NPLC				
	60 Hz	16.67 ms × NPLC					
	NPLC Settable from 0.1 to 0.9 (in 0.1 increments), 1 to 9 (in 1 increments), 10 increments)		ements), and 10 to 100	(in			
Response time	Within $[2 \text{ ms} + 2 \times (\text{integration time})]$ (rising from negative f.s. to positive f.s., or falling from positive f.s. to negative f.s.)			m			
Faster response	On/off						
Common mode rejection ratio	100 dB or more (at 50 Hz / 60 Hz, a signal source resistance of 100 $\Omega$ or less)						
Input type	Unbalanced input	(floating)					
Input terminals	Banana jacks						
Maximum input voltage	500 V DC						
Maximum rated voltage to earth	300 V AC, DC (between each input channel and enclosure, between any two of input channels) Measurement category II (anticipated transient overvoltage: 2500 V)						
Operating temperature and humidity	In accordance with installed	In accordance with the specifications of Memory HiCorder in which Model MR8990 is installed					

Operating environment	In accordance with the specifications of Memory HiCorder in which Model MR8990 is installed	
Storage temperature and humidity	−10°C to 50°C (14°F to 122°F), 80% RH or less (no condensation)	
Dimensions	Approx. 106W × 19.8H × 196.5D mm (4.17"W × 0.78"H × 7.74"D)	
Mass	Approx. 260 g (9.2 oz.)	
Effect of radiated radio-frequency electromagnetic field	±0.1% f.s. (at maximum) at 3 V/m (in 5 mV/div range)	
Standards	Safety EN61010 EMC EN61326 Class A	
Option	Model L2200 Test Lead (CAT IV 600 V, CAT III 1000 V, 10 A)	

# 18.6.10 Model U8974 High Voltage Unit

The accuracy has been specified under the following conditions: installed in a Memory HiCorder and operated at  $23^{\circ}C \pm 5^{\circ}C (73^{\circ}F \pm 9^{\circ}F)$  in the range of 20% to 80% RH after a half-hour (at least) warm-up and execution of zero-adjustment.

• • • • •

Product warranty period	3 years
Guaranteed accuracy period	1 year
Number of input channels	2 channels
Measurement functions	Instantaneous value, r.m.s. value (Each channel can have a different setting.)
Measurement range	200 mV, 500 mV, 1 V, 2 V, 5 V, 10 V, 20 V, 50 V/div (mode DC) 500 mV, 1 V, 2 V, 5 V, 10 V, 20 V, 50 V/div (mode RMS)
Measurement accuracy	±0.25% f.s. (with the low-pass filter set to 5 Hz)
RMS measurement accuracy	±1.5% f.s. (DC, 30 Hz of higher but lower than 1 kHz, sine waves, response time: slow) ±3% f.s. (1 kHz to 10 kHz , sine waves) Crest factor: 2 (sine waves, the peak voltage is up to 1000 V)
RMS measurement response time	Fast: 150 ms (rising from 0% of f.s. to 90% of f.s.) Normal: 500 ms (rising from 0% of f.s. to 90% of f.s.) Slow: 2.5 s (rising from 0% of f.s. to 90% of f.s.)
Temperature characteristics	±0.05% f.s./°C
Frequency characteristics	DC to 100 kHz, −3 dB
Noise	30 mV p-p (typ.), 50 mV p-p (max.) (highest sensitivity range, with input short-circuited)
Common mode rejection ratio	80 dB or more (50 Hz / 60 Hz, with input terminals short-circuited)
Low-pass filter	Off, 5±50%, 50±50%, 500±50%, 5 k±50%, 50 k±50% (Hz) −3 dB
Input type	Unbalanced input (floating)
Input coupling	DC/GND
Input resistance	4 MΩ±1%
Input capacitance	5 pF or less (at 100 kHz)
A/D resolution	16 bits
Maximum sampling rate	1 MS/s
Input terminals	Banana jacks
Maximum input voltage	1000 V DC, 700 V AC
Maximum rated voltage to earth	1000 V AC, DC measurement category III, 600 V AC, DC measurement category IV (between each input channel and enclosure, between any two of input channels) Anticipated transient overvoltage: 8000 V
Operating temperature and humidity	In accordance with the specifications of Memory HiCorder in which Model U8974 is installed
Operating environment	In accordance with the specifications of Memory HiCorder in which Model U8974 is installed

Storage temperature and humidity	Temperature Humidity	-20°C to 50°C (-4°F to 122°F) -20°C or higher but lower than 40°C (-4°F or higher but lower than 104°F) 40°C or higher but lower than 45°C (104°F or higher but lower than 113°F) 45°C to 50°C (113°F to 122°F)	80% RH or less (no condensation) 60% RH or less (no condensation) 50% RH or less (no condensation)	
Dimensions	Approx. 106W	′ × 19.8H × 196.5D mm (4.17″W × 0.78″H × 7.74″D)		
Mass	Approx. 230 g	Approx. 230 g (8.1 oz.)		
Effect of radiated radio-frequency electromagnetic field	±5% f.s. (at a maximum) at 3 V/m			
Effect of conducted radio-frequency electromagnetic field	$\pm 5\%$ f.s. (at a maximum) at 3 V (500 mV/div range, with 1 V DC input)			
Standards	Safety EN6 EMC EN6	1010 1326 Class A		
Options	Model L4940 ( Model L4935 / 1000 V, 10 A) Model L9243 ( Model L4936 I Model L4937 I Model L4931 I Model L4932 ( 10 A) Model L4934* * Model L4932	Connection Cable Set (1.5 m) Alligator Clip Set (attachable on the tips of L4940, CAT I Bus Bar Clip Set (attachable on the tips of L4940, CAT I Bus Bar Clip Set (attachable on the tips of L4940, C. Magnetic Adapter Set (attachable on the tips of L4940, C. Test Pin Set (for L4940, 1.5 m, CAT IV 600 V, C Test Pin Set (attachable on the tips of L4940, CAT IV Small Alligator Clip Set (CAT III 300 V, CAT II 600 V Se is required to use Model L4934.	AT IV 600 V, CAT III I 1000 V, 1 A) AT III 600 V, 5 A) 40, CAT III 1000 V, 2 A) AT III 1000 V, 10 A) / 600 V, CAT III 1000 V,	

# 18.6.11 Model U8979 Charge Unit

## 1. General specifications

Operating environment	Indoors, Pollution Degree 2, Operating altitude: up to 2000 m (6562 ft.)
Operating temperature and humidity	0°C to 40°C (32°F to 104°F), 80% RH or less (no condensation)
Storage temperature and humidity	-10°C to 50°C (14°F to 122°F) For -10°C or higher but lower than 40°C (14°F or higher but lower than 104°F), 80% RH or less (no condensation) For 40°C or higher but lower than 45°C (104°F or higher but lower than 113°F), 60% RH or less (no condensation) For 45°C to 50°C (113°F to 122°F), 50% RH or less (no condensation)
Standards	Safety: EN61010 EMC: EN61326 Class A
Dimensions	Approx. 106W × 19.8H × 196.5D mm (4.17"W × 0.78"H × 7.74"D)
Mass	Approx. 250 g (8.8 oz.)
Product warranty period	3 years
Guaranteed accuracy period	1 year
Option	Model 9166 Connection Cord (for voltage measurement)

. . . . . . .

. . . . . . . . .

## 2. Specifications of input, output, and measurement

#### -1. Common specifications

Number of channels	2 channels
Measurement mode	Charge, pre-amplifier, voltage (selectable for each channel)
Input type	Unbalanced input (floating) In each channel, the voltage input terminal has the same-potential ground as the charge input terminal.
Common-mode rejection ratio	80 dB or more (at 50 Hz / 60 Hz, a signal source resistance of 100 $\Omega)$
Anti-aliasing filters	Cutoff frequency (fc): 20, 40, 80, 200, 400, 800, 2 k, 4 k, 8 k, 20 k, 40 k (Hz) Switchable between on and off; the instrument automatically chooses a cutoff frequency along with the sampling rate. Attenuation property: -66 dB or higher at a cutoff frequency of 1.5 fc
Maximum sampling rate	200 kS/s
A/D resolution	16 bits (± f.s. = ±25,000 data points)
Maximum rated voltage to earth	30 V AC, 60 V DC (between each input channel and the enclosure, between any two of input channels) Anticipated transient overvoltage: 330 V

#### -2. Voltage input

Measurement range	10, 20, 40, 100, 200, 400 mV f.s., 1, 2, 4, 10, 20, 40 V f.s.
Maximum input voltage	40 V DC

Frequency characteristics	DC to 50 kHz−3 dB (DC-coupled)1 Hz to 50 kHz−3 dB (AC-coupled, lower cutoff frequency: 1 Hz ±50%)
Noise	80 $\mu V$ p-p (typ.), 120 $\mu V$ p-p (max.), with the highest sensitivity range and the terminals of each input connector connected with each other
Input resistance	1 MΩ ±1%
Input capacitance	200 pF or less (at 100 kHz)
Input coupling	AC/DC/GND
Input terminals	Metallic BNC terminal

## -3. Charge input

Supported detector	Charge-output acceleration detector
Measurement sensitivity	0.1 pC/(m/s <sup>2</sup> ) to 10 pC/(m/s <sup>2</sup> )
Measurement range	<ul> <li>40, 100, 200, 400, 1 k, 2 k, 4 k, 10 k, 20 k, 40 k, 100 k, 200 k m/s<sup>2</sup> f.s. Measurement sensitivity: 0.1 pC/(m/s<sup>2</sup>) to 0.25 pC/(m/s<sup>2</sup>)</li> <li>20, 40, 100, 200, 400, 1 k, 2 k, 4 k, 10 k, 20 k, 40 k, 100 k m/s<sup>2</sup> f.s. Measurement sensitivity: 0.251 pC/(m/s<sup>2</sup>) to 0.5 pC/(m/s<sup>2</sup>)</li> <li>10, 20, 40, 100, 200, 400, 1 k, 2 k, 4 k, 10 k, 20 k, 40 k m/s<sup>2</sup> f.s. Measurement sensitivity: 0.501 pC/(m/s<sup>2</sup>) to 1.0 pC/(m/s<sup>2</sup>)</li> <li>4, 10, 20, 40, 100, 200, 400, 1 k, 2 k, 4 k, 10 k, 20 k m/s<sup>2</sup> f.s. Measurement sensitivity: 1.001 pC/(m/s<sup>2</sup>) to 2.5 pC/(m/s<sup>2</sup>)</li> <li>2, 4, 10, 20, 40, 100, 200, 400, 1 k, 2 k, 4 k, 10 k m/s<sup>2</sup> f.s. Measurement sensitivity: 2.501 pC/(m/s<sup>2</sup>) to 5.0 pC/(m/s<sup>2</sup>)</li> <li>1, 2, 4, 10, 20, 40, 100, 200, 400, 1 k, 2 k, 4 k m/s<sup>2</sup> f.s. Measurement sensitivity: 5.001 pC/(m/s<sup>2</sup>) to 10.0 pC/(m/s<sup>2</sup>)</li> </ul>
Frequency characteristics	1.5 Hz to 50 kHz -3 dB
Maximum input charge	±500 pC (when one of the higher six ranges is chosen) ±50,000 pC (when one of the lower six ranges is chosen)
Input coupling	AC/GND
Input terminals	Miniature connector (#10-32UNF)

### -4. Input from acceleration sensor with the built-in pre-amplifier

Supported detector	Acceleration detector with built-in pre-amplifier
Measurement sensitivity	0.1 mV/(m/s <sup>2</sup> ) to 10 mV/(m/s <sup>2</sup> )
Measurement range	<ul> <li>40, 100, 200, 400, 1 k, 2 k, 4 k, 10 k, 20 k, 40 k, 100 k, 200 k m/s<sup>2</sup> f.s. Measurement sensitivity: 0.1 mV/(m/s<sup>2</sup>) to 0.25 mV/(m/s<sup>2</sup>)</li> <li>20, 40, 100, 200, 400, 1 k, 2 k, 4 k, 10 k, 20 k, 40 k, 100 k m/s<sup>2</sup> f.s. Measurement sensitivity: 0.251 mV/(m/s<sup>2</sup>) to 0.5 mV/(m/s<sup>2</sup>)</li> <li>10, 20, 40, 100, 200, 400, 1 k, 2 k, 4 k, 10 k, 20 k, 40 k m/s<sup>2</sup> f.s. Measurement sensitivity: 0.501 mV/(m/s<sup>2</sup>) to 1.0 mV/(m/s<sup>2</sup>)</li> <li>4, 10, 20, 40, 100, 200, 400, 1 k, 2 k, 4 k, 10 k, 20 k m/s<sup>2</sup> f.s. Measurement sensitivity: 1.001 mV/(m/s<sup>2</sup>) to 2.5 mV/(m/s<sup>2</sup>)</li> <li>2, 4, 10, 20, 40, 100, 200, 400, 1 k, 2 k, 4 k, 10 k m/s<sup>2</sup> f.s. Measurement sensitivity: 2.501 mV/(m/s<sup>2</sup>) to 5.0 mV/(m/s<sup>2</sup>)</li> <li>1, 2, 4, 10, 20, 40, 100, 200, 400, 1 k, 2 k, 4 k m/s<sup>2</sup> f.s. Measurement sensitivity: 5.001 mV/(m/s<sup>2</sup>) to 10.0 mV/(m/s<sup>2</sup>)</li> </ul>
Frequency characteristics	1 Hz to 50 kHz −3 dB

Power supply for detector	3.5 mA ±20%, 22 V ±5%
Input coupling	AC/GND
Input terminals	Metallic BNC terminal

## -5. Specifications for accuracy

Conditions of guaranteed accuracy	Guaranteed accuracy period: 1 year Guaranteed accuracy period after adjustment made by Hioki: 1 year Temperature and humidity for guaranteed accuracy: 23°C ±5°C (73°F ±9°F), 80% RH or less Warm-up time: 30 minutes or more Specified after execution of zero-adjustment
Accuracy of voltage measurement	$\pm 0.5\%$ f.s. (with the filter set at 5 Hz)
Temperature characteristic of voltage measurement	±0.05% f.s./°C
Accuracy of amplitude with charge inputted	±2% f.s.
Temperature characteristic with charge inputted	±0.2% f.s./°C
Accuracy of amplitude inputted from acceleration detector with built-in pre-amplifier	±2% f.s.
Temperature characteristics of input from acceleration sensor with the built-in pre- amplifier	±0.2% f.s./°C
Effect of radiated radio-frequency electromagnetic field	±10% f.s. (max.) at 3 V/m (with the filter set at 5 Hz)
Effect of conducted radio-frequency electromagnetic field	±10% f.s. (max.) at 3 V (with the filter set at 5 Hz)

## 3. Specifications of functions

Low-pass filter	Off, 5 ±50% (voltage input only), 500 ±50%, 5k ±50% (Hz) −3 dB
TEDS	IEEE1451.1.4 Class 1 compliant The instrument reads out sensor information to automatically configure the sensitivity setting.

. . .

# 18.6.12 Model U8793 Arbitrary Waveform Generator Unit

Operating environment	In accordance with the specifications of Memory HiCorder in which Model U8793 is installed	
Operating temperature and humidity	In accordance with the specifications of Memory HiCorder in which Model U8793 is installed	
Storage temperature and humidity	−20°C to 50°C (−4°F to 122°F), 80% RH or less (no condensation)	
Standards	Safety EN61010 EMC EN61326 Class A	
Dimensions	Approx. 106W × 19.8H × 196.5D mm (4.17"W × 0.78"H × 7.74"D) (excluding protrusions)	
Mass	Approx. 250 g (8.8 oz.)	
Product warranty period	3 years	
Options	Model L9795-01 Connection Cable (terminal type: SMB terminal/mini-alligator clip) Model L9795-02 Connection Cable (terminal type: SMB terminal/BNC terminal)	

### **General specifications**

## Specifications of output

Basic specifications (common to both FG function and user-defined waveform generation function)

Conditions of guaranteed accuracy	Guaranteed accuracy period: 1 year Guaranteed accuracy period from adjustment made by Hioki: 1 year Temperature and humidity for guaranteed accuracy: 23°C±5°C (73°F±9°F), 80% RH or less Warm-up time: at least 30 min. Power supply frequency range for Memory HiCorder in which Model U8793 is installed: 50 Hz / 60 Hz ±2 Hz
Number of output channels	2 channels
Output terminals	SMB terminals
Output type	Unbalanced output (floating)
Maximum rated voltage to earth	30 V rms AC or 60 V DC (between individual output channels and enclosure/external I/O terminals as well as between individual output channels) Anticipated transient overvoltage: 300 V
Maximum output voltage	-10 V to 15 V
Amplitude setting range	0 V p-p to 20 V p-p (setting resolution: 1 mV)
DC offset setting range	-10 V to 15 V (setting resolution: 1 mV)
Output impedance	1 Ω or less
Maximum output current	±10 mA (per channel)
Allowable load resistance	1.5 kΩ or more
Output configuration	Waveform output/open/short

## Specificationsof FG function

Output waveform	Sine wave, rectangular wave, pulse wave (variable duty ratio), triangular wave, ramp wave, DC
Output frequency range	0 Hz to 100 kHz (setting resolution: 10 mHz)
Output frequency accuracy	±0.015% of setting
DC output accuracy	±0.05% of setting ±10 mV
DC output temperature characteristic	(±0.005% of setting ±1 mV)/°C
Amplitude accuracy	±0.5% of setting ±10 mV p-p (10 mHz to 10 kHz) ±0.8% of setting±10 mV p-p (higher than 10 kHz but not higher than 50 kHz) ±1.0% of setting±10 mV p-p (higher than 50 kHz but not higher than 100 kHz)
Amplitude temperature characteristic	(±0.05% of setting ±1 mV p-p)/°C
DC offset accuracy	±0.5% of setting ±10 mV
DC offset Temperature characteristics	(±0.05% of setting ±1 mV)/°C
Phase difference setting range	-360° to 360° (setting resolution: 0.1°)
Jitter	Within 50 ns p-p (rectangular waves, pulse waves, triangular waves, ramp waves)
Pulse waves duty ratio setting range	0.1% to 99.9% (setting resolution: 0.1%) Valid with a pulse width of 500 ns or more
Pulse waves duty ratio accuracy	±0.1% of period (10 mHz to 5 kHz) ±0.5% of period (higher than 5 kHz but not higher than 20 kHz) ±1.0% of period (higher than 20 kHz but not higher than 100 kHz)

### Specifications of user-defined waveform generation function

Output waveform	Waveforms measured with Model 8847, MR8847, MR8847A, MR8827, MR8740 or MR8741 Memory HiCorder (Logic waveforms are not supported.) Waveforms measured with Model PW3198 Power Quality Analyzer (via Model SF8000) Waveforms saved by Model 7075 Waveform Generator (via Model SF8000) Waveforms created in CSV format (via Model SF8000) Waveforms created with Model SF8000 Waveform Maker
Voltage axis resolution	16 bits
Waveform memory capacity	256 kW/channel × 8 blocks
Low-pass filter	2nd-order LPF, 50 Hz to 1 MHz (14 steps based on 1-2-5 series)
D/A refresh rate	2 MHz at a maximum (setting resolution:10 mHz)
Clock frequency accuracy	±150 ppm
Clock frequency jitter	Within 50 ns p-p
Delay	-250,000 to 250,000 (in 1 data point increments)
Loop count	1 to 50,000 or infinity

Sweep waveforms	Non-DC FG waveforms, user-defined waveforms	
Sweep form	Linear	
Sweep target	FG waveforms:	Frequency, amplitude, offset, duty ratio (pulse waves only) (Simultaneously sweeping frequency, amplitude, and offset is available.)
	User-defined waveforms:	Clock frequency, amplitude, offset (Simultaneously sweeping clock frequency, amplitude, and offset is available.)
Sweep time setting range	10 µs to 1000 s (se	tting resolution: 10 μs)

## Specifications of sweep function

## Specifications of program function

Sequence length	Links up to 128 steps into a single sequence, outputting that.
Step control	A waveform type of each step can be set to FG waveform, sweep waveform, or user- defined waveform. An output period of each step can be set to the number of loops (for sweep waveforms) or an output time (for FG and user-defined waveforms).
Hold settings	Each step can be set to on or off.
Output time setting range	10 μs to 1000 s (for FG waveform and user-defined)
Step loop count setting range	1 to 1,000 (for sweep waveform)
Overall loop count setting range	1 to 50,000 or infinity
Monitor function	The step number and loop count of the step being presently executed, and the overall loop count can be displayed.

## Other specifications

Inter-channel synchronization	The phase difference between channels on a module and that between modules can be set.	
Self-test function	Output voltage values can be monitored. Monitor resolution: 10 mV Monitor accuracy: ±3.0% of f.s. (f.s.=15 V)	
Starting/stopping output	Controllable by operating the key on the Memory HiCorder or inputting a signal to the unit's external control terminal	
External input	While using the program function, externally inputting a low-level signal disengages the hold, proceeding to the next step.Control voltage level:3.5 V to 5.0 V (high level), 0 V to 0.8 V (low level)Response pulse width:100 µs or more (low level)	
External output	Output signals during waveform outputOutput type:Open-drain output (with 5-volt outputs, active low)Output voltage level:4.0 V to 5.0 V (high level), 0 V to 0.5 V (low level)Contact capacity:5 V to 30 V DC, 50 mA	
External I/O terminals	Push-button type terminal block	
Waveform output indicator	The red LED is turned on when a waveform is output; and turned off when no waveforms output.	

# 18.6.13 Model MR8790 Waveform Generator Unit

The accuracy has been specified under the following conditions: installed in a Memory HiCorder and operated at  $23^{\circ}C \pm 5^{\circ}C (73^{\circ}F \pm 9^{\circ}F)$  in the range of 20% to 80% RH after a half-hour (at least) warm-up.

### **General specifications**

Product warranty period	3 years	
Guaranteed accuracy period	1 year	
Guaranteed accuracy period after adjustment made by Hioki	1 year	
Number of output channels	4 channels (Every channel is isolated from the unit and outputs. Each channel is isolated from each other)	
Self-test function	Yes (by utilizing the voltage and current monitors)	
Voltage and current monitor function (switchable)	Resolution: $5 \mu A$ (current monitor) 10 mV (voltage monitor) Monitor accuracy:+2.0% of f.a. (f.a. = 10.) ([voltage monitor] or 5 mA [current monitor])	
(,	Monitor accuracy.±3.0% of i.s. (i.s. = 10 v [voltage monitor] of 5 mA [current monitor])	
Maximum output current	±5 mA	
Allowable load resistance	2 kΩ or more	
Output terminals	SMB terminals	
Output configuration	Waveform output/open/short-circuit	
Output relay switching time	5 ms or less	
Output protection	Output current limited to 40 mA (with output short-circuited)	
Maximum rated voltage to earth	30 V rms AC or 60 V DC (between each output channel and enclosure, between any two of output channels) Anticipated transient overvoltage: 330 V	
Operating temperature and humidity	In accordance with the specifications of Memory HiCorder in which Model MR8790 is installed	
Operating environment	In accordance with the specifications of Memory HiCorder in which Model MR8790 is installed	
Storage temperature and humidity	−20°C to 50°C (−4°F to 122°F), 90% RH or less (no condensation)	
Dimensions	Approx. 106W × 19.8H × 196.5D mm (4.17"W × 0.78"H × 7.74"D) (excluding protrusions)	
Mass	Approx. 230 g (8.1 oz.)	
Standards	Safety EN61010 EMC EN61326 Class A	
Effect of radiated radio-frequency electromagnetic field	±3% of f.s. (at maximum) at 3 V/m (f.s.=10 V)	
Effect of conducted radio-frequency electromagnetic field	±1% of f.s. (at maximum) at 3 V (f.s.=10 V)	
Options	Model L9795-01 Connection Cable (terminal type: SMB terminal/mini-alligator clip) Model L9795-02 Connection Cable (terminal type: SMB terminal/BNC terminal)	

Maximum output voltage	±10 V	
Resolution	16 bits	
Output frequencies	Output frequencies: Setting resolution: Frequency accuracy:	DC, 0 Hz to 20 kHz (sine waves) 1 Hz ±0.01% of setting
Amplitude	Setting range: Setting resolution: Amplitude accuracy:	0 V p-p to 20 V p-p 1 mV ±0.25% of setting ±2 mV p-p (1 Hz to 10 kHz) ±0.6% of setting ±2 mV p-p (higher than 10 kHz but not higher than 20 kHz)
DC offset	Setting range: -10 Per Setting resolution:1 n Offset accuracy: ±3	0 V to 10 V ak value including amplitude and DC offset is limited to $\pm 10$ V. nV mV
DC output	Output accuracy: ±0.	6 mV

## Specifications of voltage output

# 18.6.14 Model MR8791 Pulse Generator Unit

## **General specifications**

Temperature and humidity for guaranteed accuracy	$23^\circ\text{C}\pm5^\circ\text{C}$ (73°F±9°F), 80% RH or less (no condensation) (When installed in the Memory HiCorder)		
Guaranteed accuracy period	1 year		
Product warranty period	3 years		
Operating temperature and humidity	In accordance with the specifications of Memory HiCorder in which Model MR8791 is installed		
Operating environment	In accordance with the specifications of Memory HiCorder in which Model MR8791 is installed		
Storage temperature and humidity	−20°C to 50°C (−4°F to 122°F), 90% RH or less (no condensation)		
Maximum rated voltage to earth	30 V rms AC or 60 V DC (between output channels and enclosure) Anticipated transient overvoltage: 330 V		
Dimensions	Approx. 106W × 19.8H × 196.5D mm (4.17"W × 0.78"H × 7.74"D) (excluding protrusions)		
Mass	Approx. 230 g (8.1 oz.)		
Number of output channels	8 channels (Every channel is isolated from the unit. Each channel is isolated from each other) (Every channel is not isolated from one another [common GND]) (Every channel is not isolated from output connector frame [common GND])		
Output mode 1	Pattern output/pulse output (8 channels switch at the same time)		
Output mode 2	Logic output/open-collector output (can be set with respect to each of eight channels)		
Logic output: Open collector Outpu	Output voltage level:0 V to 5 V (high level 3.8 V or more, low level 0.8 V or less)Rated current:±5 mAt:Collector-emitter absolute maximum rated voltage:50 VOver-current protection:100 mA		
Output mode 3	Output/open (= self-test) (8 channels switch at the same time)		
Open-collector output spec (rising time [10% to 90%])	5 $\mu s$ (at maximum) (a load capacity of 1000 pF, a pull-up resistance of 1 k $\Omega)$		
Self-test function	Detected voltages: High level: 3.4 V or more, low level: 1.6 V or less		
Relay switching time	5 ms or less (switchable between logic and open collector, switchable between output and open [self-test])		
Standards	Safety EN61010 EMC EN61326 Class A		

• • •

## Specifications of pulse output

Output frequency	Setting range: Setting resolution: Frequency accuracy:	0 Hz to 20 kHz (can be set with respect to each of eight channels) 0.1 Hz ±100 ppm
Duty ratio	Setting range: Setting resolution: Duty ratio accuracy:	0.1% to 99.9%, 0, 100% (DC) 0.1% [±100 ppm (setting period) ±150 ns] of setting "Minimum pulse width" and "Open collector output regulation" specifications have priority.

#### Minimum pulse width 1 µs

## Specifications of pattern output

Clock frequency	Range: Setting resolution: Frequency accuracy:	0 Hz to 120 kHz (Common to 8 channels) 10 Hz ± 100 ppm of setting
Memory (Pattern)	2,048 words (16,384	bits = 2,048 words × 8 bits/word)

# Specifications of output connector

10250-52A2PL: Manufactured by Sumitomo 3M (SCSI-2 connector), (Centronics half-pitch 50-pin socket-contact)

• • • • • • • • • • • • • • •

• • • • •

Pin	Signal name	Pin	Signal name
1	I_GND	26	I_GND
2	CH1	27	I_GND
3	CH2	28	I_GND
4	CH3	29	I_GND
5	CH4	30	I_GND
6	I_GND	31	I_GND
7	CH5	32	I_GND
8	CH6	33	I_GND
9	CH7	34	I_GND
10	CH8	35	I_GND
11	I_GND	36	I_GND
12	NC	37	I_GND
13	NC	38	I_GND
14	NC	39	I_GND
15	NC	40	I_GND
16	I_GND	41	I_GND
17	NC	42	I_GND
18	NC	43	I_GND
19	NC	44	I_GND
20	NC	45	I_GND
21	I_GND	46	I_GND
22	TEST2 (DIN03)	47	I_GND
23	TEST3 (DIN02)	48	I_GND
24	NC	49	I_GND
25	NC	50	I_GND
Frame	F_GND		

CH1 to CH8:	Pulse output
I_GND:	Isolation GND (isolated GND)
F_GND:	Non-Isolation GND (main unit GND)
NC:	Not Connected
TESTn:	Test pin, Do NOT connect any signal to them.

Recommended connection cable: KB-SHH2: Sanwa Supply (SCSI-2 connector) (Centronics half 50-pin male)
. . . . .

# 18.6.15 Model U8975 4CH Analog Unit

The accuracy has been specified under the following conditions: installed in a Memory HiCorder and operated at 23°C  $\pm$ 5°C (73°F  $\pm$ 9°F) in the range of 20% to 80% RH after a half-hour (at least) warm-up and execution of zero-adjustment.

Operating environment	Indoors, pollution degree 2, operating altitude: up to 2000 m (6562 ft.)		
Operating temperature and humidity range	0°C to 40°C (32°F to 104°F), 80% RH or less (no condensation)		
Storage temperature and humidity range	<ul> <li>-10°C to 50°C</li> <li>For -10°C or higher but lower than 40°C (14°F or higher but lower than 104°F),</li> <li>80% RH or less (no condensation)</li> <li>For 40°C or higher but lower than 45°C (104°F or higher but lower than 113°F),</li> <li>60% RH or less (no condensation)</li> <li>For 45°C to 50°C (113°F to 122°F), 50% RH or less (no condensation)</li> </ul>		
Standards	Safety: EN61010 EMC: EN61326 Class A		
Dimensions	Approx. 106W × 19.8H × 196.5D mm (4.17"W × 0.78"H × 7.74"D)		
Weight	Approx. 250 g (8.8 oz.)		
Product warranty period	3 years		
Measurement range	4, 10, 20, 40, 100, 200 V f.s.		
Maximum input voltage	200 V DC		
Maximum rated terminal-to-ground voltage	300 V AC, DC, Measurement category II (between each input channel and the enclosure, between any two of input channels) Anticipated transient overvoltage: 2500 V		
Measurement terminals	Insulated BNC terminal		
Number of channels	4 channels		
Frequency characteristics	DC to 2 MHz, −3 dB		
Noise	5 mV p-p (typ.), 10 mV p-p (max.) (with the highest sensitivity range and input terminals connected with each other)		
Input type	Unbalanced input (floating)		
Input coupling	DC/GND		
Input resistance	1 MΩ ±1%		
Input capacitance	30 pF ±10 pF (at 100 kHz)		
A/D resolution	16 bits (± f.s. = ±32,000 data points)		
Maximum sampling rate	5 MS/s		
Accuracy guarantee period	1 year		
Accuracy guarantee period after adjustment made by Hioki	1 year		

Measurement accuracy	±0.1% f.s. (with the filter set at 5 Hz)	
Temperature characteristics	±0.02% f.s./°C	
Effect of radiated radio-frequency electromagnetic field	$\pm$ 5% f.s. (max.) at 3 V/m (with the filter set at 5 Hz)	
Effect of conducted radio-frequency electromagnetic field	$\pm 5\%$ f.s. (max.) at 3 V (in the 10 V range, with the filter set at 5 Hz, with 1 V DC inputted)	
Common-mode rejection ratio	80 dB or more (at 50 Hz / 60 Hz, a signal source resistance of 100 $\Omega)$	
Low-pass filter	Off, 5 ±50%, 500 ±50%, 5 k ±50%, 200 k ±50% (Hz) −3 dB	
Options	Model L9197 Connection Cord (CAT IV 300 V, CAT III 600 V, 1 A) Model L9198 Connection Cord (CAT III 300 V, CAT II 600 V, 0.2 A) Model L9217 Connection Cord (CAT III 300 V, CAT II 600 V, 0.2 A) Model L9790 Connection Cord (with Model L9790-01 or 9790-03: CAT III 300 V, CAT II 600 V, 1 A) (with Model 9790-02: CAT III 150 V, CAT II 300 V, CAT II 600 V, 1 A) Model 9322 Differential Probe (with grabber clips attached: CAT II 1000 V) (with alligator clips attached: CAT III 600 V, CAT II 1000 V) Model P9000-01 Differential Probe (CAT III 1000 V) Model P9000-02 Differential Probe (CAT III 1000 V) Model 9665 10:1 Probe (CAT II 300 V) Model 9666 100:1 Probe (CAT II 300 V)	

. . . . .

# 18.6.16 Model U8977 3CH Current Unit Current Unit

The accuracy has been specified under the following conditions: installed in a Memory HiCorder and operated at  $23^{\circ}C \pm 5^{\circ}C$  ( $73^{\circ}F \pm 9^{\circ}F$ ) in the range of 20% to 80% RH after a half-hour (at least) warm-up and execution of zero-adjustment.

Operating environment	Indoors, pollution degree 2, operating altitude: up to 2000 m (6562 ft.)		
Operating temperature and humidity range	0°C to 40°C (32°F to 104°F), 80% RH or less (no condensation)		
Storage temperature and humidity range	<ul> <li>-10°C to 50°C (14°F to 122°F)</li> <li>For -10°C or higher but lower than 40°C (14°F or higher but lower than 104°F),</li> <li>80% RH or less (no condensation)</li> <li>For 40°C or higher but lower than 45°C (104°F or higher but lower than 113°F),</li> <li>60% RH or less (no condensation)</li> <li>For 45°C to 50°C (113°F to 122°F), 50% RH or less (no condensation)</li> </ul>		
Standards	Safety: EN61010 EMC: EN61326 Class A		
Dimensions	Approx. 106W × 19.8H × 196.5D mm (4.17"W × 0.78"H × 7.74"D)		
Weight	Approx. 250 g (8.8 oz.)		
Product warranty period	3 years		
Options	Model CT9900 Conversion Cable (PL23 receptacle–ME15W plug) Model CT9920 Conversion Cable (PL14 receptacle–ME15W plug)		
Number of input channels	3 channels		
Supported current sensors	<ul> <li>Directly connectable current sensors</li> <li>Model 9272-05 Clamp on Sensor (20 A/200 A AC)</li> <li>Model CT6841-05 AC/DC Current Probe (20 A)</li> <li>Model CT6843-05 AC/DC Current Probe (200 A)</li> <li>Model CT6844-05 AC/DC Current Probe (500 A, ¢20 mm)</li> <li>Model CT6845-05 AC/DC Current Probe (500 A, ¢50 mm)</li> <li>Model CT6846-05 AC/DC Current Probe (1000 A)</li> <li>Model CT6862-05 AC/DC Current Probe (1000 A)</li> <li>Model CT6862-05 AC/DC Current Sensor (50 A)</li> <li>Model CT6863-05 AC/DC Current Sensor (200 A)</li> <li>Model CT6863-05 AC/DC Current Sensor (500 A)</li> <li>Model CT6865-05 AC/DC Current Sensor (1000 A)</li> <li>Model CT6875 AC/DC Current Sensor (500 A)</li> <li>Model CT6876 AC/DC Current Sensor (1000 A)</li> <li>Model CT6877 AC/DC Current Sensor (1000 A)</li> <li>Model CT6877 AC/DC Current Sensor (1000 A)</li> <li>Model CT7631 AC/DC Current Sensor (100 A)</li> <li>Model CT7636 AC/DC Current Sensor (100 A)</li> <li>Model CT7636 AC/DC Current Sensor (100 A)</li> <li>Model CT7636 AC/DC Current Sensor (100 A)</li> <li>Model CT7642 AC/DC Current Sensor (100 A)</li> <li>Model CT7731 AC/DC Current Sensor (2000 A)</li> <li>Model CT7734 AC/DC Auto-Zero Current Sensor (100 A)</li> <li>Model CT7742 AC/DC Auto-Zero Current Sensor (2000 A)</li> <li>Model CT7744 AC Flexible Current Sensor (600 A, ¢100 mm)</li> <li>Model CT7045 AC /DC Current Sensor (6000 A, ¢180 mm)</li> </ul>		

Measurement range	<ul> <li>For the directly connectable current sensors, the instrument automatically recognizes the rating of the current sensor.</li> <li>2 A, 4 A, 10 A, 20 A, 40 A, 100 A (rating: 20 A)</li> <li>4 A, 10 A, 20 A, 40 A, 100 A, 200 A (rating: 50 A)</li> <li>20 A, 40 A, 100 A, 200 A, 400 A, 1000 A (rating: 200 A)</li> <li>40 A, 100 A, 200 A, 400 A, 1000 A, 2000 A (rating: 500 A)</li> <li>100 A, 200 A, 400 A, 1000 A, 2000 A (rating: 1000 A)</li> <li>For the current sensors that require Model CT9920 for connection, choose a conversion rate or a model number.</li> <li>200 A (Model CT7631, CT7731)</li> <li>200 A, 400 A, 1000 A (Model CT7636, CT7736)</li> <li>2000 A, 4000 A, 1000 A (Model CT7642, CT7742)</li> <li>2000 A, 4000 A, 10000 A, 2000 A, 4000 A, 100000 A (0.1 mV/A)</li> <li>200 A, 400 A, 1000 A, 2000 A, 4000 A, 10000 A (1 mV/A)</li> <li>20 A, 40 A, 100 A, 200 A, 400 A, 1000 A (100 mV/A)</li> <li>2 A, 4 A, 10 A, 20 A, 4 A, 10 A (1000 mV/A)</li> </ul>	
Frequency characteristics	DC to 2 MHz (±3 dB)	
Noise	10 mA p-p (max.) (using the 20-A sensor, with the 2 A f.s. range and input terminals connected with each other)	
Low-pass filter	Off, 5 Hz, 500 Hz, 5 kHz, 200 kHz ±50% (−3 dB)	
Input type	Current sensor	
Measurement terminal	LR10-DC12BR (Hirose connector)	
Input coupling	DC/GND	
Input resistance	1 MΩ ±1%	
Maximum input current	Depends on a sensor.	
Maximum rated terminal-to-ground voltage	Non-isolated	
Maximum sampling rate	5 MS/s	
A/D resolution	16 bits	
Accuracy guarantee period	1 year	
Accuracy guarantee period after adjustment made by Hioki	1 year	
Measurement accuracy	±0.3% f.s. + (accuracy of current sensor)	
Temperature characteristics	±0.045% f.s./°C	
Effect of radiated radio-frequency electromagnetic field	±5% f.s. (max.) at 3 V/m (with the filter set at 5 Hz)	
Effect of conducted radio-frequency electromagnetic field	$\pm$ 5% f.s. (max.) at 3 V (using the 20-A sensor, with the 20 A f.s. range, with the filter set at 5 Hz, with a current of 2 A DC inputted)	

• • • •

# 18.6.17 Model U8978 4CH Analog Unit

The accuracy has been specified under the following conditions: installed in a Memory HiCorder and operated at  $23^{\circ}C \pm 5^{\circ}C$  ( $73^{\circ}F \pm 9^{\circ}F$ ) in the range of 20% to 80% RH after a half-hour (at least) warm-up and execution of zero-adjustment.

Operating environment	Indoors, pollution degree 2, operating altitude: up to 2000 m (6562 ft.)		
Operating temperature and humidity range	0°C to 40°C (32°F to 104°F), 80% RH or less (no condensation)		
Storage temperature and humidity range	<ul> <li>−10°C to 50°C (14°F to 122°F)</li> <li>For −10°C or higher but lower than 40°C (14°F or higher but lower than 104°F), 80% RH or less (no condensation)</li> <li>For 40°C or higher but lower than 45°C (104°F or higher but lower than 113°F), 60% RH or less (no condensation)</li> <li>For 45°C to 50°C (113°F to 122°F), 50% RH or less (no condensation)</li> </ul>		
Standards	Safety: EN61010 EMC: EN61326 Class A		
Dimensions	Approx. 106W × 19.8H × 196.5D mm (4.17"W × 0.78"H × 7.74"D)		
Weight	Approx. 250 g (8.8 oz.)		
Product warranty period	3 years		
Measurement range	100, 200, 400 mV f.s., 1, 2, 4, 10, 20, 40 V f.s.		
Maximum input voltage	(Direct input) 40 V DC (In combination with Model 9665) 400 V DC		
Maximum rated terminal-to-ground voltage	<ul> <li>(Direct input)</li> <li>30 V AC, 60 V DC (between each input channel and the enclosure, between any two of input channels)</li> <li>(In combination with Model 9665)</li> <li>300 V AC, DC, Measurement category II (between each input channel and the enclosure, between any two of input channels)</li> </ul>		
Measurement terminals	Insulated BNC terminal		
Number of channels	4 channels		
Frequency characteristics	DC to 2 MHz, -3 dB		
Noise	500 $\mu$ V p-p (typ.), 1 mV p-p (max.) (with the highest sensitivity range and the terminals of each input connector connected with each other)		
Input type	Unbalanced input (floating)		
Input coupling	DC/GND		
Input resistance	1 MΩ ±1%		
Input capacitance	30 pF ±10 pF (at 100 kHz)		
A/D resolution	16 bits (± f.s. = ±32,000 data points)		
Maximum sampling rate	5 MS/s		
Accuracy	1 year		

Accuracy guarantee period after adjustment made by Hioki	1 year
Measurement accuracy	±0.3% f.s. (with the filter set at 5 Hz)
Temperature characteristics	±0.045% f.s./°C
Effect of radiated radio-frequency electromagnetic field	$\pm$ 5% f.s. (max.) at 3 V/m (with the filter set at 5 Hz)
Effect of conducted radio-frequency electromagnetic field	$\pm 5\%$ f.s. (max.) at 3 V (in the 10 V range, with the filter set at 5 Hz, with 1 V DC inputted)
Common-mode rejection ratio	80 dB or more (at 50 Hz / 60 Hz, a signal source resistance of 100 $\Omega)$
Low-pass filter	Off, 5 ±50%, 500 ±50%, 5 k ±50%, 200 k ±50% (Hz) −3 dB
Options	Model L9197 Connection Cord (CAT IV 300 V, CAT III 600 V, 1 A) Model L9198 Connection Cord (CAT III 300 V, CAT II 600 V, 0.2 A) Model L9217 Connection Cord (CAT III 300 V, CAT II 600 V, 0.2 A) Model L9790 Connection Cord (with Model L9790-01 or 9790-03: CAT III 300 V, CAT II 600 V, 1 A) (with Model 9790-02: CAT III 150 V, CAT II 300 V, CAT II 600 V, 1 A) Model 9322 Differential Probe (with grabber clips attached: CAT II 1000 V) (with alligator clips attached: CAT III 600 V, CAT II 1000 V) Model P9000-01 Differential Probe (CAT III 1000 V) Model P9000-02 Differential Probe (CAT III 1000 V) Model 9665 10:1 Probe (CAT II 300 V) Model 9666 100:1 Probe (CAT II 300 V)

**Maintenance and Service** 

## 

Do not touch the internal parts of this instrument as high voltage is generated in some parts. Customers are not allowed to modify, disassemble, or repair the instrument. Doing so may cause fire, electric shock, or injury.

The recording paper can be purchased via authorized Hioki distributor or reseller.

## Calibrations

The frequency of calibration varies depending on the status of the instrument and installation environment. We recommend that the frequency of calibration be determined in accordance with the status of the instrument and installation environment and that you request that calibration be performed periodically.

## **Precautions during shipment**

Be sure to observe the following precautions:

- To avoid damage to the instrument, remove all accessories and optional equipment from the instrument. Use the original packing materials in which the product was shipped. Damage that occurs during transport is not covered by the warranty.
- When sending the instrument for repair, be sure to include details of the problem.

To avoid straining some parts of the printer, and to prevent dirt adhering to the print head, close the printer cover.

## Replaceable parts and operating lifespan

The characteristics of some parts used in the product may deteriorate due to long time of use. To ensure the product can be used over the long term, it is recommended to replace these parts on a periodic basis.

Contact your authorized Hioki distributor or reseller for replacement.

The service life of parts varies with the operating environment and frequency of use. Parts are not guaranteed to operate throughout the recommended replacement cycle.

Part	Recommended replacement cycle	Remarks/conditions
Fan motor	Approx. 4 years	
Print head	After using approx. 1000 rolls of recording paper	
LCD backlight (Half-life of brightness)	Approx. 70,000 hours	At an ambient temperature of 25°C (77°F) The service life varies greatly depending on the ambient environment. The service life becomes shorter under high temperature in particular.
Model U8331 SSD Unit	Approx. 20,000 hours (continuous writing)	In ambient environment of 25°C (77°F) Total bytes written (TBW): Approx. 60 TB Data retention period: Approx. one year (When power is OFF) It is recommended to back up the data at regular intervals.
Electrolytic capacitors	Approx. 4 years	If used under the severe environment (ambient temperature 40°C [104°F]), it will get deteriorated in approx. four years.
Lithium battery	Approx. 10 years	The instrument contains an built-in lithium battery for memory backup, which offers a service life of about 10 years. If the date and time deviate substantially when the instrument is switched on, the battery should be replaced. Contact your authorized Hioki distributor or reseller.

The fuse is housed in the power unit of the instrument. If the power does not turn on, the fuse may be blown. If this occurs, replacement or repair cannot be performed by the customer. Please contact your authorized Hioki distributor or reseller.

# **19.1 Troubleshooting**

If damage is suspected, check the "Troubleshooting" section before contacting your authorized Hioki distributor or reseller.

## Before having the instrument repaired

#### Power and operating keys malfunction

Condition	Check for	Remedy and reference
Turning on the instrument does not cause the screen to display something.	Is the power cord connected? Are connections made correctly?	Verify that the power cord is connected properly. "2.5 Supplying Power" (p. 51)
	<ul> <li>Is any key being held down?</li> </ul>	Check if the keys are stuck.
Keys do not work.	<ul> <li>Is the key lock engaged (Is the key lock message displayed)?</li> </ul>	Disengage the key lock. (Hold down the <b>ESC</b> key for three seconds)

## **Display or operation malfunction**

Condition	Check for	Remedy and reference
Blank screen	Is the backlight saver engaged? Press any key.	Set the backlight saver set to [Off].
Pressing the <b>START</b> key does not allow any waveforms to appear on the screen.	<ul> <li>Is the message "Pre-Trigger Wait" displayed?</li> <li>Is the message "Trigger Wait" displayed?</li> </ul>	When the pre-trigger is engaged, the instrument does not trigger while the pre-trigger memory is being filled. Recording starts when the instrument triggers.
The displayed waveforms do not change.	<ul> <li>Is the clamp sensor or connection cable connected correctly?</li> <li>Is the vertical axis (voltage axis) range set properly?</li> <li>Is the low-pass filter enabled?</li> </ul>	Check the clamp sensor or connection cable for disconnection. Check the input channels for improper settings.
While measuring a signal with the memory function, the displayed frequency is much lower than the actual frequency.	Aliasing may be occurring.	Change the timebase setting to a faster sampling rate. Press the <b>AUTO</b> key to execute the automatic setting. "3.3.2 Timebase and Sampling Rate" (p. 62)
Changing the input range setting does not cause the displayed waveform size to change.	Is the variable function set to [On]?	Set the variable function set to <b>[Off]</b> . "8.6 Setting the Waveform Position (Variable Function)" (p. 178)

## No printing or printing malfunction

Condition	Check for	Remedy and reference
Nothing is printed on the paper.	Is the paper loaded reversely (backside front)?	Check if the recording paper is loaded reversely. "2.4 Loading Recording Paper" (p. 49)
The printout is too light.	<ul><li> Is the recording paper genuine?</li><li> Is the print density set correctly?</li><li> Is the print head clean?</li></ul>	Change the print density setting. "6.5 Configuring the Printer Settings" (p. 133) Clean the print head. "Cleaning the print head" (p. 446)
The recorded trace is too wide.	The input signal may have a ripple component.	Enable the filter in the module settings. "3.4.2 Configuring Analog Channels Settings" (p. 73)
The recorded trace is doubled.	Is the waveform printing density set to [Light]? In this case, printed dots are spaced out in the vertical direction. Thus, a slightly varying signal is printed as the waveform that can seem to be one line or two lines.	Set the waveform printing density to any setting other than [Light]. ([Printer] sheet) "6.5 Configuring the Printer Settings" (p. 133)

## Saving data is not possible

Condition	Check for	Remedy and reference
Saving data on the storage device is not possible.	<ul> <li>Is your CF card Hioki genuine?</li> <li>Is the storage device inserted properly?</li> <li>Is the storage device formatted?</li> <li>Is the remaining capacity of the storage device enough?</li> <li>Is the number of files in the folder reached the limit?</li> </ul>	<ul><li>"2.3 Preparing Storage Devices" (p. 47)</li><li>"To change storage devices" (p. 92)</li></ul>
The USB flash drive cannot be used.	Has the USB flash drive settings been configured?	"USB usage" (p. 48)

19

#### Other

Condition	Check for	Remedy and reference
The USB communications cannot be used.	Have the USB communication settings been configured?	"16.6.1 Configuring the USB Settings With the Instrument" (p. 361)
The USB driver cannot be	Is [Interface] set to [USB]?	Set <b>[Interface]</b> to <b>[USB]</b> . "16.6.1 Configuring the USB Settings With the Instrument" (p. 361)
installed.	Has the USB driver been installed successfully?	Access [device manager] on the computer and delete [Other Devices], then reconnect the USB cable.
The response of remote control is very slow.	Check the Java settings.	For more information about Java settings, see the application disc supplied with the instrument. This remote operation through a browser is mainly intended for monitoring the screen. If you want the faster operation, use Model 9333 LAN Communicator.
In remote control operation, the keys are displayed, but the screen is not displayed.	Delete Java cache files.	Configure the Java setting from the Control Panel of the computer. For more information, start the application disc supplied with the instrument and open the page of Java (installing JRE), which describes how to delete cache files.

### If the cause is unknown

Perform the system reset. All settings are returned to their factory defaults. Refer to "19.2 Resetting the Instrument" (p. 435).

# **19.2 Resetting the Instrument**

## 19.2.1 Resetting System Settings

Select configured settings on the instrument and reset them to the factory defaults. The Initialization returns the instrument to its factory default state. By default, the various settings (status, channels, and triggers) and the system settings (environment) can be selected to be initialized on this screen.

The program or arbitrary waveform data of Model U8793 Arbitrary Waveform Generator Unit is written in ROM of module. So it will not get erased even is main instrument is reset.

#### Procedure

#### To display the screen

Press the SYSTEM key to display the system screen, and then select the [Init] sheet.

#### **1** Move the cursor to the item you want to reset.

#### 2 Select [On].

Select [Off] for the settings you do not want to reset.

(Status, Ch, Trigger)	Settings on each of the status screens, channel screen, and trigger setting window (Default setting: ON)
(Environment)	Settings on the [Environment] sheet, [File Save] sheet, and [Printer] sheet (Default setting: ON)
(Interface)	Settings on the <b>[Interface]</b> sheet (Default setting: OFF)

3 Sys	stem Reset
1 On	(Status, Ch, Trigger)
<b>2</b> On	(Environment)
Off	(Interface)
_	
No.] —	

#### **3** Move the cursor to [System Reset].

#### **4** Select [Exec].

A confirmation dialog box is displayed.

LWAR Oka	N. ay	l Enabled ?	setting	reset!
F1 F2		YES NO		

#### 5 Select [YES].

#### To cancel the reset action

#### Select [NO].

When the resetting is completed, the message "System initialized" is displayed.

# 19.2.2 Resetting Waveform Data

Discard the waveform data saved in the memory and reset the data.

#### Procedure

#### To display the screen

Press the SYSTEM key to display the system screen, and then select the [Init] sheet.

#### **1** Move the cursor to the [Clear Wave Data] box.

#### **2** Select [Exec].

When the resetting is completed, the message "Waveform data erased." is displayed.

$\left( + \right)$	【Ini	tia	alize】	
	No.	1	Clear Wave Data	
	No.	2	System Reset	

....

. . . . . . .

# **19.3 Error Messages**

If an error is displayed on screen when power supply is switched ON, it is necessary to repair. Contact your authorized Hioki distributor or reseller.

A message is displayed whenever an error occurs. When an error occurs, take the remedial action indicated below.

A beep may sound if the beeper setting on the **[Environment]** sheet is set to **[Warn]** or **[Warn+Action]**. Refer to "15 Setting the System Environment" (p. 335).

#### Warning display



#### Warning messages

Disp No.	Message	Remedy	References	
3	Out of paper.	Load another roll of paper.	"2.4 Loading Recording Paper"	
4	Printer cover is open.	Close the printer cover.	(p. 49)	
5	Recording length is set to Continuous.	When the recording length (Shot) is set to [Cont.] or [On], real- time printing is not available with a fast timebase setting.	"3.3.3 Setting the Recording Length (Number of Divisions)" (p. 66)	
6	Cannot set. (Time/Div 10 ms to 200 ms)	When the recording length (Shot) is set to [Cont.] or [On], the printer cannot be used.		
10	Set the recording media.	Set the storage device.	"2.3 Preparing Storage Devices" (p. 47)	
11	Wrong recording format.	The storage device was formatted in an unsupported format. Format the storage device.	"2.3.2 Formatting Storage Devices" (p. 49)	
12	Cannot write.	The write protection is engaged of the storage device. Disable it.	_	
13	Disk full while accessing the file.	Saving files is not possible because of insufficient space on the storage device. Delete files or change the storage device. If the instrument is performing measurement, stop the measurement, and then change the storage device.	"5.5.4 Deleting Files and Folders" (p. 119)	
14	File is read only.	The file is read-only. Deleting the file is prohibited.	_	
15	Access to the file was denied.	An internal fault may have occurred in the instrument. Cycle the instrument.	_	
16	The file name already exists: cannot save.	Change the file name.	"5.5.6 Renaming Files and Folders" (p. 121)	
17	The folder name already exists.	Change the folder name.		

Disp No.	Message	Remedy	References	
18	Not enough free space in the folder to create file.	Either delete files in the saving destination folder or change the destination to another folder.	_	
19	Folder not empty.	The folder contains files. Be careful not to delete the necessary files.	_	
20	The maximum length of a file name, including its path, is 255 characters.	Reduce the number of characters of the path name including the filename to 255 or less.	_	
21	Internal error.	An internal error occurred. Check the storage device.	-	
22	No waveform data to save.	Acquire waveform data.	_	
24	There is no calculation result.	There is no calculation result. After performing calculation, print the results.	"10 Numerical Calculation Functions" (p. 235)	
25	Cannot select this media.	You cannot select this storage device as a destination of auto- saving. Select another device.	_	
26	Invalid folder path.	The root folder cannot be specified.	_	
27	When executing, select "No" as the save property.	Since other dialogs are displayed, the selective saving cannot be carried out. Either the selective saving during execution to <b>[No]</b> or close the dialog and save data again.	"5.2.3 Saving Data Selectively (SAVE Key)" (p. 103)	
28	Pressed key invalid (waveform evaluation).	Unable to perform the operation because the waveform evaluation is enabled. Set the waveform evaluation set to [Off].	"14.3 Configuring the Waveform Evaluation Setting" (p. 326)	
29	The recording length was restricted.	_	-	
30	Auto-ranging failed.	Check the input signal.	"3.6 Measurement in Automatic Range Setting (Auto-Range Function)" (p. 82)	
31	AB cursor positions invalid.	Cursors A and B are at the same position. Check the cursor positions.	"7.2 Specifying the Waveform Range (Cursors A and B)" (p. 145)	
32	Zero-adjustment needed.	Perform the zero-adjustment.	"2.7 Adjusting the Zero Position (zero-adjustment)" (p. 54)	
33	Disabled key.	Close the dialog.	-	
34	Invalid key pressed (Overlay)	The key operation is prohibited because the overlay is enabled. Set the overlay to [Off].	"8.3 Overlaying New Waveforms With Past Waveforms" (p. 168)	
36	No trigger has been set.	Set the trigger conditions.	"9 Setting the Trigger" (p. 211)	
38	Use of logic channels has reduced analog waveform resolution from 16 to 12 bits.	Using channels LA to LD reduces the resolution of CH1 to CH4 to 12 bits.	"8.10 Setting Details of Modules" (p. 184)	
39	Auto balance failed.	Check if no load is applied to the strain gauge transducer and the strain gauge transducer is correctly connected to a measuring object.	"8.10.4 Setting Model 8969 and U8969 Strain Unit" (p. 188)	

Disp No.	Message	Remedy	References
40	Voltage Sag triggering is disabled. (Valid time base range: 20 µs/div to 50 ms/div)	You can use the voltage sag triggering only when setting the timebase to one between 20 µs/ div and 50 ms/div.	"8.10.4 Setting Model 8969 and U8969 Strain Unit" (p. 188)
41	Channels that are not measurable will be assigned to X-Y.	The channel not specified in the <b>[Used Ch]</b> box is selected. Change the channel selection.	"8.4 Setting Channels to Be Used (Extending the Recording Length)" (p. 170)
42	There is not enough data in the memory.	Measure the necessary amount of data required for the calculation.	"11.1 Waveform Calculation Workflow" (p. 254)
43	Stopped.	_	_
44	Current clamp/sensor was recognized.	-	-
45	Current clamp/sensor was disconnected.	Check the connection of the current clamps and the current sensors.	_
46	Channels may no longer be able to be used by frequency units due to logic channel use.	If LA to LE are used, the frequency units cannot be used at CH1 to CH4.	"3.4.3 Configuring Logic Channel Settings" (p. 76)
47	This module cannot be used because it is not AAF aligned.	Press the <b>SYSTEM</b> key to display the <b>[Init]</b> sheet.	_
48	There are module on which AAF cannot be set to On because of lack of adjustment.	and check the software items. If [Not AAF aligned] is displayed, send the module for repairs.	
50	Roll Mode is not available.	Roll mode cannot be used when the overlay is enabled.	"8.2 Displaying Waveforms During the Writing in the Memory Simultaneously (Roll Mode)" (p. 167)
51	Cannot use. (Pre Trigger)	The pre-trigger function is not available when using the external sampling.	"17 Controlling the Instrument Externally" (p. 369)
52	Cannot use. (Roll Mode, Memory Division)	If the waveform calculation function is in use, these functions cannot be used.	"11.1 Waveform Calculation Workflow" (p. 254)
53	Cannot use. (Roll Mode, Memory Division, Wave Calculation)	If one of the functions is in use, the other functions cannot be used.	"8 Displaying Waveforms During the Writing in the Memory Simultaneously (Roll Mode)" (p. 167)
54	Cannot use. (Overlay)	The overlay function is not available when using the roll mode.	"8.3 Overlaying New Waveforms With Past Waveforms" (p. 168)
55	Cannot use. (Overlay, Memory Division, Wave Calculation)	If roll mode is in use, these functions cannot be used.	"8.2 Displaying Waveforms During the Writing in the Memory Simultaneously (Roll Mode)" (p. 167)
56	Real-time printing is not available.	The recording length (Shot) is set to <b>[Cont.]</b> or <b>[On]</b> . Real-time printing is not available when using the recorder function with a faster timebase setting.	"3.3.3 Setting the Recording Length (Number of Divisions)" (p. 66) "6.2 Setting Auto-printing" (p. 127)

19

439

Disp No.	Message	Remedy	References	
57	Cannot set.(External sampling)	Cannot use roll mode when using the external sampling.	"8.2 Displaying Waveforms During the Writing in the Memory Simultaneously (Roll Mode)" (p. 167)	
58	Rated capacity/rated output error.	The value calculated from the rated capacity and rated output exceed the selected range. Input correct values.	(p. 175)	
59	Cannot use. (Roll Mode, Wave Calculation)	If the memory division function is in use, these functions cannot be used.	"12.1 Configuring the Recording Settings" (p. 269)	
60	No waveform data.	Acquire waveform data.	_	
65	Dot interpolation may takes place for sampling speed 1 ms/S.	Set the sampling rate to 1 ms/S or longer.	"4.2 Setting Measurement Conditions" (p. 87)	
68	Recording length is too long.	Shorten the measurement recording length. The maximum recording length that can be calculated is given below: Model MR8847-51: 10,000 div Model MR8847-52: 40,000 div Model MR8847-53: 80,000 div	"3.3.3 Setting the Recording Length (Number of Divisions)" (p. 66)	
80	In key lock.	The key lock function is engaged. Disengage the key lock function.	19KEY LOCKKEY LOCK19KEY LOCK	
91	LAN: Bad IP address.	Check the IP address.	"16.1 Setting LAN and	
95	LAN: Connection timed out.	Check the transmission settings.	Connecting the Instrument to the LAN Network (Before Using	
97	LAN: Network error.	Check the connection between the instrument and connection destination.	FTP/Internet Browser/Command Communications)" (p. 342)	
100	Inappropriate setting of time axis for waveform data.	Set the timebase to the setting with which the waveform was measured.	"3.3.2 Timebase and Sampling Rate" (p. 62) "9.11 Searching the Measured	
101	Some blocks are different in time axis setting from the others.	Set the same timebase setting for all search target blocks. If they cannot be the same, set the search range to the displayed blocks only.	(p. 233)	
102	Some blocks are different in modules configuration from the others.	Unify the modules configuration of the search target blocks. If they cannot be the same, set the search range to the displayed blocks only.	"9.11 Searching the Measured Data Using the Trigger Settings" (p. 233)	
103	No data matching your search condition.	Check the trigger setting.		
104	There is no data in the search target channel.	Select the channels including measured data as the search target.		
105	There is a block including no data in the search target channel.	Select the blocks including measured data as the search target.		
106	Some blocks are different in measurement mode of modules from the others.	Blocks created with different measurement modes cannot be searched.	_	

Disp No.	Message	Remedy	References
108	Some blocks are different in measurement mode of modules from the others.	Set the search range to the displayed blocks.	"9.11 Searching the Measured Data Using the Trigger Settings" (p. 233)
110	No space to store waveform data at copy location.	Create empty space by deleting the waveform data from the copy location.	(p. 206)
111	No space to register arbitrary waveform data.	Create empty space by deleting waveform data from registration location.	(p. 206)

# 19.4 Self-Test (Self-Diagnostics)

The following self-test checks are available.

#### Procedure

#### To display the screen

Press the **SYSTEM** key to display the system screen, and then select the **[Init]** sheet.



## 19.4.1 ROM/RAM Check

This check tests the instrument's internal memory (ROM and RAM).

Performing the ROM/RAM check erases measured data. Save the measured data to another storage device before performing the ROM/RAM check.

#### **1** Move the cursor to the [ROM/RAM Check] box.

#### 2 Select [Exec].

The ROM/RAM check is started.

The following checks are performed in the following order: Program ROM, Address bus, Backup RAM, Work RAM, Video RAM, and Storage RAM

#### Do not turn off the instrument during the check.

#### To cancel the check,

#### Press the STOP key.

The present check is interrupted, and the next one starts. All operation keys (except **STOP** key) are disabled.

The judgment results are displayed when the checks finish. OK: Normal NG: Error ABORT: When the check is interrupted

# If the message "NG" is displayed, send the instrument for repair.

Press any key to return to the previous screen.



#### Procedure (Common to printer check, display check, key check, system configuration check)

#### To display the screen

Press the **SYSTEM** key to display the system screen, and then select the **[Init]** sheet.

## **19.4.2 Printer Check**

This check tests the condition of the printer. Before executing the printer check, check that the recording paper is loaded.

#### **1** Move the cursor to the [Printer Check] box.

#### **2** Select [Exec].

The test pattern is printed.

Approximately 5 cm of each of the following patterns is printed in the following order: Checkerboard, vertical lines, slanted lines, and characters.

#### To cancel the check

Press the STOP key.

## 19.4.3 Display Check

This check tests the condition of the display screen.

**1** Move the cursor to the [Display Check] box.

**2** Select [Exec].

The screen becomes uniformly red.

# **3** Press any key to check the display condition.

The screen changes each time you press an operation key.

Pressing any key repeatedly to return to the previous screen.

#### After the printer check

Check the printed recording paper for white streaks. If there are any white streaks, clean the print head. (p. 446)

The print quality (print speed) and print density settings is reflected in the test printout.

#### Screen changing order

Color check (Red, Green, Blue, Black, White)  $\rightarrow$  Gradation check (Red, Green, Blue, Black, White)  $\rightarrow$  Color pattern  $\rightarrow$  Original screen.

If the display screen seems abnormal, send the instrument for repair.

# 19.4.4 Key Check

This check tests the keys, jog dial, and shuttle ring for proper operation.

- **1** Move the cursor to the [Key Check] box.
- **2** Select [Exec].

Operation keys are displayed.

**3** Press each operation key once or several times.

The corresponding key is highlighted.

Jog dial: Turn it clockwise and counterclockwise, one or several revolutions each.

Shuttle ring: Turn slowly clockwise and counterclockwise all the way each.

(The **START** key check also functions as the LED check.)

Operating all of the keys completes the check.

To cancel the check Press the START and STOP keys simultaneously.

Pressing any key repeatedly to return to the previous screen.

## 19.4.5 System Configuration Check

The list of installed options and other system information is displayed on the separate window.

**1** Move the cursor to the [System Information] box.

The key check will not finish if there is a problem that prevents even one of the keys from being recognized. If this occurs, press the **STOP** and **START** keys simultaneously to display the previous screen. There may be a malfunction in the instrument. Send the instrument for

If there is a problem with the **STOP** or **START** key, you cannot return to the previous screen. Turn off the instrument. Send it for repair.

repair.



The **[System Information]** list is displayed. **To return to the previous screen Press any key.** 

[MR8	847A MEMO	Sys NRY HiCOR	tem Information .DER]			
Ch	Model	Name	Resolution	Sampling	Firmware	
Ch1	8966	ANALOG	12-bit	20MS/s		
Ch2	8966	ANALOG	12-bit	20MS/s		
Ch3	8967	TEMP	16-bit		1.00	
Ch4	8967	TEMP	16-bit		1.00	
Ch5	8968	HIGH RES	16-bit	1MS/s		
Ch6	8968	HIGH RES	16-bit	1MS/s		
Ch7	8969	STRAIN	16-bit	200kS/s		
Ch8	8969	STRAIN	16-bit	200kS/s		
Ch9	8971	CURRENT	12-bit	1MS/s		resolution, sampling
Ch10	8971	CURRENT	12-bit	1MS/s		rate, and firmware
Ch11	MR8990	DVM	24-bit		1.03	version no. of each
Ch12	MR8990	DVM	24-bit		1.03	installed module (unit)
Ch13	U8974	HI VOLT	16-bit			
Ch14	U8974	HI VOLT	16-bit			
Ch15	U8793	ARB-GEN			1.00	
Ch16	U8793	ARB-GEN			1.00	Firmware version no.
Storag	e RAM: : 512M	Word — Ei	mware Version :	V5.00		
Printe	er : Exis	ts Boa	ard Revision:	0000		Board revision no
HDD	: Equi	oped [FF	GA Version]			Doard revision no.
ECommu	nication]		Storage Version:	0300:0105		
Interf	ace : LAN ·		0 Version:	0200		EPCA version no
		L	.CDC Version:	0103		TT GA VEISION NO.
					PUSH ANT KET	1
	Presently se	elected Intern	al memory			
	Interface	capad	city			

19

# **19.5 Cleaning the instrument**

## Cleaning the print head

# 



The print head and surrounding metal parts can become hot. Perform cleaning only after making sure that the parts have cooled fully. Be careful to avoid touching these parts.

Normally, no maintenance is required. However, depending on usage conditions, dirt and paper dust may accumulate on the thermal head over long periods, which can cause light or smeared printing. In this case, clean the head by following the procedure below.

#### Checking the print head

#### Before cleaning the print head

The recording paper is required to clean the print head. Check that the recording paper is loaded properly.

- **1** Press the SYSTEM key to display the [Init] sheet.
- **2** Move the cursor to the [Printer Check] box.
- **3** Select [Exec].

If the printing is blurred, clean the print head.

Executing **[Cleaning]** remove the paper dust readily. If sufficient improvement is not obtained even after cleaning the print head several times, cleaning the print head is required.



#### To clean the print head

Required items: Undiluted alcohol, cotton swab

**1** Moisten the end of the cotton swab with undiluted alcohol.

Be careful not to apply too much undiluted alcohol.

2 Open the head cover and wipe the print head with the tip of the cotton swab.



#### About the print head

Note the following precautions to avoid discoloration or deformation.

- Do not use organic solvents such as thinner or benzene.
- After washing, be certain that the printer is completely dry before use.

#### About the roller surface

- White powder such as paper dust may accumulate on the roller surface after long-term use. A small amount of the dust should have no effect on printing; however, you can remove it with a commercially available camera blower brush if it causes concern.
- Always use the paper cutter to cut the printed paper. Excessive paper dust can accumulate on the roller if the paper is cut with the print head.

#### To clean the instrument and modules



Clean the vents periodically to avoid blockage. If the vents become clogged, the instrument's internal cooling will be impeded, which may result in damage.

**ACAUTION** 

- To clean the instrument and modules, wipe it gently with a soft cloth moistened with water or mild detergent.
- Wipe the LCD gently with a soft, dry cloth.

# 19.6 Disposing of the Instrument (Removing Lithium Battery)

The instrument contains the lithium battery for memory backup. Remove this battery before disposing of the instrument.

# 

• To avoid electric shock, turn off the power and disconnect the power cord and connection cables before removing the lithium battery.

• Keep batteries away from children to prevent accidental swallowing.



Do not short-circuit, recharge, disassemble or dispose of in fire. The battery may explode if mistreated.

When disposing of this instrument, remove the lithium battery and dispose of battery and instrument in accordance with local regulations.

#### CALIFORNIA, USA ONLY

Perchlorate Material - special handling may apply. See www.dtsc.ca.gov/hazardouswaste/perchlorate

## Removing the lithium battery

Required items:

Flat-blade screwdriver, Phillips screwdriver, nippers, box-end wrench, and needle-nose pliers (one each)

- **1** Ensure that the instrument is turned off, and then remove the connection cables and power cord.
- 2 Remove screws and each part in following shown sequence.



- **3** Pull the lithium battery up from the circuit board, and cut the two leads, positive and negative, with the nippers.
- **4** Remove the battery from the board.

19

Disposing of the Instrument (Removing Lithium Battery)

# Appendix

# Appx. 1 Default Values for Major Settings

Screen	Sheet/ Window	Items	Settings
Status	Status	Timebase (Memory)	5 µs/div
		Timebase (Recorder)	10 ms/div
		Sampling (X-Y recorder)	100 ms/S
		Recording length	25 div
		Format (Memory/Recorder)	Single
		Format (X-Y recorder)	X-Y Single
		Roll Mode (Memory)	Auto
		Used Ch (Memory)	Ch 1-16 ch
		Dots-Line (X-Y recorder)	Line
	Num Calc.	Numerical Calc	OFF
System	Environment	Grid Type	Dotted Line
		Time Value	Time
		Beep Sound	Warning
		Auto Scale	ON
	File Save	Auto Save	OFF
	Printer:	Auto print	OFF
		Grid Type	Normal
		Ch Mark	Ch No.
		Time Value	Time
		Mag/Comp	Same to display
		Copy GUI	Yes
		Print Area	All Wave
	Interface	Interface	LAN
		USB setting	USB Memory
Channel	Unit List	Wave_Disp (analog)	Color 1 to 16
		Wave Density	Standard
		Wave_Disp (Logic)	OFF
		Logic Width	Normal
		Range	Highest sensitivity
		Coupling	DC
	Scaling	Setting method	Ratio
		Each channel	OFF
	Comment	Print Comment (Title)	Setting
		Print Comment (Analog)	Setting
		Print Comment (Logic)	OFF
Wave	Trigger settings window	Trigger Mode (Memory)	Auto
		Trigger Mode (Recorder)	Single
		Pre Trigger (Memory)	0%
		Trigger source	OR
		Timing	Start
		Trigger for each module	OFF
		Timer Trigger	OFF
		External Trigger	OFF

# Appx. 2 For Reference

## Appx. 2.1 Waveform File sizes

#### References

File type	Function	Size	Calculation meth- od
MEM file	Memory function	(p. Appx.2)	(p. Appx.4)
REC file	Recorder function	(p. Appx.2)	(p. Appx.4)
FFT file	FFT function	(p. Appx.3)	(p. Appx.4)
XYC file	X-Y recorder function	(p. Appx.3)	(p. Appx.4)
CSV (Text) file	Memory function	(p. Appx.3)	(p. Appx.5)
	Recorder function	(p. Appx.4)	(p. Appx.5)

. . . . . . .

## References of the file size

## MEM file size (Memory function)

(File size) = (Setting size) + (Data size) Calculation method: "MEM file" (p. Appx.4)

Recording	Data count	Number of saved channels					
length (div)	gth (div)		2	4	8	16	32
100	10,001	43 KB	63 KB	103 KB	183 KB	344 KB	649 KB
1,000	100,001	219 KB	415 KB	806 KB	1.6 MB	3.0 MB	6.2 MB
10,000	1,000,001	1.9 MB	3.8 MB	7.7 MB	15 MB	31 MB	62 MB
100,000	10,000,001	19 MB	38 MB	76 MB	152 MB	305 MB	611 MB
1,000,000	100,000,001	191 MB	381 MB	762 MB	_	_	_

## REC file size (Recorder function)

(File size) = (Setting size) + (Data size)
Calculation method: "REC file" (p. Appx.4)

Recording	Dete count	Number of saved channels					
length (div)	Data count	1	2	4	8	16	32
100	10,001	63 KB	102 KB	181 KB	340 KB	656 KB	1.3 MB
1,000	100,001	414 KB	805 KB	1.6 MB	3.1 MB	6.1 MB	12 MB
10,000	1,000,001	3.8 MB	7.7 MB	15 MB	31 MB	61 MB	122 MB
20,000	2,000,001	7.7 MB	15 MB	31 MB	61 MB	122 MB	244 MB
100,000	10,000,001	38 MB	76 MB	152 MB	305 MB	610 MB	_

## FFT file size (FFT function)

(File size) = (Header size) + (Size of time axis data) + (Size of mid-term data) Calculation method: "FFT file" (p. Appx.4)

Number of pieces	Number of calculations				
of data	1	2			
1,000	360 KB	694 KB			
2,000	692 KB	1.3 MB			
5,000	1.6 MB	3.3 MB			
10,000	3.3 MB	6.5 MB			

## XYC file size (X-Y recorder function)

(File size) = (Setting size) + (Data size) Calculation method: "XYC file" (p. Appx.4)

Number of piec-		Number of saved channels						
es of data	1	2	4	8	16	32		
10,000	44 KB	64 KB	104 KB	184 KB	345 KB	650 KB		
100,000	220 KB	416 KB	807 KB	1.6 MB	3.1 MB	6.2 MB		
1,000,000	1.9 MB	3.9 MB	7.7 MB	15 MB	31 MB	62 MB		
2,000,000	3.8 MB	7.7 MB	15 MB	31 MB	61 MB	123 MB		

## CSV (Text) file size (Memory function)

#### File size = header size + data size

Calculation method: "CSV (Text) file" (p. Appx.5)

Recording	Number of piec-	Number of saved channels					
length (div)	es of data	1	2	4	8	16	32
100	10,001	313 KB	450 KB	723 KB	1.2 MB	2.3 MB	4.5 MB
1,000	100,001	3.1 MB	4.4 MB	7.1 MB	12 MB	23 MB	45 MB
10,000	1,000,001	31 MB	44 MB	71 MB	124 MB	231 MB	445 MB
100,000	10,000,001	305 MB	439 MB	706 MB	1.1 GB	2.1 GB	4.3 GB
1,000,000	100,000,001	3.1 GB	4.4 GB	7.1 GB	_	_	_

## CSV (Text) file size (Recorder function)

File size = header size + data size

Calculation method: "Recorder function" (p. Appx.5)

When saving, a CSV (text) file the size of which exceeds 2 GB is divided into multiple files with a size of 2 GB each.

Recording	Number of piec-	C- Number of saved channels					
length	es of data	1	2	4	8	16	32
100	10,001	450 KB	723 KB	1.2 MB	2.3 MB	4.4 MB	8.8 MB
1,000	100,001	4.4 MB	7.1 MB	12 MB	23 MB	44 MB	87 MB
10,000	1,000,001	44 MB	71 MB	124 MB	231 MB	444 MB	872 MB
20,000	2,000,001	88 MB	141 MB	248 MB	432 MB	889 MB	1.7 GB
100,000	10,000,001	391 MB	619 MB	1.1 GB	1.9 GB	3.7 GB	_

#### Calculation method of waveform file size

#### **MEM** file

(File size [bytes]) = (Setting size<sup>\*1</sup>) + (Data size<sup>\*2</sup>)

\*1: (Setting size) =  $23552 + 512 \times [(Number of analog channels) + 4 \times (Number of logic units) + (Number of waveform calculation channels)]$ 

\*2: (Data size) = 2 × [(Number of analog channels) + (Number of logic units) + 2 × (Number of waveform calculation channels)] × (Number of data)

#### **REC file**

(File size [bytes]) = (Setting size<sup>\*1</sup>) + (Data size<sup>\*2</sup>)

\*1: (Setting size) = 23552 + 512 × [(Number of analog channels) + 4 × (Number of logic units)]

\*2: (Data size) = 4 × [(Number of analog channels) + (Number of logic units)] × (Number of data)

#### FFT file

(File size [bytes]) = (Header size<sup>\*1</sup>) +(Size of time axis data<sup>\*2</sup>) + (Size of mid-term data<sup>\*3</sup>) \*1: (Header size) = 25600 + 512 × [(Number of analog channels) + (Number of waveform calculation channels) +

(Number of FFT calculation channels) + 1]

\*2: (Size of time axis data) = [(Number of analog channels) + 2 × (Number of waveform calculation channels)] × (Number of data) (\*4)

\*3: (Size of mid-term data) = [346 × (Number of FFT points) + 836] × (Number of FFT calculation channels) (\*4) (The file size may also increase or decrease from the calculation formula results depending on the measurement conditions.)

#### **XYC** file

(File size [bytes]) = (Header size<sup>\*1</sup>) + (Data size<sup>\*2</sup>)

\*1: (Header size) = 24576 + 512 × (Number of analog channels)

\*2: (Data size) = 2 × (Number of saved analog channels) × (Number of data)

#### CSV (Text) file

#### **Memory function**

(File size [bytes]) = (Header size<sup>\*1</sup>) + (Data size<sup>\*2</sup>) \*1: (Header size) = 194 + 103 × [(Number of saved analog channels) + (Number of saved logic channels)] \*2: (Data size) = [18 + 14 × (Number of saved analog channels) + 2 × (Number of logic channels)] × (Number of data)

#### **Recorder function**

#### (File size [bytes]) = (Header size<sup>\*1</sup>) + (Data size<sup>\*2</sup>)

\*1: (Header size) = 194 + 130 × [(Number of saved analog channels) + (Number of saved logic channels)]
\*2: (Data size) = [18 + 28 × (Number of saved analog channels) + 4 × (Number of logic channels)] × (Number of data)

## Appx. 2.2 Files Size of Setting and Image Files

File	Size
Setting file	33 KB
BMP (Not color-compressed)	470 KB
BMP (Gray scale, not compressed)	470 KB
BMP (B/W, not compressed)	59 KB
BMP (B/W reverse, not compressed)	59 KB

# Appx. 2.3 Timebase and Maximum Recordable Time

The maximum available recording time varied depending on the selected timebase. The maximum recording time can be obtained by the following formula.

(Recordable Time) = Timebase ×	You can check the recordable time on the [Status]
(Recording length)	sheet of the status screen. ([Recording period])

- Setting a slower timebase may result in an excessively long recording time (over a year) that exceeds the guarantee period or product life, in which case we cannot guarantee operation.
- When using the memory function, the maximum recording length varies depending on the number of used channels.
- When using the X-Y recorder function, the maximum number of samples is 4,000,000 (if using the U8975, U8977, or U8978: 2,000,000).

## **Recorder function**

Timebase/div	Model MR8847-51 Maximum recording length: 20,000 div*	Model MR8847-52 Maximum recording length: 80,000 div*	Model MR8847-53 Maximum recording length: 160,000 div*
10 ms	3 min 20 s	13 min 20 s	26 min 40 s
20 ms	6 min 40 s	26 min 40 s	53 min 20 s
50 ms	16 min 40 s	1 h 6 min 40 s	2 h 13 min 20 s
100 ms	33 min 20 s	2 h 13 min 20 s	4 h 26 min 40 s
200 ms	1 h 6 min 40 s	4 h 26 min 40 s	8 h 53 min 20 s
500 ms	2 h 46 min 40 s	11 h 6 min 40 s	22 h 13 min 20 s
1 s	5 h 33 min 20 s	22 h 13 min 20 s	1 d 20 h 26 min 40 s
2 s	11 h 6 min 40 s	1 d 20 h 26 min 40 s	3 d 16 h 53 min 20 s
5 s	1 d 3 h 46 min 40 s	4 d 15 h 6 min 40 s	9 d 6 h 13 min 20 s
10 s	2 d 7 h 33 min 20 s	9 d 6 h 13 min 20 s	18 d 12 h 26 min 40 s
30 s	6 d 22 h 40 min 0 s	27 d 18 h 40 min 0 s	55 d 13 h 20 min 0 s
50 s	11 d 13 h 46 min 40 s	46 d 7 h 6 min 40 s	92 d 14 h 13 min 20 s
1 min	13 d 21 h 20 min 0 s	55 d 13 h 20 min 0 s	111 d 2 h 40 min 0 s
100 s	23 d 3 h 33 min 20 s	92 d 14 h 13 min 20 s	185 d 4 h 26 min 40 s
2 min	27 d 18 h 40 min 0 s	111 d 2 h 40 min 0 s	222 d 5 h 20 min 0 s
5 min	69 d 10 h 40 min 0 s	277 d 18 h 40 min 0 s	
10 min	138 d 21 h 20 min 0 s		
30 min			
1 h			

(d: days, h: hours, min: minutes, s: seconds)

\* Even when the recording length is set to [Cont.], the maximum recording length does not change.

## If using the U8975, U8977, or U8978

Timebase/div	MR8847-51 Maximum recording length: 10,000 div*	MR8847-52 Maximum recording length: 40,000 div*	MR8847-53 Maximum recording length: 80,000 div*
10 ms	1 min 40 s	6 min 40 s	13 min 20 s
20 ms	3 min 20 s	13 min 20 s	26 min 40 s
50 ms	8 min 20 s	33 min 20 s	1h 6 min 40 s
100 ms	16 min 40 s	1h 6 min 40 s	2h 13 min 20 s
200 ms	33 min 20 s	2h 13 min 20 s	4h 26 min 40 s
500 ms	1 h 23 min 20 s	5h 33 min 20 s	11h 6 min 40 s
1 s	2h 46 min 40 s	11h 6 min 40 s	22h 13 min 20 s
2 s	5h 33 min 20 s	22h 13 min 20 s	1d 20h 26 min 40 s
5 s	13h 53 min 20 s	2d 7h 3 min 20 s	4d 15h 6 min 40 s
10 s	1d 3h 46 min 40 s	4d 15h 6 min 40 s	9d 6h 13 min 20 s
30 s	3d 11h 20 min 00 s	13d 21h 20 min 00 s	27d 18h 40 min 00 s
50 s	5d 18h 53 min 20 s	23d 3h 33 min 20 s	46 d 7 h 06 min 40 s
1 min	6d 22h 40 min 00 s	27 d 18 h 40 min 00 s	55 d 13 h 20 min 00 s
100 s	11d 13h 46 min 40 s	46 d 7 h 06 min 40 s	92 d 14 h 13 min 20 s
2 min	13d 21h 20 min 00 s	55 d 13 h 20 min 00 s	111 d 2 h 40 min 00 s
5 min	34 d 17 h 20 min 00 s	138 d 21 h 20 min 00 s	277 d 18 h 40 min 00 s
10 min	69 d 10 h 40 min 00	277 d 18 h 40 min 00 s	
30 min	208 d 8 h 00 min 00 s		
1 h			



For Model MR8847-51 (Total memory: 64 MW)

Time-	Sampling	Number of used channels Maximum recording length						
base/	rate	32 channels	16 channels	8 channels	4 channels	2 channels		
uiv		20,000 div	40,000 div	80,000 div	160,000 div	320,000 div		
5 µs	50 ns	0.1 s	0.2 s	0.4 s	0.8 s	1.6 s		
10 µs	100 ns	0.2 s	0.4 s	0.8 s	1.6 s	3.2 s		
20 µs	200 ns	0.4 s	8 s	1.6 s	3.2 s	6.4 s		
50 µs	500 ns	8 s	2 s	4 s	8 s	16 s		
100 µs	1 µs	2 s	4 s	8 s	16 s	32 s		
200 µs	2 µs	4 s	8 s	16 s	32 s	1 min 4 s		
500 µs	5 µs	10 s	20 s	40 s	1 min 20 s	2 min 40 s		
1 ms	10 µs	20 s	40 s	1 min 20 s	2 min 40 s	5 min 20 s		
2 ms	20 µs	40 s	1 min 20 s	2 min 40 s	5 min 20 s	10 min 40 s		
5 ms	50 µs	1 min 40 s	3 min 20 s	6 min 40 s	13 min 20 s	26 min 40 s		
10 ms	100 µs	3 min 20 s	6 min 40 s	13 min 20 s	26 min 40 s	53 min 20 s		
20 ms	200 µs	6 min 40 s	13 min 20 s	26 min 40 s	53 min 20 s	1 h 46 min 40 s		
50 ms	500 µs	16 min 40 s	33 min 20 s	1 h 6 min 40 s	2 h 13 min 20 s	4 h 26 min 40 s		
100 ms	1 ms	33 min 20 s	1 h 6 min 40 s	2 h 13 min 20 s	4 h 26 min 40 s	8 h 53 min 20 s		
200 ms	2 ms	1 h 6 min 40 s	2 h 13 min 20 s	4 h 26 min 40 s	8 h 53 min 20 s	17 h 46 min 40 s		
500 ms	5 ms	2 h 46 min 40 s	5 h 33 min 20 s	11 h 6 min 40 s	22 h 13 min 20 s	1 d 20 h 26 min 40 s		
1 s	10 ms	5 h 33 min 20 s	11 h 6 min 40 s	22 h 13 min 20 s	1 d 20 h 26 min 40 s	3 d 16 h 53 min 20 s		
2 s	20 ms	11 h 6 min 40 s	22 h 13 min 20 s	1 d 20 h 26 min 40 s	3 d 16 h 53 min 20 s	7 d 9 h 46 min 40 s		
5 s	50 ms	1 d 3 h 46 min 40 s	2 d 7 h 33 min 20 s	4 d 15 h 6 min 40 s	9 d 6 h 13 min 20 s	18 d 12 h 26 min 40 s		
10 s	100 ms	2 d 7 h 33 min 20 s	4 d 15 h 6 min 40 s	9 d 6 h 13 min 20 s	18 d 12 h 26 min 40 s	37 d 0 h 53 min 20 s		
30 s	300 ms	4 d 15 h 6 min 40 s	13 d 21 h 20 min 0 s	27 d 18 h 40 min 0 s	55 d 13 h 20 min 0 s	111 d 2 h 40 min 0 s		
50 s	500 ms	11 d 13 h 46 min 40 s	23 d 3 h 33 min 20 s	46 d 7 h 6 min 40 s	92 d 14 h 13 min 20 s	185 d 4 h 26 min 40 s		
1 min	600 ms	13 d 21 h 20 min 0 s	27 d 18 h 40 min 0 s	55 d 13 h 20 min 0 s	111 d 2 h 40 min 0 s	222 d 5 h 20 min 0 s		
100 s	1 s	23 d 3 h 33 min 20 s	46 d 7 h 6 min 40 s	92 d 14 h 13 min 20 s	185 d 4 h 26 min 40 s			
2 min	1.2 s	27 d 18 h 40 min 0 s	55 d 13 h 20 min 0 s	111 d 2 h 40 min 0 s	222 d 5 h 20 min 0 s			
5 min	3 s	69 d 10 h 40 min 0 s	138 d 21 h 20 min 0 s	277 d 18 h 40 min 0 s				

Time- base/ div	Sampling rate	Number of used channels Maximum recording length					
		32 channels	16 channels	8 channels	4 channels	2 channels	
		80,000 div	160,000 div	320,000 div	640,000 div	1,280,000 div	
5 µs	50 ns	0.4 s	0.8 s	1.6 s	3.2 s	6.4 s	
10 µs	100 ns	0.8 s	1.6 s	3.2 s	6.4 s	12.8 s	
20 µs	200 ns	1.6 s	3.2 s	6.4 s	12.8 s	25.6 s	
50 µs	500 ns	4 s	8 s	16 s	32 s	1 min 4 s	
100 µs	1 µs	8 s	16 s	32 s	1 min 4 s	2 min 8 s	
200 µs	2 µs	16 s	32 s	1 min 4 s	2 min 8 s	4 min 16 s	
500 µs	5 µs	40 s	1 min 20 s	2 min 40 s	5 min 20 s	10 min 40 s	
1 ms	10 µs	1 min 20 s	2 min 40 s	5 min 20 s	10 min 40 s	21 min 20 s	
2 ms	20 µs	2 min 40 s	5 min 20 s	10 min 40 s	21 min 20 s	42 min 40 s	
5 ms	50 µs	6 min 40 s	13 min 20 s	26 min 40 s	53 min 20 s	1 h 46 min 40 s	
10 ms	100 µs	13 min 20 s	26 min 40 s	53 min 20 s	1 h 46 min 40 s	3 h 33 min 20 s	
20 ms	200 µs	26 min 40 s	53 min 20 s	1 h 46 min 40 s	3 h 33 min 20 s	7 h 6 min 40 s	
50 ms	500 µs	1 h 6 min 40 s	2 h 13 min 20 s	4 h 26 min 40 s	8 h 53 min 20 s	17 h 46 min 40 s	
100 ms	1 ms	2 h 13 min 20 s	4 h 26 min 40 s	8 h 53 min 20 s	17 h 46 min 40 s	1 d 11 h 33 min 20 s	
200 ms	2 ms	4 h 26 min 40 s	8 h 53 min 20 s	17 h 46 min 40 s	1 d 11 h 33 min 20 s	2 d 23 h 6 min 40 s	
500 ms	5 ms	11 h 6 min 40 s	22 h 13 min 20 s	1 d 20 h 26 min 40 s	3 d 16 h 53 min 20 s	7 d 9 h 46 min 40 s	
1 s	10 ms	22 h 13 min 20 s	1 d 20 h 26 min 40 s	3 d 16 h 53 min 20 s	7 d 9 h 46 min 40 s	14 d 19 h 33 min 20 s	
2 s	20 ms	1 d 20 h 26 min 40 s	3 d 16 h 53 min 20 s	7 d 9 h 46 min 40 s	14 d 19 h 33 min 20 s	29 d 15 h 6 min 40 s	
5 s	50 ms	4 d 15 h 6 min 40 s	9 d 6 h 13 min 20 s	18 d 12 h 26 min 40 s	37 d 0 h 53 min 20 s	74 d 1 h 46 min 40 s	
10 s	100 ms	9 d 6 h 13 min 20 s	18 d 12 h 26 min 40 s	37 d 0 h 53 min 20 s	74 d 1 h 46 min 40 s	148 d 3 h 33 min 20 s	
30 s	300 ms	27 d 18 h 40 min 0 s	55 d 13 h 20 min 0 s	111 d 2 h 40 min 0 s	222 d 5 h 20 min 0 s		
50 s	500 ms	46 d 7 h 6 min 40 s	92 d 14 h 13 min 20 s	185 d 4 h 26 min 40 s			
1 min	600 ms	55 d 13 h 20 min 0 s	111 d 2 h 40 min 0 s	222 d 5 h 20 min 0 s			
100 s	1 s	92 d 14 h 13 min 20 s	185 d 4 h 26 min 40 s				
2 min	1.2 s	111 d 2 h 40 min 0 s	222 d 5 h 20 min 0 s				
5 min	3 s	277 d 18 h 40 min 0 s					

## For Model MR8847-52 (Total memory: 256 MW)

Time- base/ div	Sampling rate	Number of used channels Maximum recording length						
		32 channels	16 channels	8 channels	4 channels	2 channels		
		160,000 div	320,000 div	640,000 div	1,280,000 div	2,560,000 div		
5 µs	50 ns	0.8 s	1.6 s	3.2 s	6.4 s	12.8 s		
10 µs	100 ns	1.6 s	3.2 s	6.4 s	12.8 s	25.6 s		
20 µs	200 ns	3.2 s	6.4 s	12.8 s	25.6 s	51.2 s		
50 µs	500 ns	8 s	16 s	32 s	1 min 4 s	2 min 8 s		
100 µs	1 µs	16 s	32 s	1 min 4 s	2 min 8 s	4 min 16 s		
200 µs	2 µs	32 s	1 min 4 s	2 min 8 s	4 min 16 s	8 min 32 s		
500 µs	5 µs	1 min 20 s	2 min 40 s	5 min 20 s	10 min 40 s	21 min 20 s		
1 ms	10 µs	2 min 40 s	5 min 20 s	10 min 40 s	21 min 20 s	42 min 40 s		
2 ms	20 µs	5 min 20 s	10 min 40 s	21 min 20 s	42 min 40 s	1 h 25 min 20 s		
5 ms	50 µs	13 min 20 s	26 min 40 s	53 min 20 s	1 h 46 min 40 s	3 h 33 min 20 s		
10 ms	100 µs	26 min 40 s	53 min 20 s	1 h 46 min 40 s	3 h 33 min 20 s	7 h 6 min 40 s		
20 ms	200 µs	53 min 20 s	1 h 46 min 40 s	3 h 33 min 20 s	7 h 6 min 40 s	14 h 13 min 20 s		
50 ms	500 µs	2 h 13 min 20 s	4 h 26 min 40 s	8 h 53 min 20 s	17 h 46 min 40 s	35 h 33 min 20 s		
100 ms	1 ms	4 h 26 min 40 s	8 h 53 min 20 s	17 h 46 min 40 s	1 d 11 h 33 min 20 s	2 d 23 h 6 min 40 s		
200 ms	2 ms	8 h 53 min 20 s	17 h 46 min 40 s	1 d 11 h 33 min 20 s	2 d 23 h 6 min 40 s	5 d 22 h 13 min 20 s		
500 ms	5 ms	22 h 13 min 20 s	1 d 20 h 26 min 40 s	3 d 16 h 53 min 20 s	7 d 9 h 46 min 40 s	14 d 19 h 33 min 20 s		
1 s	10 ms	1 d 20 h 26 min 40 s	3 d 16 h 53 min 20 s	7 d 9 h 46 min 40 s	14 d 19 h 33 min 20 s	29 d 15 h 6 min 40 s		
2 s	20 ms	3 d 16 h 53 min 20 s	7 d 9 h 46 min 40 s	14 d 19 h 33 min 20 s	29 d 15 h 6 min 40 s	59 d 6 h 13 min 20 s		
5 s	50 ms	9 d 6 h 13 min 20 s	18 d 12 h 26 min 40 s	37 d 0 h 53 min 20 s	74 d 1 h 46 min 40 s	148 d 3 h 33 min 20 s		
10 s	100 ms	18 d 12 h 26 min 40 s	37 d 0 h 53 min 20 s	74 d 1 h 46 min 40 s	148 d 3 h 33 min 20 s	296 d 7 h 6 min 40 s		
30 s	300 ms	55 d 13 h 20 min 0 s	111 d 2 h 40 min 0 s	222 d 5 h 20 min 0 s				
50 s	500 ms	92 d 14 h 13 min 20 s	185 d 4 h 26 min 40 s					
1 min	600 ms	111 d 2 h 40 min 0 s	222 d 5 h 20 min 0 s					
100 s	1 s	185 d 4 h 26 min 40 s						
2 min	1.2 s							
5 min	3 s							

## For Model MR8847-53 (Total memory: 512 MW)
### Appx. 2.4 Maximum Recording Length and Number of Divisions (Memory Division Function)

The maximum recording length is automatically determined when you set the number of the used channels and number of divisions.

#### Freely specified recording length

For Model MR8847-51 (Total memory: 64 MW)

The number of	Number of used channels					
divisions	1 to 2 channels	1 to 4 channels	1 to 8 channels	1 to 16 channels	1 to 32 channels	
(blocks)		Maxim	um recording leng	th (div)		
2	160,000	80,000	40,000	20,000	10,000	
4	80,000	40,000	20,000	10,000	5,000	
8	40,000	20,000	10,000	5,000	2,500	
16	20,000	10,000	5,000	2,500	1,200	
32	10,000	5,000	2,500	1,200	600	
64	5,000	2,500	1,200	600	300	
128	2,500	1,200	600	300	150	
256	1,200	600	300	150	70	
512	600	300	150	70	30	
1024	300	150	70	30	-	

#### For Model MR8847-52 (Total memory: 256 MW)

The number of	Number of used channels				
divisions	1 to 2 channels	1 to 4 channels	1 to 8 channels	1 to 16 channels	1 to 32 channels
(blocks)		Maxim	um recording leng	th (div)	
2	640,000	320,000	160,000	80,000	40,000
4	320,000	160,000	80,000	40,000	20,000
8	160,000	80,000	40,000	20,000	10,000
16	80,000	40,000	20,000	10,000	5,000
32	40,000	20,000	10,000	5,000	2,500
64	20,000	10,000	5,000	2,500	1,200
128	10,000	5,000	2,500	1,200	600
256	5,000	2,500	1,200	600	300
512	2,500	1,200	600	300	150
1024	1,200	600	300	150	_

The number of	Number of used channels					
divisions	1 to 2 channels	1 to 4 channels	1 to 8 channels	1 to 16 channels	1 to 32 channels	
(blocks)		Maxim	um recording leng	th (div)		
2	1,280,000	640,000	320,000	160,000	80,000	
4	640,000	320,000	160,000	80,000	40,000	
8	320,000	160,000	80,000	40,000	20,000	
16	160,000	80,000	40,000	20,000	10,000	
32	80,000	40,000	20,000	10,000	5,000	
64	40,000	20,000	10,000	5,000	2,500	
128	20,000	10,000	5,000	2,500	1,200	
256	10,000	5,000	2,500	1,200	600	
512	5,000	2,500	1,200	600	300	
1024	2,500	1,200	600	300	-	

#### For Model MR8847-53 (Total memory: 512 MW)

### Fixed recording length

For Model MR8847-51 (Total memory: 64 MW)

The number of	Number of used channels					
divisions	1 to 2 channels	1 to 4 channels	1 to 8 channels	1 to 16 channels	1 to 32 channels	
(blocks)		Maxim	um recording leng	th (div)		
2	100,000	50,000	20,000	20,000	10,000	
4	50,000	20,000	20,000	10,000	5,000	
8	20,000	20,000	10,000	5,000	2,000	
16	20,000	10,000	5,000	2,000	1,000	
32	10,000	5,000	2,000	1,000	500	
64	5,000	2,000	1,000	500	200	
128	2,000	1,000	500	200	100	
256	1,000	500	200	100	500	
512	500	200	100	50	25	
1024	200	100	50	25	-	

#### For Model MR8847-52 (Total memory: 256 MW)

The number of		nels			
divisions	1 to 2 channels	1 to 4 channels	1 to 8 channels	1 to 16 channels	1 to 32 channels
(blocks)		Maxim	um recording leng	th (div)	
2	500,000	200,000	100,000	50,000	20,000
4	200,000	100,000	50,000	20,000	20,000
8	100,000	50,000	20,000	20,000	10,000
16	50,000	20,000	20,000	10,000	5,000
32	20,000	20,000	10,000	5,000	2,000
64	20,000	10,000	5,000	2,000	1,000
128	10,000	5,000	2,000	1,000	500
256	5,000	2,000	1,000	500	200
512	2,000	1,000	500	200	100
1024	1,000	500	200	100	-

The number of	Number of used channels					
divisions	1 to 2 channels	1 to 4 channels	1 to 8 channels	1 to 16 channels	1 to 32 channels	
(blocks)		Maxim	um recording leng	th (div)		
2	1,000,000	500,000	200,000	100,000	50,000	
4	500,000	200,000	100,000	50,000	20,000	
8	200,000	100,000	50,000	20,000	20,000	
16	100,000	50,000	20,000	20,000	10,000	
32	50,000	20,000	20,000	10,000	5,000	
64	20,000	20,000	10,000	5,000	2,000	
128	20,000	10,000	5,000	2,000	1,000	
256	10,000	5,000	2,000	1,000	500	
512	5,000	2,000	1,000	500	200	
1024	2,000	1,000	500	200	-	

#### For Model MR8847-53 (Total memory: 512 MW)

### Appx. 2.5 Scaling Method for Strain Gauges

This section describes how to determine the scaling conversion ratio when performing measurement with strain gauges and the 8969 and U8969 Strain Unit.

The appropriate conversion formula into stress varies depending on how the strain gauges are used. There are three methods: the one-gauge, two-gauge, and four-gauge methods. The two-gauge method is used for temperature compensation.

E: Young's modulus, v: Poisson's ratio,  $\epsilon$ : Distortion measurement value

Measuring tensile and compressive stress: Stress ( $\sigma$ ) = E ×  $\epsilon$ When performing temperature compensation with two or four gauges, position the gauges perpendicularly with each other.

Stress ( $\sigma$ ) is calculated according to 1 / (1 + v) for two gauges, and according to 1 / {2 (1 + v)} for four gauges.

Measuring bending stress: Stress ( $\sigma$ ) = E ×  $\epsilon$ 

When performing temperature compensation with two or four gauges, stress ( $\sigma$ ) is calculated as a multiple of 1/2 or 1/4, respectively.

Measuring torsional stress: Stress ( $\sigma$ ) = E / {2 (1 +  $\nu$ )} ×  $\varepsilon$  (with two gauges) When using four gauges, the values are halved.

Refer to the strain gauge instruction manual for combinations of strain gauges for each measurement.

Example: Measuring compressive stress Using the one-gauge method; material of measured object: aluminum; Young's modulus: 73 (GPa) (refer to the table below)  $\sigma$  = 73 × 10<sup>9</sup> × (Measured Value) × 10<sup>-6</sup> [unit: µɛ]

= 73 × (Measured value) [unit: kPa]

= 7.44\* × (Measured value) [unit: gf/mm<sup>2</sup>]

\* 1 Pa =  $1.01971621 \times 10^{-7} \text{ kgf/mm}^2 = 1 \text{ N/m}^2$ 

Conversion ratio: 7.44; Unit: gf/mm<sup>2</sup> Enter this value as the scaling conversion ratio.

#### Mechanical properties of industrial materials

Material	Module of longitudinal elasticity (Young's module)	Poisson's ratio
	E (GPa)	ν
Carbon steel (0.1 to 0.25% C)	205	0.28 to 0.3
Carbon steel (> 0.25% C)	206	0.28 to 0.3
Spring steel (Quenched)	206 to 211	0.28 to 0.3
Nickel steel	205	0.28 to 0.3
Cast iron	98	0.2 to 0.29
Brass (Cast)	78	0.34
Phosphor bronze	118	0.38
Aluminum	73	0.34
Concrete	20 to 29	0.1

Refer to "8.5 Converting Input Values (Scaling Function)" (p. 171).

## Appx. 3 About Options

### Appx. 3.1 Options

The following options are available for the instrument. Contact your authorized Hioki distributor or reseller when ordering. The options are subject to change. Visit our website for updated information. For details of cables and clamp sensors for connecting to the modules and the instrument, refer to the manuals supplied with them.

The products marked "factory option" are not user-installable. To order these products additionally, contact your authorized Hioki distributor or reseller.

#### Module (for generation)

These modules can be installed along with a measurement module.

Application	Model	Number of channels	Maximum output frequency	Output voltage
User-defined waveform generation	Model U8793 Arbitrary Waveform Generator Unit	2	100 kHz	-10 V to 15 V
Sine wave and DC generation	Model MR8790 Waveform Generator Unit	4	20 kHz	±10 V
Pulse generation	MR8791 Pulse Generator Unit	8	100 kHz	0 to 5 V

#### Modules (Measurement amplifiers)

The modules listed below can be inserted into the right side of the instrument. You can install these modules freely.

Application	Model	Number of channels	Maximum sampling rate	A/D Resolu- tion	Maximum input voltage	Maximum rated voltage to earth
	Model 8966 Analog Unit	2	20 MS/s	12 bits	400 V DC	300 V AC, DC (CAT II)
	Model 8968 High Resolution Unit	2	1 MS/s	16 bits	400 V DC	300 V AC, DC (CAT II)
	Model MR8990 Digital Voltmeter Unit	2	500 S/s	24 bits	500 V DC	300 V AC, DC (CAT II)
Voltage measurement	Model U8975 4CH Analog Unit	4	5 MS/s	16 bit	200 V DC	300 V AC, DC (CAT II)
	Model U8978 4CH Analog Unit	4	5 MS/s	16 bit	40 V DC (Direct input) 400 V DC (with Model 9665 10:1 Probe used)	30 V AC, 60 V DC (Direct input) 300 V AC, DC (CAT II) (with Model 9665 10:1 Probe used)
	Model 8972 DC/RMS Unit	2	1 MS/s	12 bits	400 V DC	300 V AC, DC (CAT II)
RMS voltage measurement	Model U8974 High Voltage Unit	2	1 MS/s	16 bits	1000 V DC 700 V AC	1000 V AC, DC (CAT III) 600 V AC, DC (CAT IV)
Temperature (Thermocouple) measurement	Model 8967 Temp Unit	2	_	16 bits	_	300 V AC, DC (CAT II)
Frequency, count, pulse duty, and pulse width measurements	Model 8970 Freq Unit	2	_	16 bits	400 V DC	300 V AC, DC (CAT II)
	Model 8971 Current Unit	2	1 MS/s	12 bits	_	Not insulated.
Current measurement	Model U8977 3CH Current Unit	3	5 MS/s	16 bit	-	Not insulated.
Strain (Strain-gauge	Model 8969 Strain Unit	2	200 48/2	16 hita		33 V rms AC or 70 V DC
measurement	Model U8969 Strain Unit	2	200 K3/S	TODILS	_	30 V rms AC or 60 V DC
Digital signals and contact signal measurement	Model 8973 Logic Unit	16	20 MS/s	-	-	Not insulated.
Acceleration measurement (sensor with built-in pre- amplifier, charge-output sensor)	Model U8979 Charge Unit	2	200 kS/s	16 bits	40 V DC	30 V AC, 60 V DC

Refer to "18.6 Specifications of Modules" (p. 395).



#### Measurement probes, cords, and clamp sensors

Application	Model	Description	Maximum input voltage	Maximum rated voltage to earth
	Model L9197 Connection Cable	For high voltage	600 V AC, DC	600 V AC, DC (CAT III) 300 V AC, DC (CAT IV)
	Model L9198 Connection Cable		300 V AC, DC	600V AC,DC (CAT II) 300 V AC,DC (CAT III)
	Model L9790 Connection Cable	For low voltage	600 V AC, DC	With Model L9790-01 Alligator Clip or Model 9790-03 Contact Pin attached: 600 V AC, DC (CAT II) 300 V AC, DC (CAT III) With Model 9790-02 Grabber Clip attached: 300 V AC, DC (CAT II) 150 V AC, DC (CAT III)
	Model L9217 Connection Cable	Isolated BNC-Isolated BNC	300 V AC, DC	600V AC,DC (CAT II) 300 V AC,DC (CAT III)
	Model 9322 Differential Probe	For high voltage • Model 9418-15 AC Adapter is required when connecting to the module for voltage measurement.	2000 V DC, 1000 V AC	With grabber clips attached: 1000 V AC, DC (CAT II) With alligator clips attached: 1000 V AC, DC (CAT II) 600 V AC, DC (CAT III)
	Model P9000-01 Differential Probe Model P9000-02 Differential Probe	The Model Z1008 AC Adapter or a commercially available USB cable is required.	1000 V AC, DC	1000 V AC, DC (CAT III)
Voltage measurement	Model 9665 10:1 Probe	Maximum rated voltage above ground is that of the module.	1 kV rms (up to 500 kHz)	_
	Model 9666 100:1 Probe	Maximum rated voltage above ground is that of the module.	5 kV peak (up to 1 MHz)	_
	Model 9166 Connection Cord	For inputting voltage to Model U8979	30 V AC, 60 V DC	-
				With Model L4935 Alligator Clip Set or Model L4932 Test Pin Set attached: 600 V AC, DC (CAT IV) 1000 V AC, DC (CAT III, CAT II) With Model L9243
				Grabber Clip attached 1000 V AC (CAT II)
	Model L4940 Connection Cord	For Model U8974 High Voltage Unit	1000 V DC	With Model L4936 Bus Bar Clip Set attached: 600 V AC, DC (CAT III)
				With Model L4937 Magnetic Adapter Set attached: 1000 V AC, DC (CAT III)
				With Model L4934 Small Alligator Clip Set attached: 300 V AC, DC (CAT III) 600 V AC, DC (CAT II)

Application	Model	Description	Maximum input voltage	Maximum rated voltage to earth
	Model 9320-01 Logic Probe	Four channels, for detecting voltage and closed/open contact points	-	_
Logic signal input	Model MR9321-01 Logic Probe	Four isolated channels, for detecting voltage and closed/open contact points (small-terminal types, for lines)	High range 250 V rms Low range 150 V rms	250 V rms (CAT II)
	Model 9327 Logic Probe	Four channels, for detecting voltage and closed/open contact points (high-speed type)	_	_
	Model 9709 AC/DC Current Sensor	500 A, DC to 100 kHz	-	-
	Model CT6841 AC/DC Current Probe	20 A, DC to 1 MHz	-	_
	Model CT6843 AC/DC Current Probe	200 A, DC to 500 kHz	-	-
AC/DC current	Model CT6844 AC/DC Current Probe	500 A, DC to 200 kHz	_	-
Model CT955X or 9318 is required for	Model CT6845 AC/DC Current Probe	500 A, DC to 100 kHz	-	-
connection.	Model CT6846 AC/DC Current Probe	1000 A, DC to 20 kHz	_	_
	Model CT6862 AC/DC Current Sensor	50 A, DC to 1 MHz	-	-
	Model CT6863 AC/DC Current Sensor	200 A, DC to 500 kHz	-	-
	Model CT6865 AC/DC Current Sensor	1000 A, DC to 20 kHz	_	-
	Model CT6875 AC/DC Current Sensor	500 A, DC to 2 MHz	_	-
AC/DC current	Model CT6876 AC/DC Current Sensor	1000 A, DC to 1.5 MHz	_	-
	Model CT6877 AC/DC Current Sensor	2000 A, DC to 1 MHz	_	_
	Model CT7631 AC/DC Current Sensor	100 A, DC to 10 kHz	_	-
	Model CT7636 AC/DC Current Sensor	600 A, DC to 10 kHz	_	-
	Model CT7642 AC/DC Current Sensor	2000 A, DC to 10 kHz	_	-
AC/DC current Model CT9920 is required for connection	Model CT7731 AC/DC Auto-Zero Current Sensor	100 A, DC to 5 kHz	_	_
	Model CT7736 AC/DC Auto-Zero Current Sensor	600 A, DC to 5 kHz	-	-
	Model CT7742 AC/DC Auto-Zero Current Sensor	2000 A, DC to 5 kHz	_	_

Application	Model	Description	Maximum input voltage	Maximum rated voltage to earth
AC current Model CT955X or 9318 is required for connection.	Model 9272-10 Clamp On Sensor	20 A/200 A, 1 Hz to 100 kHz	_	-
	Model 9018-50 Clamp On Probe	10 A to 500 A, 40 Hz to 3 kHz	_	-
AC current	Model 9132-50 Clamp On Probe	20 A to 1000 A, 40 Hz to 1 kHz	_	-
Leakage current	Model 9657-10 Clamp On Leak Sen- sor	10 A AC (Leakage current, 50 Hz/60 Hz)	_	_
Voltrage	Model L9795-01 Connection Cable	Alligator clip	120.14	30 V rms AC,
generation	Model L9795-02 Connection Cable	BNC output	±30 V	or 60 VDC
Others For voltage- measuring modules	Model CT9555, CT9556, and CT9557 Sensor Unit	For Model 9272-05, 9709-05, CT6841-05, CT6843-05, CT6844-05, CT6845-05, CT6846-05, CT6862-05, CT6863-05	_	_
For connecting to the Model 8971 Current Unit	Model 9318 Conversion Cable	For Model 9272-10, 9709, CT6841, CT6843, CT6844, CT6845, CT6846, CT6862, CT6863, CT6865	-	-
For connecting to the Model U8977 3CH Current Unit	Model CT9900 Conversion Cable	For Model 9272-10, 9709, CT6841, CT6843, CT6844, CT6845, CT6846, CT6862, CT6863, CT6865	-	-
	Model CT9920 Conversion Cable	For Model CT7631,CT7731, CT7636, CT7736, CT7642, CT7742, CT7044, CT7045, CT7046	_	-

For more information on the output rate of a clamp sensor, see the indication on each clamp sensor or the instruction manual.

#### Printer

Recording paper	Model 9231 Recording Paper	A4-size width × 30 m, one set of 6 rolls
-----------------	----------------------------	--

#### Storage media

SSD Unit	Model U8331 SSD Unit	Built-in SSD drive (specify when ordering)
USB flash drive	Model Z4006 USB Drive	16 GB
	Model 9728 PC Card 512M	512 MB, with adapter
CF cards	Model 9729 PC Card 1G	1 GB, with adapter
	Model 9830 PC Card 2G	2 GB, with adapter

#### Software

Application coffware	Model 9333 LAN Communicator
Application software	Model 9335 Wave Processor

#### Other

Power supply	Model 9784 DC Power Unit	Device to supply DC power to the instrument (factory option)
Case	Model 9783 Carrying Case	Equipped with casters

### Appx. 3.2 Model 9783 Carrying Case

The product warranty period of Model 9783 Carrying Case is one (1) year.



#### Part names



ər

- 2 Caster
- **3** Room for the MR8847A
- 4 Room for instruction manual
- 5 Room for recording paper, accessories and options
- 6 Pull-out handle

How to pull out the handle Pull out the handle while pressing the button on the handle.

#### How to open the latch

- Pull up the butterfly and rotate it counterclockwise.
   (half turn)
- **2** Once the catch is open, pull the latch.







### Appx. 3.3 Model 9784 DC Power Unit

The instrument can be operated on a DC power supply such as batteries.

If both of an AC power supply and Model 9784 DC Power Unit are connected to the instrument, the AC power supply supplies the power preferentially. Note that when the instrument is operated on AC power supply and Model 9784 is turned on, Model 9784 will be in standby state but consume electricity. Turn off Model 9784 when not in use.

The input voltage of Model 9784 ranges between 10 V and 28 V DC.

### 



Before making connections, make sure Model 9784 DC Power Unit is turned off. The instrument could be damaged by a spark if it is connected to a voltage source while its power supply is on.

### **ACAUTION**



Check polarity (positive/negative) and firmly connect Model 9784 to a DC power supply. Model 9784 may break down if the polarity is reversed.

#### **Specifications of Model 9784 DC Power Unit**

The accuracy is provided at 23°C±5°C (73.4F±9F), 20% to 80% RH, 30 minutes after power on.

12 V DC
10 V to 28 V DC
200 VA
As per Memory HiCorder in which Model 9784 is installed
As per Memory HiCorder in which Model 9784 is installed
As per Memory HiCorder in which Model 9784 is installed
700 V DC for 1 minute (between input and output as well as input and enclosure)
100 $\mbox{M}\Omega$ or more/500 V DC (between input and output as well as between input and enclosure)
Approx. 290W × 220H × 32D mm (11.42"W × 8.66"H × 1.26"D)
Approx. 1.2 kg (42.3 oz.)

When using a DC power supply, the specifications of the printer will change as follows:
1. The paper feeding speed decreases to 1 cm/s at the fastest: thus, real time prints for consecutive recording length will be enabled for ranges 1 s/div or later.

2. [Print Speed] setting will be disabled.

• The input voltage should not fall below 10 V DC when using the printer. It may prevent the printing to work properly.

#### Connecting procedure





Negative (-) terminal of Model 9784

#### **Required items:**

A connection cable to connect the source DC power supply and Model 9784 DC Power Unit with each other.

Recommended rated value of the cable: Permissible electric current of 25 A or more Cable termination: Compatible with connection terminal block shown in the left figure.

- **1** Make sure Model 9784 DC Power Unit is turned off.
- Connect the positive terminal block

   (+) of Model 9784 to the positive of the connection cable, and the negative terminal block (-) of Model 9784 to the negative of the connection cable.
- Connect the positive terminal block (+) of the source DC power supply to the positive of the connection cable, and the negative terminal block (-) of the source DC power supply to the negative of the connection cable.

**4** Turn on the 9784.



Back side of Model 9784 DC Power Unit

- This device cannot charge any external battery.
- Take care against battery over-discharge when using a battery to run the instrument.
- If the device detects over-current or over-voltage, it blocks off the output. In such cases, turn off Model 9784 and after approximately one minute, turn it on again.

#### Instrument operating time when a battery is used

(Reference values at room temperature) Battery to be used: 12 V 38 Ah, fully charged

	Model 8966, fully charged
When the printer is not in use (Trigger standby, etc.)	Approx. 9 hours
When the printer is in use (Recorder function, 1 s/div solid printing)	Approx. 5 hours

The values indicated above may vary depending on the number of times the battery is used, charging state, or ambient temperature.

If the instrument is running on AC power supply and the DC power unit is kept on standby (switch is in the on position), the instrument will consume the battery of the unit. In this case, the operating duration of the battery is approximately 5000 hours.

## Appx. 4 FFT Definitions

#### What Is FFT?

FFT is the abbreviation for Fast Fourier Transform, an efficient method to calculate the DFT (Discrete Fourier Transform) from a time-domain waveform. The reverse process of transforming frequency data obtained by the FFT back into its original time-domain waveform is called the IFFT (Inverse FFT). The FFT functions perform various types of analysis using FFT and IFFT.

#### Time and frequency domain considerations

All signals are input to the instrument as a function of the time domain. This function can be considered as a combination of sine waves at various frequencies, such as in the following diagram. The characteristics of a signal that may be difficult to analyze when viewed only as a waveform in the time domain can be easier to understand by transforming it into a spectrum (the frequency domain).



#### Discrete fourier transforms and inverse FFT

For a discrete signal x(n), the DFT is X(k) and the number of Analysis points is N, which are related as follows:

$$X(k) = DFT\{x(n)\} = \sum_{n=0}^{N-1} x(n)W_N^{kn}$$
(1)  
$$x(n) = IDFT\{X(k)\} = \frac{1}{N} \sum_{k=0}^{N-1} X(k)W_N^{-kn}$$
(2)  
$$W_N = \exp\left(-j\frac{2\pi}{N}\right)$$
(3)

X(k) is typically a complex number, so expression (1) can be transformed again and written as follows:

$$F(k) = |F(k)|\exp\{j\phi(k)\} = |F(k)| \angle \phi(k) \dots$$
(4)

$$\phi(k) = \tan^{-1} \frac{\text{Im}\{X(k)\}}{\text{Re}\{X(k)\}}$$
(5)

|F(k)| : Amplitude spectrum,  $\phi(k)$  : Phase spectrum

Representing the above relationship on a complex flat surface produces the following figure.



#### Linear time-invariant systems

Consider a linear time-invariant (LTI) system y(n) that is a response to discrete time-domain signal x(n).

In such an **LTI system**, the following expression applies to any integer Ai when the response to xi(n) is  $y_i(n) = L[x_i(n)]$ .

 $L[A_1x_1(n) + A_2x_2(n)] = A_1y_1(n) + A_2y_2(n).....(6)$ 

If the system function of an LTI system is h(n), the input/output relationship can be obtained by the next expression.

$$y(n) = \sum_{m=0}^{\infty} h(m)x(n-m) = \sum_{m=-\infty}^{\infty} h(n-m)x(m)$$
 ......(7)

Therefore, when a unit impulse  $\delta(n)$  (which is 1 when n = 0, and 0 when  $n \neq 0$ ) is applied to x(n), the input/output relationship is:

This means that when the input signal is given as a unit impulse, the output is the LTI system characteristic itself. The response waveform of a system to a unit impulse is called the **impulse response**.

On the other hand, when the discrete Fourier transforms of x(n), y(n), and h(n) are X(k), Y(k), and H(k), respectively, expression (7) gives the following:

Y(k) = X(k)H(k).....(9)

H(k) is also called the transfer function, calculated from X(k) and Y(k). Also, the inverse discrete Fourier transform function of H(k) is the unit impulse response h(n) of the LTI system.

The impulse response and transfer function of this instrument are calculated using the relationships of expression (9).



#### Number of analysis points

The FFT functions of this instrument can perform frequency analysis of time-domain waveforms consisting of 1000, 2000, 5000, or 10,000 points. However, when the following conditions are satisfied, previously analyzed data can be reanalyzed with a different number of analysis points.

A. When measurements are made with the averaging function disabled (Off)

B. When measurements are made with the averaging function enabled for time-domain averaging (simple or exponential).

When the number of analysis points at measurement time is  $N_1$  and the number of analysis points is changed to  $N_2$  after measurement, the instrument performs as follows.

#### (1) When $N_1 < N_2$

- Because not enough data has been collected, zero is inserted for time after the end of the measured waveform.
- The window function applies only to the  $N_1$  segment.
- Frequency resolution is increased. For example, if *N*<sub>1</sub>= 1000 and *N*<sub>2</sub> = 2000, frequency resolution is doubled.
- The average energy of the time-domain waveform is reduced, so the amplitude of the linear spectrum is also reduced.



(2) When  $N_1 > N_2$ 

- The specified  $(N_2)$  segment is extracted from the head of the  $(N_1)$  data.
- The window function applies only to the  $N_2$  segment.
- Frequency resolution is decreased. For example, if  $N_1$  = 2000 and  $N_2$  = 1000, frequency resolution is halved.
- The average energy of the time-domain waveform is unchanged, so the amplitude of the linear spectrum is not significantly affected.



#### Aliasing

When the frequency of a signal to be measured is higher than the sampling rate, the observed frequency is lower than that of the actual signal, with certain frequency limitations. This phenomena occurs when sampling occurs at a lower frequency than that defined by the Nyquist-Shannon sampling theorem, and is called **aliasing**.

If the highest frequency component of the input signal is  $f_{max}$  and the sampling frequency is  $f_s$ , the following expression must be satisfied:

 $f_s = 2f_{max} \dots \tag{10}$ 

Therefore, if the input includes a frequency component higher than  $f_s/2$ , it is observed as a lower frequency (alias) that does not really exist.

The following diagrams show the results of spectrum analysis of composite waveforms having components of 1 kHz and 3 kHz, and of 1 kHz and 7 kHz.

If sampling frequency  $f_s$  is 10 kHz, the spectral component of an input frequency above 5 kHz (in this case, 7 kHz) is observed as an alias at 5 kHz or below.

In this example the difference between the 3 kHz and 7 kHz components is indiscernible.





#### Anti-aliasing filters

When the maximum frequency component of the input signal is higher than one-half of the sampling frequency, aliasing distortion occurs. To eliminate aliasing distortion, a low-pass filter can be used that cuts frequencies higher than one-half of the sampling frequency. Low-pass filters used this way are called **anti-aliasing filters**.

The following figures show the effect of application of an anti-aliasing filter on a square wave input waveform.





#### Imaging

When the instrument is set to a measurement frequency range that requires a higher sampling rate than the maximum capability of the module, intermediate data points are interpolated between successive data samples. In this case, the time-domain waveform exhibits a stair-step shape. When FFT analysis is performed in this situation, non-existent high frequency spectral components appear. This phenomena is called zero-order hold characteristic **imaging**.

The following figures show the time-domain waveform and spectrum of a sine wave applied to the Model 8968 High Resolution Unit.



To avoid imaging phenomena when analyzing waveforms with the FFT function, verify the maximum sampling frequency of the module before measuring.

time-domain data.

#### Averaging

With the FFT function, averaging is performed according to the following analytical expressions. Averaging in the time domain produces meaningless data if performed with inconsistent trigger criteria.

#### (1) Simple Averaging (Time and Frequency Domains)

Sequences of acquired data are summed and divided by the number of acquisitions.

n: count of measurements to average

*An*: averaging results of *n* counts

Zn: measurement data of n counts

#### (2) Exponential Averaging (Time and Frequency Domains)

Before averaging, newer data is given exponentially greater significance than older data.

N: specified number of counts to average

n: count of measurements to average

An: averaging results of n counts

Zn: measurement data of n counts

#### Overall value

The overall value is the sum of the power spectrum at each frequency. This value is nearly equal to the positive sum of the squares of the (RMS) input signals, except when frequency averaging is performed. The FFT function of the instrument calculates and displays the RMS values for stored waveforms and the overall value from the sum of the power spectrum for the frequency domain. Any FFT analysis modes other than the power spectrum, however, take the root square of the overall value to match the unit.

With the FFT analysis mode set to the power spectrum

$$(Over \ all) = \sum_{i=0}^{N} P_i$$
.....(13-1)

With the FFT analysis mode set to the histogram, linear spectrum, RMS spectrum, impulse response, 1/1 octave analysis, or 1/3 octave analysis

$$(Over all) = \sqrt{\sum_{i=0} P_i}$$
(13-2)

 $P_i$ : power spectrum of value *i* 

#### Total harmonic distortion (THD)

Total harmonic distortion (THD) indicates the proportion of the higher harmonics to the fundamental harmonic.

This means that the larger the value, the more distorted the waveform.

THD = 
$$\sqrt{\frac{\sum (V_n)^2}{(V_0)}} \times 100$$
 [%].....(14)

 $V_0$  = fundamental wave  $V_n$  = *next* higher harmonic

#### Window function

2

The Fourier transform of a continuous system is defined by the integral calculus in expression (15) for the time range from minus infinity to plus infinity.

$$X(f) = \int_{-\infty}^{\infty} x(t) \,\varepsilon^{-2\pi f t} dt \quad \dots \tag{15}$$

However, because expression (15) cannot be calculated with actual measurements, the Analysis is performed on a segment between finite limits. Processing the waveform segment within these limits is called **window processing**. For FFT analysis, the waveform segment within these limits is assumed to repeat periodically (as shown below).



When the number of points for FFT analysis is an integer multiple of the input signal frequency, a singleline spectrum is obtained. However, if it is not an integer multiple of the frequency (When the waveform assumed with FFT includes discontinuous points), the spectrum is scattered, and a line spectrum cannot be obtained. This phenomenon is called leakage error (as shown below).



The window function was created to suppress such leakage errors. The window function smoothly connects each end of the time-domain waveform where it is cut off.

The following figure presents an example of spectral analysis by applying a window function to a timedomain waveform.

Using the window function, discontinuous points on the time-domain waveform are eliminated, so the wave shape approaches a line spectrum.



The following figure shows the time-domain waveform of the window function and its spectrum. Each spectrum shows a large peak at a low frequency, and many smaller peaks at higher frequencies. The largest peak is called the **main lobe**, and the smaller peaks are the **side lobes**.

The most accurate results of the FFT function are obtained when the width of the main lobe and the amplitude of the side lobes are minimized, although both conditions cannot be satisfied at the same time. Therefore, a window function with a wide main lobe is used when amplitude values are important, while a window function with a small main lobe is used to observe fine spectral details, and a window function with small side lobe amplitudes is used to exclude the effects of the surrounding spectrum.

However, the main lobe width is proportional to the width (1/W) of the window so increasing the number of analysis points increases the frequency resolution.





Spectrum

The following example shows input sine waves of 1050 Hz and 1150 Hz analyzed with different window functions. Because the frequencies in this example are close to one another, a rectangular window with a narrow main lobe is able to separate and display both frequencies, but a Hann window with a wide main lobe displays the two as a single spectral component.





Analysis Using a Rectangular Window

Analysis Using a Hann Window

#### Octave filter characteristics

Octave filter characteristics are determined according to the IEC61260 standard. The figures below show these standards and the filter characteristics of this instrument.





#### Linear predictive coding (LPC)

In the following figure, linear predictive coding is implemented by passing a sample of the input signal through the prediction filter while altering the filter so as to minimize errors in the original signal.



Given a time-discrete signal { $x_t$ } (*t* is an integer) where the input signal is sampled at interval  $\Delta T$ , LPC analysis presumes the following relationship between current sample value  $x_t$  and the value of previous sample p.

 $x_{t} + a_{t}x_{t-1} + a_{2}x_{t-2} + \dots + a_{p}x_{t-p} = \varepsilon_{t}.....(16)$ 

However, { $\varepsilon_t$ } is an uncorrelated random variable with average value 0 and the dispersion  $\sigma^2$ . Expression (16) shows how current sample value  $x_t$  can be "linearly predicted" from previous sample values.

If the predicted value of  $x_t$  is actually  $x_t$ , expression (16) can be transformed as follows.

$$x_t = \frac{\alpha}{x_t} + \varepsilon_t = \sum_{i=1}^r \alpha_1 x_{t-i} + \varepsilon_t$$
 (17)

#### Here, $\alpha i$ is called the **linear predictor coefficient**.

For LPC analysis, this coefficient is calculated using the Levinson-Durbin algorithm, and a spectrum is obtained. In this instrument, the order of the coefficient can be set from 2 to 64. Larger orders reveal fine spectral components, while small orders reveal the overall spectrum shape.

# Index

#### Number

100BASE-TX	346
9333 LAN Communicator	367

Α	
A.A.F	186, 196
Acceleration sensor	
Acquisition interval	
Aliasing	Appx.27
Analog trigger	214
Analysis mode	283, 286, 288, 320
Anti-aliasing filter	186, 273, Appx.28
Area	239, 250
Attenuation rate	
Auto-balance	
Auto-correlation function	
Auto-print	127
Auto-range	
Auto-save	
Auto-setup	113
Average	239, 249
Averaging	282, Appx.30

### В\_\_\_\_\_

Beep sound	337
Binary	93
Blackman-Harris window	280, Appx.33
Blackman window	280, Appx.33
Blank panel	28
BMP	93
Breakdown	432
Built-in drive	47

#### С

Calculation number	286
Calculation starting point	300
Calibration	55
Carrying case App	ox.21
CF card	47
Changing storage device	92
Clock setting	53
Coherence function	312
Command	365
Comment	
Add comments	160
Print (Channel marker)	133
Communication	341
Access	356
Command communication	365
Delimiter	365
Direct connection to computer	347
Download	358
Gateway	343

Header
Host name 343
IP address 343
Port number 365
Subnet mask 343
Connection
Frequency, number of rotations, and count
measurement 32
Temperature measurement 33
Vibration/displacement (strain) measurement 34
Voltage measurement 30
Connection cables 30, 32
Conversion ratio 171
COPY key 20, 136
Cross-correlation function 315
Cross power spectrum 310
CURSOR key 19
Cursors A and B 140
Cursor value 140
X-Y composite waveform 144

#### D

	A mmy 00
DC power supply	Аррх.22
Decibel input	292
Decimation	279
Delete	119
Delete Save	100
Delimiter	366
Display color	
Calculated waveform	261
Display format	293
Display image	
Save	103
Display type and split screen	294
Disposal	
Lithium battery	448
Duty ratio	239, 241, 251

#### E

Entering numerals	166
Entering text	163
ESC key	19
Exponential averaging	282, Appx.30
Exponential window	280, Appx.33
External control	369
External control terminal	369
External sampling	. 62, 277, 375
External trigger	226

#### F

Fall time	239, 241, 250
Fast response	193
FEED key	20, 137
FFT	273, Appx.24

File	
File type	
When entering the file name	164
File management	
Change name	121
Delete	119
New folder	118
Sort	120
File size	
CSV file	Appx.3, Appx.5
FFT file	Appx.3, Appx.4
MEM file	Appx.2, Appx.4
REC file	Appx.2, Appx.4
XYC File	Appx.3, Appx.4
Filter	
Filter width	218
Flat top window	280, Appx.33
Folder	118
New folder	99, 118
Forcible trigger	226
Format	49
Format/Initialization	49, 435
Four arithmetic operations	239, 241, 251
Fourier transforms	Appx.24
Frequency range	277
Frequency resolution	278
FTP	355

### G

Glitch trigger	217
Graph	. 70

### H

Hamming window	280, Appx.33
Hann window	280, Appx.32
Header	366
Help	24
HELP key	24
High-level calculation	239
Highlight	285
Attenuation rate	285
Attenuation value	285
Histogram	302, 320

### 

Icon	47
Imaging	Appx.29
Impulse response	311, Appx.25
Input coupling	74
Input level	154
Installation	7
Internal memory	48
Internet browser	348
Invert	182

\_\_\_\_

### Ind.**2**

### J

Jog dial	. 19
Judgment	243
Jump function	147

### κ

T(C) 1001(	ey-lock	19
------------	---------	----

### L\_\_\_\_\_

L9197 Connection Cord	30, 32
L9217 Connection cable	30, 32
LAN	342, 365
Level monitor	154
Level trigger	215
Linear predictive coding	Appx.36
Linear spectrum	303
Linear time-invariant system	Appx.25
Load	110
File type	93
Loading	110
Logic channel	
Logic probe	42
Logic trigger	220
Low-level calculation	239
Low-pass filtering	
LPC	Appx.36
LTI system	Appx.25

#### Μ

Magnification/demagnification	
Waveform	150
Zoom function	151
Manual print	130
Manual trigger	226
Maximal	281
Maximum value (maximum) 249,	281
Measurable range	317
Memory capacity	379
Memory division	267
Minimum value (minimum)	249
Mode 194,	196
Module 28, 184, 395, App	x.15

### Ν

NG	
External sampling	294
Nyquist, running spectrum	294
X-Axis setting	294
X-axis unit	294
NPLC	193
Number of analysis points App	ox.26

Number of calculation points	277,	291
Number of events		218
Numerical calculation		235
Calculation equation		249
Calculation type		238
Judgment		243
Setting		238
Numerical calculation result		242
Nyquist	288,	293

### 0\_\_\_\_\_

315, 317
288, Appx.35
172
19
Appx.15
292, Appx.30
168

Р	
Paper feeding	20
Parameters	37
Peak value display 28	31
Period/Frequency 241, 24	49
Period trigger 21	16
Phase difference calculation 239, 24	41
Phase spectrum	13
Highlight 28	35
Power cord	51
Power spectrum	)6
Power spectrum density 307, 30	30
Power supply	52
POWER Switch	52
P-P value	49
Pre-trigger 22	27
Trigger priority 22	29
Print 125, 29	99
Auto Print 12	26
Channel settings 16	61
Comment 16	60
Counter printing (Date) 13	35
Measurement condition 16	60
Print content 12	26
Printing malfunctions 43	33
Quick print 12	26
Title 16	60
Printer	
Printer head 44	46
Printing	
Realtime printing 12	27
Probe attenuation 18	36
Pulse count 239, 241, 25	51
Pulse generation 20	)1
Pulse width 239, 241, 25	51

### R

82
Аррх.6
52
68
80, Appx.32
270
276
194
192
9, 241, 250
249
167
442
295

### S

Save	91, 95
Auto-save	95
File type	93
Quick save	95
Saving is not possible	433
Selection save	95
SAVE key	. 95, 103
Scaling	171
Rated capacity	175
Rated output	175
Using a clamp sensor	174
Using a strain gauge 176,	, Appx.14
Using the Model 8969 Strain Unit and U8969	9
Strain Unit	175
Scroll	146
Search	. 24, 233
Select at save	103
Self diagnostics	
Display check	443
Key check	444
Printer check	443
ROM/RAM check	442
System configuration check	444
Setting	
Auto-load	113
Auto-print	127
Input channel	70
Measurement condition	60
Save	95
Waveform display	178
Simple averaging	Appx.30
Sort	120
Specified time level (Lev-Time)	239, 241
SSD	47
Standard deviation	239, 250
Standard LOGIC terminals	18

Start block	269
START key	19
Start measurement	
STARTUP	113
STOP key	19
Storage	302

### т

Text	. 93
Text comment	138
Thermocouple	. 33
Timebase	278
Time lag calculation	239
Timer trigger	222
Time to level (Time-Lev) 239, 241,	251
Time value	
Time to maximum value	249
Time to minimum value	249
Transfer function	309
Trigger	211
Glitch	217
In	215
Level	215
Mode	213
Out	215
Out-of-period	216
Timing	230
Trigger filter	218
Trigger mode	284
Trigger output	377
Trigger priority	229
Trigger search	234
Trigger settings	
Setting procedure	212
Trigger source (AND/OR)	232
Two-point setting	171

### U

LI8331 SSD Unit	47	381
Upper and lower limits	,	156
	361	365
Used block	157	260
Used channel	157,	170
User defined waveform	202	205
	203,	205

### V

Variable auto-correction	173
Variable function	
Using the scaling and variable functions together	
180	
Using together with the scaling function	173
Vernier	181
Voltage sag trigger	216

#### W

Waveform	
Magnify/compress	150
Range specification	145
Waveform calculation	253
Operator	
Waveform color	149, 261, 286, 291
Waveform evaluation	321
Waveform file size	Аррх.2
Waveform generation	199
Waveform image	
Save	103
Waveform screen	300
Waveform tracking display	270
Window function	280, 291, Appx.31
Correction	

### <u>X</u>

X-axis		287
X-Y area	239,	250

### Y\_\_\_\_\_

	~~~
Y-axis	287

### Ζ\_\_\_\_\_

Zero-adjust		54
Zero position	54,	74

### Warranty Certificate

Model	Serial number	Warranty period
		Three (3) years from date of purchase ( / )
Customer name:		· · · · · · · · · · · · · · · · · · ·
Customer address:		

#### Important

- Please retain this warranty certificate. Duplicates cannot be reissued.
- Complete the certificate with the model number, serial number, and date of purchase, along with your name and address. The personal information you provide on this form will only be used to provide repair service and information about Hioki products and services.

This document certifies that the product has been inspected and verified to conform to Hioki's standards. Please contact the place of purchase in the event of a malfunction and provide this document, in which case Hioki will repair or replace the product subject to the warranty terms described below.

#### Warranty terms

- The product is guaranteed to operate properly during the warranty period (three [3] years from the date of purchase).
   If the date of purchase is unknown, the warranty period is defined as three (3) years from the date (month and year) of manufacture (as indicated by the first four digits of the serial number in YYMM format).
- 2. If the product came with an AC adapter, the adapter is warrantied for one (1) year from the date of purchase.
- 3. The accuracy of measured values and other data generated by the product is guaranteed as described in the product specifications.
- 4. In the event that the product or AC adapter malfunctions during its respective warranty period due to a defect of workmanship or materials, Hioki will repair or replace the product or AC adapter free of charge.
- 5. The following malfunctions and issues are not covered by the warranty and as such are not subject to free repair or replacement:
  - -1. Malfunctions or damage of consumables, parts with a defined service life, etc.
  - -2. Malfunctions or damage of connectors, cables, etc.
  - -3. Malfunctions or damage caused by shipment, dropping, relocation, etc., after purchase of the product
  - -4. Malfunctions or damage caused by inappropriate handling that violates information found in the instruction manual or on precautionary labeling on the product itself
  - -5. Malfunctions or damage caused by a failure to perform maintenance or inspections as required by law or recommended in the instruction manual
  - -6. Malfunctions or damage caused by fire, storms or flooding, earthquakes, lightning, power anomalies (involving voltage, frequency, etc.), war or unrest, contamination with radiation, or other acts of God
  - -7. Damage that is limited to the product's appearance (cosmetic blemishes, deformation of enclosure shape, fading of color, etc.)
  - -8. Other malfunctions or damage for which Hioki is not responsible
- 6. The warranty will be considered invalidated in the following circumstances, in which case Hioki will be unable to perform service such as repair or calibration:
  - -1. If the product has been repaired or modified by a company, entity, or individual other than Hioki
  - -2. If the product has been embedded in another piece of equipment for use in a special application (aerospace, nuclear power, medical use, vehicle control, etc.) without Hioki's having received prior notice
- 7. If you experience a loss caused by use of the product and Hioki determines that it is responsible for the underlying issue, Hioki will provide compensation in an amount not to exceed the purchase price, with the following exceptions:
  - -1. Secondary damage arising from damage to a measured device or component that was caused by use of the product
  - -2. Damage arising from measurement results provided by the product
  - -3. Damage to a device other than the product that was sustained when connecting the device to the product (including via network connections)
- 8. Hioki reserves the right to decline to perform repair, calibration, or other service for products for which a certain amount of time has passed since their manufacture, products whose parts have been discontinued, and products that cannot be repaired due to unforeseen circumstances.

### HIOKI E.E. CORPORATION

http://www.hioki.com

HIOKI





All regional contact information

http://www.hioki.com

**HEADQUARTERS** 81 Koizumi

Ueda, Nagano 386-1192 Japan

**HIOKI EUROPE GmbH** 

Rudolf-Diesel-Strasse 5 65760 Eschborn, Germany hioki@hioki.eu

1906 EN Printed in Japan

Edited and published by HIOKI E.E. CORPORATION

CE declarations of conformity can be downloaded from our website.
Contents subject to change without notice.
This document contains copyrighted content.
It is prohibited to copy, reproduce, or modify the content of this document without permission. ·Company names, product names, etc. mentioned in this document are trademarks or

registered trademarks of their respective companies.