

Operating manual

data logger for external sensors

BA-OP20E-03-EN

## Table of contents

Con	tent		Page					
1.	Safet	ty	2					
2.	Inten	ended use						
3.	Equip	uipment						
4.	Scop	ne of supply						
5.	Prepa	paration before starting	4					
	5.1.							
		5.1.1. Installation conditions	4					
		5.1.2. Installation of the SmartGraph software	4					
		5.1.3 Preparing data logger configuration	4					
	5.2.	Note at initial startup	4					
6.	Opera	ration	4					
	6.1.	Switching on and off						
	6.2.	Basic settings and operating modes						
		6.2.1. The four operating modes						
		6.2.2. Network function (M51)						
		6.2.3. Factory settings (M52)						
		6.2.4. Acoustic function (M53)						
7.		nection and configuration of external sensors	6					
	7.1	BUS sensors						
		7.1.2 Configuration of BUS sensors (M6x)						
		7.1.3 Logging the BUS sensors (M7x) off						
	7.2	Connection of analogue sensors						
	1.2	7.2.1 Sensors for measuring voltage 0 - 1V						
		7.2.2 Sensors for measuring current, 2-cable 4 - 20 n and 3-cable 0 - 20 mA	ηA					
		7.2.3 Pt100 sensors in 3- and 4-cable switching	8					
		7.2.4 Thermal elements	8					
	7.3	Configuration of analogue sensors (M81)	8					
8.	Meas	easured values display and data recording						
	8.1.	Channel groups and measuring channels						
	8.2 Processing channels for converting measured values							
	8.3.	Displaying measured values	9					
	8.4.	Data recording	9					
9.	Alarn	m function	11					
	9.1.	Alarm configuration						
	9.2.	Alarm display						
	9.3.	Acoustic alarm						
	9.4.	Using the alarm hysteresis						
10.		es on maintenance and operation	12					
		Battery change						
		. Deleting measured data						
		. Mounting on a wall						
		. Moving to another site						
11		nical data	13					
		us codes	14					
14.	งเลเน	uo ovuoo	14					

In order to use your data logger according to its intended use and utilise its complete range of functions, carefully read all documentation about this device.

This operating manual describes the functions of the hardware.

A separate manual – the **software manual** – describes how to use the software and configure the data logger with the software and can be opened after the software has been installed by using the help function in the software.

Your new data logger was built according to current state-of-the-art technology and fulfils valid European and national directives. This conformity has been tested and the corresponding declarations and documents are kept on file by the manufacturer.

To keep this condition and ensure safe operation, as a user, you must observe the following safety instructions:

# 1. Safety

We accept no liability for damages caused by non-observance of this manual or unprofessional handling. Any warranty claims are voided in such cases!



Before starting the measuring device for the first time, read this manual from front to back!

For reasons of safety and conformity (CE), any unauthorised change made to the device construction or components which are to be used with the measuring device are prohibited!

#### Before using the device, observe the following:

- · Never measure live parts.
- · Observe the storage and operating conditions.
- The only party responsible for determining measured results to be valid, drawing conclusions and deriving actions is the user! The correctness of the results presented is excluded from any liability or guarantee.
   Liability for damages which have been caused by utilising the presented measured results is strictly excluded.

## 2. Intended use

The data logger is designed to detect and record a range of measured values that are detected by the measuring device and the connected external sensors. The measured data can be detected at variable selectable recording or request intervals, then saved and transmitted to a connected PC.

The measuring device may only be used for this intended use while complying with specified technical data for the measuring device and external sensors.


Any other use is considered misuse and contrary to the intended use.



The product must not be disposed of with household waste. Dispose of this device in a manner according to the relevant legal requirements.


This release replaces all previous releases. No part of this publication may be reproduced without written permission. The same applies for electronically processing, duplicating or spreading the publication. Subject to technical changes. All rights reserved. Trademarks are used without guarantee that they may be used freely and primarily following the spelling of the manufacturer. The product names used are registered and should be treated appropriately. Changes to construction in the interests of constant improvements to the product, as well as changes to the shape and colour are reserved. The delivered product may vary from product images. This document was produced with all due care. We accept no liability whatsoever for mistakes or ornissions.

# 3. Equipment

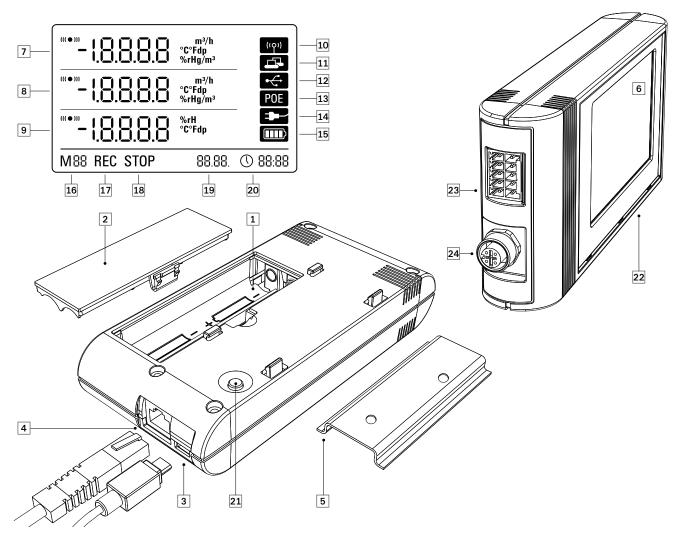


- Battery compartment
- 2 Battery cover
- 3 PC connection USB type micro B
- 4 Network connection RJ45
- Mount track for fastening
- 6 LCD display:
  - Measured value row 1
  - 8 Measured value row 2
  - 9 Measured value row 3
  - 10 Display symbol for active acoustic signal
  - 1 Display symbol for active network connection
  - Display symbol for active USB connection
  - Display symbol for power supply over a network
  - Display symbol for power supply over USB
  - 15 Display for battery level
  - 16 Display for mode marker
  - Display for active measured value recording
  - Display for inactive measured value recording
  - Display for date
  - Display for time
- Mode selection button
- Data logger for connecting to external sensors

10-pin terminal with two independent input channels for connecting up to two analogue sensors:

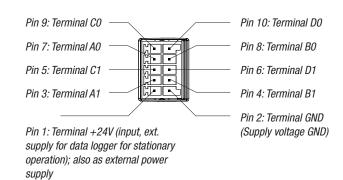

5-pin round connector M12 for connecting up to four digital BUS-compatible sensors:

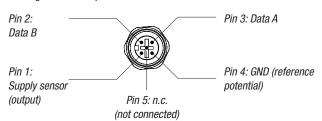

# 4. Scope of supply

The following components are included in the standard scope of supply:

- Data logger
- USB connection cable
- CD-ROM with operating manual, SmartGraph software and software manual
- 4 x AA batteries
- Factory certificate

# 5. Preparation before starting

#### 5.1. Software

#### 5.1.1. Installation conditions

To configure your data logger and read the recorded measured values, the SmartGraph software must be installed on a PC with the following minimum requirements.

#### Supported operating systems:

- Windows XP from Service Pack 3 (32 bit or 64 bit version)
- Windows Vista (32 bit or 64 bit version)
- Windows 7 (32 bit or 64 bit version)

#### Hardware requirements:

- Processor speed: 1 GHz, minimum
- CD-ROM drive
- USB or network connection RJ45
- 512 MB RAM, minimum
- 4 GB of free hard disk space, minimum
- Adobe Acrobat Reader software

#### 5.1.2. Installation of the SmartGraph software

Insert the CD-ROM into your PC drive and install the software by following the instructions in the installation wizard.

#### 5.1.3 Preparing data logger configuration

If necessary, connect the external sensors which are needed for detecting measured values to the external connections of your data logger.

Information about connecting and configuring suitable sensors is provided in chapters 7 and 11. Follow the instructions in chapter 7 for connecting external sensors and then continue with startup.

Afterwards, connect the data logger to your PC via the USB cable provided in the scope of supply. The measuring device is automatically detected by the SmartGraph software.

Alternatively, you can configure your data logger via a LAN connection over your local network if the network function is enabled. Further information about the network function is provided in chapter 6.2.2.

Start the SmartGraph software. The program automatically detects the connected data logger and adds it to the list of available data loggers. The data logger can now be configured via the software.

Further detailed information about using the software is provided in the software manual which you can open from the help function of the Smart-Graph software.

## 5.2. Note at initial startup

After starting the device for the first time, the message "SET TIME" appears on the display. However, no settings need to be made directly on the device. The time synchronises itself with the PC time automatically when connected to the SmartGraph software for the first time.

# 6. Operation

The PC software SmartGraph is the central configuration interface for your data logger. All additional configuration and visualisation specifications can only be set by software.

Basic settings can be directly configured with one-button operation by using the mode selection button on your data logger.

You can restrict the one-button operation with the mode selection button from your software if necessary (key lock). It is not possible to operate your data logger with the mode selection button in this case.

#### 6.1. Switching on and off

M52

**M53** 

M<sub>6</sub>x

M7x\*

**M81** 

An 0

**M81** 

An 1

When current is being supplied, the data logger cannot completely switch off, but can only be set to an operating mode with minimal energy consumption (M1). In this mode, measured value detection, measured value display and data recording are inactive. An overview of the four various operating modes is provided in the next chapter.

## 6.2. Basic settings and operating modes

Eleven basic settings can be configured by using the mode selection button. These include the four various operating **M1** modes, the network function, a global reset of settings, the acoustic function and various settings for configuring external **M2** Briefly pressing the mode selection button changes to the **M3** current setting level. Briefly pressing the mode selection button allows navigation **M4** through the individual setting modes. Each chosen mode is shown for four seconds and M51 can be selected.

> Within this time, the mode marker flashes in the bottom left corner of the display (M1, M2, M3, M4, M51, M52, M53, M6x, M7x, M81 (An0), M81 (An1)).

Pressing the mode selection button for 1 second confirms your selection.

The data logger then changes to the selected mode.

If no selection is confirmed within the four second period, the setting level is left and the display returns back to the original mode without making changes.

This function is only available if a BUS sensor has already been registered (M61).

#### 6.2.1. The four operating modes

#### Operating mode M1





Selection of the operating mode M1

Display of the operating mode M1

Measured value recording is inactive. "OFF" is shown in the second measured value row. The STOP symbol is shown.

In this operating mode (data logger delivery state), the power consumption is minimal because measured values cannot be requested or shown.

#### Operating mode M2





 
Selection of the operating mode M2

Example display of the operating mode M2

Measured value detection is active. The measured values which have been configured in the SmartGraph software are shown in all three measured value rows at the selected sensing rate.

In this operating mode, data recording is inactive; the displayed measured values are not saved in the memory. The display for measured value recording thus shows STOP (no data recording).

#### Operating mode M3





Selection of the operating mode M3


Example display of the operating mode M3

Measured value detection and data recording are active. The measured values which have been configured in the SmartGraph software are shown in all three measured value rows at the selected sensing rate.

Additionally, in this operating mode, up to twenty measuring channels, which can be selected in the SmartGraph software, are stored in the measured value memory. The display for measured value recording thus shows REC (data recording).

## Operating mode M4



 

Selection of the operating mode M4

Display of the operating mode M4

Measured value detection and data recording are active; but measured value display is inactive.

Measured values are not shown in any of the three measured value rows. Still, in this operating mode, up to twenty measuring channels, which can be selected in the SmartGraph software, are stored in the measured value memory. The display for measured value recording thus shows REC (data recording).


#### 6.2.2. Network function (M51)
 
#### Requirements for connecting over a IPv4 network.

To automatically identify the IP configuration of a data logger (which has received an IP address in the IP network via DHCP for example), it is necessary that UDP broadcasts are allowed through the network.

Note: Based on their concept, UDP broadcasts do not operate through a router (NAT), but instead only within its own network. If the data logger is outside of the network, using fixed IP addresses through a system administrator is highly recommended.

#### Connect to the network





Selection of the network function M51

Example display of the network function M51

If the data logger is connected to a local network and the network function is activated, then software configuration and data reading from the data logger can be carried out over the network.

A signal which is broadcast from the data logger over UDP allows the SmartGraph software to automatically find the measuring device in the local network.

The first time that the data logger is connected to the network (add network device), it may be necessary to adjust the data logger's network settings to the configuration of the available network in the SmartGraph software. The factory preset is DHCP.

Further information about the network function is provided in the software manual which you can open from the help function of the SmartGraph software.

With the professional version of the SmartGraph software, it is also possible to retrieve and log current and saved measured values of the data logger in adjustable request intervals over the network.

#### Use in network mode

For continuous use of the network card, the data logger must be mounted on a wall. There must be a free air convection within a gap of a half metre and the zone must not be interrupted by external sources of convection (fans, lighting etc.).

## Power supply in network mode

Using the network card, which is built into the data logger, raises the power consumption of the measuring device.

When the device is running on batteries alone and not connected to an external power supply, it automatically deactivates the network function after 12 minutes pass without communicating with the network. In this case, the network function must be restarted by an external power supply either manually or automatically.



When using the data logger in LAN mode, the power should thus be supplied by the USB power supply.

In the optionally available PoE design, the data logger can have its power supplied directly over the network connection.

#### Information for system administrators

#### **Broadcast over UDP:**

PC sends to ......UDP:255.255.255.255:52010 (data logger receives at UDP port 52010\*) data logger replies to ......UDP:255.255.255.255:52005

(PC receives at UDP port 52005\*)

 
#### Data transmission over TCP:

data logger receives at TCP port 52015\*

\* The ports can be reconfigured, but this is not recommended.

Open or lost TCP connections are closed by the data logger after a TCP timeout of 120 seconds.

#### 6.2.3. Factory settings (M52)



This function resets the device settings to factory settings.

Even when resetting the device to factory settings or when there are no batteries in the device, the measurement data remains in the memory and is not deleted.

Selection of the reset function M52

Information about deleting the measured data is provided in chapter 9.2.

#### 6.2.4. Acoustic function (M53)

Activating or deactivating the acoustic function switches the data logger's acoustic signal either on or off. If the acoustic function is active, the function's display symbol is shown on the display.

When the acoustic function is active, alarm results are indicated as a tone, provided an active alarm has been preset for one or more of the three display measured values in the SmartGraph software.





Selection of the acoustic function M53

Example display of the acoustic function M53

If the acoustic function is not active, then none of the navigations steps which require the mode selection button on the data logger to be pressed are acknowledged by a tone. The same applies for selecting a mode.

If no selection is made, and thus the setting level is exited, then a tone is also emitted.

 
# 7. Connection and configuration of external sensors

The data logger has a 5-pin round connector M12 for connecting digital BUScompatible sensors (BUS-sensor) and also has a 10-pin terminal with two independent input channels for connecting up to two analogue sensors.

#### **BUS** sensors 7.1

#### 7.1.1 Connection of BUS sensors

Attach the BUS sensor to the 5-pin round connector of the data logger (see 24, chapter 3). The sensor is supplied with current via the plug.



By optionally using up to three Y-distributors, a maximum of four digital BUS sensors can be connected to the data logger.

Further information about the currently available BUS sensors is provided in the technical data in chapter 11.

#### 7.1.2 Configuration of BUS sensors (M6x)

So that BUS sensors can be used with the data logger, each BUS sensor must first be registered at the data logger individually.

It is only possible to configure if the data logger is not in logging mode (M3 or M4)!

The BUS sensors can be configured at the data logger as described below or otherwise, directly in the SmartGraph software. Further detailed information about configuration of the BUS sensors in the software is provided in the software manual which you can open by using the help function of the Smart-Graph software.

To configure at the data logger, connect the first BUS sensor to be registered to the 5-pin round connector 24 of the data logger and then use the mode selection button to navigate to the configuration mode M6x – as described in chapter 6.2. The option for registering the BUS sensor is shown on the display (n1 for the first sensor to n4 for the fourth sensor).

Briefly pressing the mode selection button starts registration of the BUS sensor. The display then changes to the scan mode and the connected BUS sensor is automatically detected and identified.

At identification, the sensor is assigned a four-digit BUS ID. The first two digits of the ID represent the sensor type (e.g. 71 for TFF sensors). The last two digits represent the sensor number and are automatically assigned according to the order of registration - 01 for the first to 04 for the fourth registered sensor.

 
After sensor registration, a message is displayed with information about the BUS ID – the message symbol in the bottom right corner of the display flashes. Briefly pressing the mode selection button closes the message.



Tip: Note the BUS ID for measuring in the future directly on the sensor.



Example display: Registration function M61 selection for registering the first BUS sensor (n1).



Example display: Message specifying the BUS ID (71.01) for the first registered BUS sensor.

Important: If several sensors are used, each sensor must first be individually connected to the data logger, registered and assigned a BUS ID in this manner. The registration process cannot be carried out if more than one sensor is connected to the BUS!

.....


Thus, ensure that only the applicable sensor is connected to the BUS for registration.

This restriction only applies for the registration process. After all sensors have been individually registered, it is possible to use several BUS sensors without difficulty, of course.

Otherwise, the BUS sensors can be configured directly in the SmartGraph software.

Further detailed information about configuration of the BUS sensors in the software is provided in the software manual which you can open by using the help function of the SmartGraph software.

#### 7.1.3 Logging the BUS sensors (M7x) off

 

selection for logging off the first selected sensor.



Example display: Message specifying the BUS ID (71.01) for the logged off BUS sensor.

To log off a registered BUS sensor from the data logger again, use the mode selection button to navigate to the configuration mode M7x. The option for removing the first BUS sensor is shown on the display.

To log off, it is not necessary to connect the sensor to the device!

If several BUS sensors had already been connected and a BUS sensor which is not the first is to be removed, press the mode selection button until the BUS ID shows the sensor to be removed.

Briefly pressing the mode selection button now starts BUS sensor log off. After sensor log off, a message is displayed with information about the BUS ID - the message symbol in the bottom right corner of the display flashes. Briefly pressing the mode selection button closes the message.


#### 7.2 Connection of analogue sensors

 The data logger has a 10-pin terminal with two independent input channels for connecting up to two analogue sensors. Input channel 1 has pins 1, 3, 5, 7 and 9 while input channel 2 has pins 2, 4, 6, 8 and 10 (see  $\boxed{23}$ , chapter 3).

Both of the input channels support the sensor configurations listed in the following subchapters.

#### 7.2.1 Sensors for measuring voltage 0 - 1V

The sources of voltage are connected with the positive pole at terminal B and with the negative pole at terminal A, as shown in the diagram:



Important: The voltage input is a real difference input.


If the sensor is connected to the data logger via cables which are too long, it might be necessary to connect the sensor via shielded cabling. The cable shield should be connected to the GND terminal.

To register and configure sensors for measuring voltage at the data logger, follow the instructions in chapter 7.3.

# 7.2.2 Sensors for measuring current, 2-cable 4 - 20 mA and 3-cable 0 - 20 mA


The switching supports current measurement in 2-cable and 3-cable operation. For 2-cable operation, sensor supply and supply for the datalogger must have identical reference potential. In 2-cable and 3-cable operation, the sensor current is fed into the A0/A1 terminal.

#### Wiring diagram for measuring current in 2-cable operation:

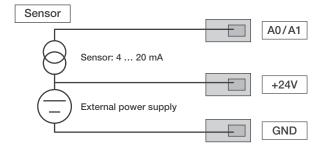

The sensor current is converted into voltage in the data logger at a load. The load has a resistance of  $<50~\Omega$ . Both the sensor and the data logger can be supplied via an external source of voltage.

## Wiring diagram for measuring current in 3-cable operation:

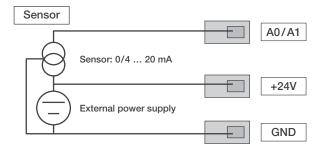


This switching is used for sensors whose own current usage is over 4 mA, such as gas sensors for example.

To register and configure sensors for measuring current at the data logger, follow the instructions in chapter 7.3.


#### 7.2.3 Pt100 sensors in 3- and 4-cable switching

 For 3-cable switching, the PT100 is connected to the measurement switching via 3 cables. The measuring current is fed into the sensor via the D0/D1 cable. The resistance of the PT100 is determined from the terminal voltages B0/B1, C0/C1 and D0/D1:



Important: The data logger is able to compensate cable resistances up to  $10 \Omega$ . The compensation typically reduces the influence of the cable resistance by a factor of 100.

For 4-cable switching, the PT100 is connected to the measurement switching via 4 cables. The measuring current is fed into the sensor via the D0/D1 and C0/C1 cable. The resistance of the PT100 is determined from the terminal currents B0/B1, A0/A1:

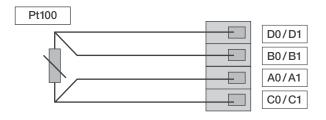


For exact temperature measurements, 4-cable switching is recommended.

To register and configure PT100 sensors at the data logger, follow the instructions in chapter 7.3.

#### 7.2.4 Thermal elements

 The data logger supports the connection of thermal elements of the types J, K and S. The thermal element is connected with the positive pole at terminal B and with the negative pole at terminal A:





Important: When connecting thermal elements, observe the polarity.

To register and configure thermal elements at the data logger, follow the instructions in chapter 7.3.

## 7.3 Configuration of analogue sensors (M81)

So that analogue sensors can be used with the data logger, their specification at the data logger must be configured correctly.

# It is only possible to configure if the data logger is not in logging mode (M3 or M4)!

To configure the sensors, use the mode selection button to navigate to the configuration mode M81 (AN0) — as described in chapter 6.2 — in order to configure the specification of a sensor for the first input channel. Alternatively, navigate to the configuration mode M81 (AN1) to configure the specification of a sensor for the second input channel. The option for configuring the first analogue sensor is shown on the display.

At initial startup, there is no sensor assignment preset in the factory; at later configurations, previous specifications are preset. Pressing and holding the mode selection button makes it possible to now change to the configuration menu for the analogue sensor specifications.

Press the mode selection button again until the desired sensor specification appears on the screen. Then, press and hold the mode selection button to confirm the desired sensor specification.

After sensor registration, a message is displayed with information about the desired sensor configuration – the message symbol in the bottom right corner of the display flashes. Briefly pressing the mode selection button closes the message.

Example LCD displays of sensor specification for registering an analogue sensor at the first input channel (ANO):



Selection for specifying no sensor assignment at the first input channel.



 
Selection of a sensor for measuring voltage 0 - 1V.



Selection of a sensor for measuring current in 2-cable operation.



Selection of a sensor for measuring current in 3-cable operation.




Selection of a PT100 sensor in 3-cable operation.



Status indicating that no sensor is registered at the first input channel.



 
Status indicating that a sensor is registered for measuring voltage 0 - 1V at the first input channel.



Status indicating that a sensor is registered for measuring current in 2-cable operation at the first input channel.



 Status indicating that a sensor is registered for measuring current in 3-cable operation at the first input channel.




Status indicating that a PT100 sensor is registered in 3-cable operation at the first input channel.



Selection of a PT100 sensor in 4-cable operation.



 Status indicating that a PT100 sensor is registered in 4-cable operation at the first input channel.



Selection of a thermal element of the *J* type at the first input channel.



Status indicating that a thermal element of the J type is registered at the first input channel.



Selection of a thermal element of the K type.



Status indicating that a thermal element of the K type is registered at the first input channel.



Selection of a thermal element of the S type at the first input channel.



Status indicating that a thermal element of the S type is registered at the first input channel.

# 8. Measured values display and data recording

#### 8.1. Channel groups and measuring channels

Each measured value in the specified measuring unit which is detected by a connected sensor represents a channel group.

A temperature sensor with the specifiable measuring units °C or °F represents for example two channel groups (temperature °C and temperature °F).

The amount of channel groups which can be detected by a BUS sensor depends on the sensor design. The BUS sensor of the TFF type can detect seven different channel groups for example.

Analogue sensors for measuring voltage and current can only detect one channel group each; analogue sensors for measuring temperature can detect two channel groups (°C and °F).

For each channel group, there are then four measuring channels for recording: Current measured value (cur), minimum measured value (min), maximum measured value (max) and average measured value (mid).

When all sensors are assigned with a total of four connected BUS sensors of the TFF type and two connected analogue PT100 sensors, the data logger can detect a total of 32 channel groups and 128 measuring channels, as shown in table 2.

## 8.2 Processing channels for converting measured values

With the SmartGraph software, analogue sensors which supply a current or voltage value can be used as processing channels for converting measured values. Processing channels make it possible to convert the input values of analogue sensors which supply a current or voltage value into the actual measured value. Measuring unit, conversion parameter and decimal points can be specified for each processing channel and assigned to a sensor type (see table 1).

Further detailed information about configuration of the processing channels in the software is provided in the software manual which you can open by using the help function of the SmartGraph software.

#### 8.3. Displaying measured values

One of the channel groups specified in table 1 for displaying measured values can be configured to be displayed on each of the three measured value rows. Here, the current measured value is always shown on the display.

#### 8.4. Data recording

If either of the operating modes M3 or M4 are selected, then the data logger is in logging mode (REC) and the measured values of the measuring channels selected for recording are saved in the device.

Up to 20 of the measuring channels specified in table 2 can be simultaneously recorded in the data memory of the measuring device.

Recording begins immediately from the moment that the operating mode M3 or M4 is selected and is carried out in ring mode. This means that when the memory limits are reached, the recording does not stop but continues to record. The older values are simply overwritten by the newest measured values.

Tip: Current, minimum, maximum and average measured values for a channel group each represent one measuring channel. If these values should be available for later documentation and evaluation, each of the measuring channels must already be selected during memory organisation for recording, because it is not possible to calculate these values in the software.

The specifications for type, duration and scope of data recording in the logging mode can be individually set in the software. Detailed information is provided in the software manual.

Table 1: Available processing channels for converting measured values

associable units:	counts, logic, digits, °C, °F, K, °Cdp, °Fdp, %rH, g/kg, g/m³, $\mu$ m, mm, cm, dm, m, km, in, mil, ft, mi, m/s, km/h, kts, ppm, mV, V, mA, A, Hz, kHz, bar, mbar, Pa, mPa, hPa, kPa, m³, I, s, ms, $\mu$ s, %, °, mm/h, m³/h, $l/m^2$ , in/h, mil/h, g, kg
associable sensor types:	temperature, relative humidity, absolute humidity, dew point, battery voltage, voltage, current, absolute air pressure, relative air pressure, building moisture, flow rate, mix ratio, CO2 concentration, particles 0.1 $\mu$ m, particles 0.2 $\mu$ m, particles 0.3 $\mu$ m, particles 0.5 $\mu$ m, particles 1 $\mu$ m, particles 5 $\mu$ m, particles 10 $\mu$ m, particles x $\mu$ m, particles y $\mu$ m, particles z $\mu$ m, unknown, inactive, wet-bulb temperature, global radiation, daylight, amount of rain, wind speed, wind direction, analogue/digital input, ground moisture, leaf wetness

Table 2: Overview of available channel groups (measured values) and measuring channels of the data logger

Sensor assign- ment	Sensor type	Channel group (measured value)	Unit	Available processing channels for converting measured	channels (max. 20 saving) a	vailable m s for data channels and for dis channels f	recording available playing	
		Temperature	°C	-	cur	min	max	mid
		Temperature	°F	-	cur	min	max	mid
DUIG	T	Dew point	°C	-	cur	min	max	mid
BUS sensor 1	e.g. TFF sensor BUS class 71	Dew point	°F	-	cur	min	max	mid
SCHSUL I		Relative humidity	%	-	cur	min	max	mid
		Absolute humidity	g/m³	-	cur	min	max	mid
		Mix ratio	g/kg	-	cur	min	max	mid
		Temperature	°C	-	cur	min	max	mid
		Temperature	°F	-	cur	min	max	mid
BUS		Dew point	°C	_	cur	min	max	mid
sensor 2	e.g. TFF sensor	Dew point	°F	_	cur	min	max	mid
(with Y distributor)	BUS class 71	Relative humidity	%	_	cur	min	max	mid
uisti ibutoi j		Absolute humidity	g/m³	_	cur	min	max	mid
		Mix ratio	g/kg	_	cur	min	max	mid
		Temperature	°C	-	cur	min	max	mid
		Temperature	°F	-	cur	min	max	mid
BUS		Dew point	°C	-	cur	min	max	mid
sensor 3	e.g. TFF sensor	Dew point	°F	_	cur	min	max	mid
(with Y distributor)	BUS class 71	Relative humidity	%	_	cur	min	max	mid
uisti ibutoi )		Absolute humidity	g/m³	_	cur	min	max	mid
		Mix ratio	g/kg	_	cur	min	max	mid
		Temperature	°C	_	cur	min	max	mid
		Temperature	°F	_	cur	min	max	mid
BUS		Dew point	°C	_	cur	min	max	mid
sensor 4	e.g. TFF sensor	Dew point	°F	_	cur	min	max	mid
(with Y	BUS class 71	Relative humidity	%	_	cur	min	max	mid
distributor)		Absolute humidity	g/m <sup>3</sup>	_	cur	min	max	mid
		Mix ratio	g/kg	_	cur	min	max	mid
	Measuring voltage 0 - 1 V	Voltage	V		cur	min	max	mid
	Measuring current in 2-cable operation 4 - 20 mA	Current	mA	yes,	cur	min	max	mid
	Measuring current in 3-cable operation 0 - 20 mA	Current	mA	see table 1	cur	min	max	mid
	PT100 temperature measurement in 3-cable operation	Temperature	°C	_	cur	min	max	mid
	PT100 temperature measurement in 3-cable operation	Temperature	°F	_	cur	min	max	mid
Analogue	PT100 temperature measurement in 4-cable operation	Temperature	°C			min		mid
sensor 1 at input	PT100 temperature measurement in 4-cable operation	Temperature	°F	_	cur	min	max max	mid
channel 1	Temperature measurement with thermal element K type	Temperature	°C			min		mid
(AnO)	Temperature measurement with thermal element K type	Temperature	°F	_	cur	min	max max	mid
	Temperature measurement with thermal element J type	Temperature	°C		cur	min		mid
	Temperature measurement with thermal element J type	Temperature	°F	_	cur		max	mid
		Temperature	°C	_	cur	min	max	
	Temperature measurement with thermal element S type Temperature measurement with thermal element S type	Temperature	°F	_	cur	min min	max max	mid mid
			V	_				
	Measuring current in 2 cable operation 4 20 mA	Voltage		yes,	cur	min	max	mid
	Measuring current in 2-cable operation 4 - 20 mA	Current	mA	see table 1	cur	min	max	mid
	Measuring current in 3-cable operation 0 - 20 mA	Current	mA °C		cur	min	max	mid
	PT100 temperature measurement in 3-cable operation	Temperature		_	cur	min	max	mid
Analogue	PT100 temperature measurement in 3-cable operation	Temperature	°F °C	-	cur	min	max	mid
sensor 2	PT100 temperature measurement in 4-cable operation	Temperature	°F	-	cur	min	max	mid
at input channel 2	PT100 temperature measurement in 4-cable operation	Temperature		-	cur	min	max	mid
(An1)	Temperature measurement with thermal element K type	Temperature	°C	-	cur	min	max	mid
(AIII)	Temperature measurement with thermal element K type	Temperature	°F	-	cur	min	max	mid
	Temperature measurement with thermal element J type	Temperature	°C	-	cur	min	max	mid
	Temperature measurement with thermal element J type	Temperature	°F	-	cur	min	max	mid
	Temperature measurement with thermal element S type	Temperature	°C	-	cur	min	max	mid
	Temperature measurement with thermal element S type	Temperature	°F	_	cur	min	max	mid

## 9. Alarm function

#### 9.1. Alarm configuration

An alarm function can be configured in the measuring device administration for each of the measuring channels selected for display or recording.

By defining an upper and lower alarm limit value, a value corridor is specified. This is the so-called good range and when the range is exited, an alarm sounds.

Note: The alarm function can only be represented on the display for the channel groups of the three measuring channels selected for measured value display, and only in the operating modes M2 and M3!

However, saving alarm results of other selected measuring channels in logging mode is independent of the selected display of the measured values. That means that the alarm results of the measuring channels which are not for display but for data recording are also recorded.

Even in the operating mode M4 when displaying measured values is deactivated, all preselected alarm results are recorded!

### 9.2. Alarm display



Example display for an alarm result of the measuring channel shown in the first measured value row.

The alarm display is only possible for measured values which are preselected for displaying and which have been configured with an active alarm function.


If an alarm occurs at one of these measuring channels, the alarm symbol flashes beside the measured value display for this channel while the good range is exited.

If the measured value then reaches the

defined value corridor, that is, the good range, then the alarm symbol stops flashing and is shown continually.

This indicates that an alarm result occurred. If the good range is exited during the course of a measurement, the alarm symbol flashes again.

Reading the measured value memory deletes the alarm display.

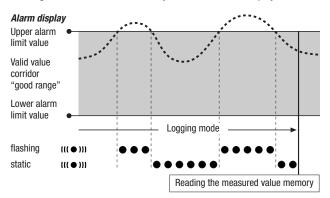

Additionally, a hysteresis can be set by which the measured value must return to the valid range to switch off the alarm.

#### 9.3. Acoustic alarm

If an alarm goes off while the acoustic function is activated (see chapter 6.2.4. Acoustic function), then and alarm tone sounds and only stops when the measured value returns to the good range.

#### 9.4. Using the alarm hysteresis


If you use the alarm function without alarm hysteresis, then an alarm sounds and is recorded each time the preset limit values are exceeded.

If your limit values have been selected very close to each other, then this means that an alarm situation occurs very often.

For example, if you set a room temperature of 24 °C as the upper alarm limit and a room temperature of 10 °C as the lower alarm limit and the room temperature continually deviates between 23.5 and 25 °C during the measuring period, then there will be many individual alarm signals created and recorded.

To prevent this, you can define an alarm hysteresis. With this setting, you define a value by which the measured value must have returned to the valid value corridor, the good range, in order to switch off the alarm.

If an alarm hysteresis of 1  $^{\circ}$ C was set, the alarm in the previous example would go off once as 24  $^{\circ}$ C was exceeded and then only stop as the temperature drops below 23  $^{\circ}$ C again.

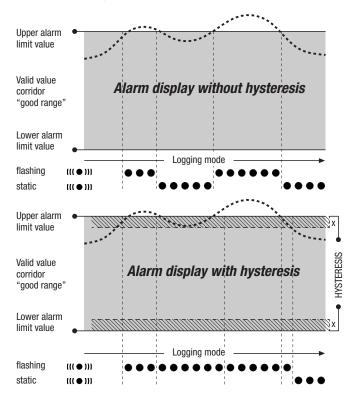

# 10. Notes on maintenance and operation

#### 10.1. Battery change

If "LO bAtt" appears in the upper row of the display, then the batteries need to be changed.

No data can be recorded while batteries are being changed. If data recording is running, pause it and ensure that the data logger is in operating mode M1 or M2 before changing the batteries.

To replace the batteries, open the battery compartment, remove the used batteries and then insert new batteries, while observing the correct poles.

The time is maintained for at least a minute during battery change, even when batteries are not inserted.

Only use appropriate batteries which comply with the technical data. Other types of batteries can cause operating errors. Do not use rechargeable batteries!

Do not dispose of used batteries in the household rubbish or throw them in the fire: instead, dispose of them according to the relevant legal requirements.

#### 10.2. Deleting measured data

The detected measured data are permanently saved in the internal Flash memory. Even when resetting the device to factory settings or when there are no batteries in the device, the measurement data remains in the memory and is not deleted.

Saved data can only be deleted via the SmartGraph3 software as a whole and not individually.



Display for deleting measured data. In the display, 6 % of the data have been deleted so far. The deletion process takes approx. 2 minutes. During this time, the following messages appears on the display: "FOMA FLSH xxx %".

During the entire deleting period, access to the device is not possible and it does not respond to requests from the Smart-Graph3 software.

After memory has been completely deleted, "FOMA FLSH 100 %" is shown

on the display. Afterwards, the display returns to normal operation.

Further detailed information about using the software is provided in the software manual which you can open from the help function of the Smart-Graph software.

#### 10.3. Positioning for mobile use

For mobile measured value recording, the data logger can be positioned at any site. Observe the permissible ambient conditions for operation (see technical data). Due to its compact dimensions, the data logger can be hidden for non-intrusive applications.

#### 10.4. Mounting on a wall

For stationary data detection, the data logger can also be mounted on a wall or a similar holding device. A mount track is included in the scope of supply for fastening.

For network operation, wall mounting is absolutely necessary.

Additional information about network operation is provided in chapter 6.2.2.

## 10.5. Moving to another site

Especially when moving from cold to warm ambient conditions, e.g. when moving into a heated room after storage in a car over night, depending on humidity in the room, condensation may form on the printed circuit board.

This physical trait can lead to false measured values. Unfortunately, it is necessary for the construction and cannot be prevented in any measuring devices. In these cases, please wait approx. 5 minutes until the measuring device has "acclimatised" before starting to measure.

# 11. Technical data

	Magazirin	0 414			
Voltage input	Measuring range	0 1 V			
0 - 1 V	Accuracy	$\pm 200~\mu V \pm 0.1~\%$ of measured value			
	Resolution	< 500 μV			
	Measuring range	2-cable operation: 4 20 mA, 3-cable operation: 0 20 mA			
Voltage	Accuracy	$\pm~4~\mu\text{A} \pm~0.1~\%$ of measured value			
measurement	Resolution	< 5 μΑ			
	Total load	approx. 50 Ω			
	Measuring range	-200 °C 1,200 °C			
Thermal element K	Accuracy	$\pm$ 1 °C $\pm$ 0.5 % of the measured value at -200 °C 0 °C, $\pm$ 1 °C $\pm$ 0.2 % of the measured value at 0 °C 1,200 °C			
	Resolution	< 0.2 °C			
	Measuring range	-200 °C 1,200 °C			
Thermal element J	Accuracy	$\pm$ 1 °C $\pm$ 0.5 % of the measured value at -200 °C 0 °C, $\pm$ 1 °C $\pm$ 0.2 % of the measured value at 0 °C 1,200 °C			
	Resolution	< 0.2 °C			
	Measuring range	-50 °C 1,700 °C			
Thermal element S	Accuracy	$\pm$ 1 °C $\pm$ 0.5 % of the measured value at -50 °C 0 °C, $\pm$ 1 °C $\pm$ 0.2 % of the measured value at 0 °C 1,700 °C			
	Resolution	< 0.2 °C			
	Measuring range	-200 °C 500 °C			
Pt100	Accuracy	$\pm$ 0.2 °C $\pm$ 0.1 % of the measured value			
	Resolution	< 0.02 °C			
	Sensing interval	10/30 s, 1/10/12/15/30 min, 1/3/6/12/24 h			
Memory	Saving interval	1/10/12/15/30 min, 1/3/6/12/24 h			
organisation	Data storage	16 MB, approx. 3,200,000 measured values			
	Data recording	up to 20 simultaneous measuring channels			
	LCD display	W 90 x H 64 mm			
	Housing	Plastic			
Configuration and	Dimensions	L 180 x W 32 x H 78 mm			
dimensions	Weight	арргох. 250 g			
	Interfaces	USB, LAN, RS485 (Sensor BUS)			
	internal	4 x LR6 AA batteries, battery life > 1 year (depending on connected sensor and configuration)			
Power supply	external	USB, LAN (PoE configuration), terminals for external power supply to supply the sensor			
	Air temperature	-20 °C to +50 °C			
Permissible operating ambient	Relative humidity	0 to 95 % RH, < 20 g/m³ (non-condensing)			
conditions	Height	10,000 m above sea level			
Scope of supply	Standard	Measuring device, CD-ROM with SmartGraph 3 PC software for representing the evaluation of measured values graphically and numerically and operating manual, USB connection cable, batteries			

# 12. Status codes

In the event of a sensor error, the following codes may appear on one of the three LCD rows instead of the measured value

**E 2C**......Initialisation error at the sensor

E 27 ......Faulty calibration data

**E 36** .......Channel disabled (e.g. channel configured in the LCD, but sensor logged off or removed)

**E 50** ......Value to be displayed too large to fit on display

**E 51** ......Value to be displayed too small to fit on display

**E 52** ......Channel value in the saturation (upper limit)

E 53 ......Channel value in the saturation (lower limit)

E 54 .......Data error. Received data are not plausible

**E 55** ......Measurement not possible of sensor not reachable

Sensor	Status	Measuring range	Code		
	Negative polarity	approx. < -0.024 V	0x53 (CHANNEL_UNDERRANGE)		
	Limit range	-0.024 V 0.000 V	Displayed: 0.000V		
0 1 V	Normal operation mode	0.000 V 1.000 V			
0 1 V	Limit range	1.000 V 1.024 V	Displayed: 1.000V		
	Overvoltage	approx. > 1.024 V	0x52 (CHANNEL_OVERRANGE)		
	Special case: open		Input floating, e.g. CHANNEL_OVERRANGE, so 0x52		
	Negative polarity	approx. < -0.48 mA	0x53 (CHANNEL_UNDERRANGE)		
	Sensor breakage	approx0.48 mA 0.30 mA	0x55 (MEAS_UNABLE)		
	Fault current	0.30 mA 3.00 mA	0x51 (VALUE_UNDERFLOW)		
4 20 mA	Limit range	3.00 mA 4.00 mA	Displayed: 04.00mA		
	Normal operation mode	4.00 mA 20.00 mA			
	Limit range	20.00 mA 20.48 mA	Displayed: 20.00mA		
	Overcurrent	approx. > 20.48 mA	0x52 (CHANNEL_OVERRANGE)		
	Negative polarity	approx. < -0.48 mA	0x53 (CHANNEL_UNDERRANGE)		
	Limit range	-0.48 mA 0.00 mA	Displayed: 0.00mA		
0 20 mA	Normal operation mode	0.00 mA 20.00 mA			
	Limit range	20.00 mA 20.48 mA	Displayed: 20.00mA		
	Overcurrent	approx. > 20.48 mA	0x52 (CHANNEL_OVERRANGE)		